



UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION IV
611 RYAN PLAZA DRIVE, SUITE 1000
ARLINGTON, TEXAS 76012

bcc to DAC:ADM:
CENTRAL FILES
PDR:HQ
LPDR
TIC
NSIC

November 26, 1979


Docket Nos. 50-313
50-368

Arkansas Power and Light Company
ATTN: Mr. William Cavanaugh III
Vice President of Generation
and Construction
P. O. Box 551
Little Rock, Arkansas 72203

Gentlemen:

The enclosed IE Circular No. 79-24 is forwarded to you for information. No written response is required. Should you have any questions related to your understanding of the recommendations on this matter, please contact this office.

Sincerely,


Karl V. Seyfrit
Director

Enclosures:

1. IE Circular No. 79-24
2. List of Recently Issued
IE Circulars

cc: James P. O'Hanlon, Plant Manager
Arkansas Nuclear One
P. O. Box 608
Russellville, Arkansas 72801

1726 314

Q 8001100 149

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

IE Circular No. 79-24
Date: November 26, 1979
Page 1 of 3

PROPER INSTALLATION AND CALIBRATION OF CORE SPRAY PIPE BREAK DETECTION EQUIPMENT
ON BWRs

Description of Circumstances:

During 1976 the Iowa Electric Light and Power Company identified and corrected a potential problem involving the Core Spray (CS) pipe break detection system at the Duane Arnold Energy Center (DAEC). The problem relates to the setpoint, function, and installation of the differential pressure (dp) instrument which monitors for a CS pipe break that is located in the annulus area of the reactor vessel (i.e., located outside the core shroud but inside the reactor vessel). The installed instrument, range of 0 - 24 psid, was found deflecting downscale (i.e., reading negative psid) during operation.

The licensee's investigation of the downscale deflection revealed that the original piping arrangement and calibration did not adequately take into account the effect of density changes of the water in the pressure leg connection. The original installation had the high pressure side of the dp instrument (see attached Figure 1) connected to the reference leg in the vessel (Figure 1 Connection X) and the low pressure side to the core spray piping outside the vessel but inside the drywell (Figure 1 Connection Y). With the piping intact, this arrangement senses the pressure difference between bottom and top of core. With a break in CS piping in the annulus area the instrument then senses the additional pressure drop across the separators (dp ~ 7 psi additional) and dryers (dp ~ 7 inches water). This installation was in accordance with GE design requirements.

Also in accordance with GE instructions the calibration of the dp instrument was performed with the reactor in the cold condition and the alarm was set to trip at 5 psid increasing. Because of this cold calibration the dp instrument then indicated full downscale negative during operation. This negative dp was due to the heat up of the reference leg (Figure 1 Connection X) which caused the fluid density to decrease as the plant reached hot conditions. The magnitude of this dp was determined to be about 3.5 psid following the conditions discussed below.

1726 315

DUPLICATE DOCUMENT

Entire document previously
entered into system under:

ANO

7910250492

No. of pages: 5