



UNITED STATES
 NUCLEAR REGULATORY COMMISSION
 REGION III
 799 ROOSEVELT ROAD
 GLEN ELLYN, ILLINOIS 60137

tic

Docket No. 50-483
 Docket No. 50-486

NOV 30 1979

Union Electric Company
 ATTN: Mr. John K. Bryan
 Vice President - Nuclear
 P. O. Box 149
 St. Louis, MO 63166

Gentlemen:

The enclosed IE Bulletin No. 79-27, is forwarded to you for information. Although no written response is required at this time, these concerns will be addressed as part of the licensing process for your plant. If you desire additional information regarding this matter, please contact this office.

Sincerely,

James G. Keppler
 for James G. Keppler
 Director

Enclosure: IE Bulletin
 No. 79-27

cc w/encl:
 Mr. W. H. Weber, Manager,
 Nuclear Construction
 Central Files
 Director, NRR/DPM
 Director, NRR/DOR
 PDR
 Local PDR
 NSIC
 TIC
 Region I & IV
 Ms. K. Drey
 Mr. Ronald Fluegge, Utility
 Division, Missouri Public
 Service Commission

1790 274

Q

7912190 246

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

SSINS No.: 6820
Accession No.:
7910250499

November 30, 1979

IE Bulletin No. 79-27

LOSS OF NON-CLASS-1-E INSTRUMENTATION AND CONTROL POWER SYSTEM BUS
DURING OPERATION

Description of Circumstances:

On November 10, 1979, an event occurred at the Oconee Power Station, Unit 3, that resulted in loss of power to a non-class-1-E 120 Vac single phase power panel that supplied power to the Integrated Control System (ICS) and the Non-Nuclear Instrumentation (NNI) System. This loss of power resulted in control system malfunctions and significant loss of information to the control room operator.

Specifically, at 3:16 p.m., with Unit 3 at 100 percent power, the main condensate pumps tripped, apparently as a result of a technician performing maintenance on the hotwell level control system. This led to reduced feedwater flow to the steam generators, which resulted in a reactor trip due to high coolant system pressure and simultaneous turbine trip at 3:16:57 p.m. At 3:17:15 p.m., the non-class-1-E inverter power supply feeding all power to the integrated control system (which provides proper coordination of the reactor, steam generator feedwater control, and turbine) and to one NNI channel tripped and failed to automatically transfer its loads from the DC power source to the regulated AC power source. The inverter tripped due to blown fuses. Loss of power to the NNI rendered control room indicators and recorders for the reactor coolant system (except for one wide-range RCS pressure recorder) and most of the secondary plant systems inoperable, causing loss of indication for systems used for decay heat removal and water addition to the reactor vessel and steam generators. Upon loss of power, all valves controlled by the ICS assumed their respective failure positions. The loss of power existed for approximately three minutes, until an operator could reach the equipment room and manually switch the inverter to the regulated AC source.

The above event was discussed in IE Information Notice No. 79-29, issued November 16, 1979.

NUREG 0600 "Investigation into the March 28, 1979 TMI Accident" also discusses TMI LER 78-021-03L whereby the RCS depressurized and Safety Injection occurred on loss of a vital bus due to inverter failure.

Actions to Be Taken by Licensees

For all power reactor facilities with completion of construction (North Anna, Sequoyah, and Zimmer):

1790 275

DUPLICATE DOCUMENT

Entire document previously
entered into system under:

ANO

7910250499

No. of pages: 4