 


DK Control File



METROPOLITAN EDISON COMPANY SUBSIDIARY OF GENERAL PUBLIC UTILITIES CORPORATION

POST OFFICE BOX 480 MIDDLETOWN, PENNSYLVANIA 17057 TELEPHONE 717-644-4041

October 31, 1974

POOR ORIGINAL

Mr. J.P. O'Reilly, Director
Directorate Of Regulatory
Region I
531 Park Avenue
King Of Prussia, Pa. 19406

Operating License DPR-50
Docket 50-289

Subject: Abnormal Occurrence No. AO 74-20

Dear Mr. O'Reilly:

This telegram is to confirm the telecon between Lee Spessard (Region I-AEC), and J.J. Colitz (THI-Unit 1 Superintendent) at 1000 hours, October 31, 1974.

The following report is submitted in accordance with paragraph 6.7.2.a.4 (page 6-11) of the technical specifications.

During an inspection of the reactor building on October 30, 1974, hydraulic shock suppressor, number PR-50, located on the pressurizer electromagnetic relief valve discharge line, was found empty of hydraulic fluid.

The main cylinder lock nut was loose which permitted the cylinder to rotate approximately 90°, hit another pipe which caused a connection between the reservoir and the hydraulic cylinder to break and drain the hydraulic fluid.

The broken fitting was replaced, the hydraulic fluid was replaced, the suppressor reoriented and the lock nut tightened.

The failed suppressor has a 2½" cylinder with a 5" piston stroke which was manufactured by Grinnel.

Very truly yours,

J.G. Werbein
J.G. Werbein
Station Superintendent

2101
-4