

Distribution

NRC PDR	VAMoore
Local PDR	RHVollmer
Docket File	← MLEP
LWR #1 File	WPGamill
RSBoyd	ELD
RCDeYoung	IE(3)
DBVassallo	WHaas
FJWilliams	JRBuchanan
JFStolz	TBAbernathy
LEngle	ACRS(16)
EHylton	
RJMattson	
DRoss	
JKnight	
RTedesco	
HDenton	

SEP 02 1977

Docket No. 50-346

Toledo Edison Company
 ATTN: Mr. Lowell E. Roe
 Vice President, Facilities
 Development
 Edison Plaza
 300 Madison Avenue
 Toledo, Ohio 43652

Gentlemen:

SUBJECT: DIESEL GENERATOR LOCKOUT - DAVIS BESSE, UNIT 1

In our review of reports submitted by licensees concerning malfunctions of diesel generators, we find that in some cases the information available to the control room operator to indicate the operational status of the diesel generator may be imprecise and could lead to misinterpretation. This can be caused by the sharing of a single annunciator station by alarms that indicate conditions that render a diesel generator unable to respond to an automatic emergency start signal and alarms that only indicate a warning of abnormal, but not disabling, conditions. Another cause can be the use of wording on an annunciator window that does not specifically say that a diesel generator is inoperable (i.e., unable at the time to respond to an automatic emergency start signal) when in fact it is inoperable for that purpose.

We, therefore, request that you review the alarm circuitry and diesel generator control circuitry for the diesel generators at your facility to determine how each condition that renders a diesel generator unable to respond to an automatic emergency start signal is alarmed in the control room. These conditions include not only the trips that lock out the diesel generator start and require manual reset, but also control switch or mode switch positions that block automatic start, loss of control voltage, insufficient starting air pressure or battery voltage, etc. This review should consider all aspects of possible diesel generator operational conditions, for example test conditions and operation from local control stations. One area of particular concern is the unreset condition following a manual stop at the local station which terminates a diesel generator test prior to resetting the diesel generator controls for enabling subsequent automatic operation.

MA 4
GD

OFFICE →						
SURNAME →						
DATE →						

F

SEP 02 1977

Toledo Edison Company

- 2 -

We request that within 45 days of your receipt of this letter that you provide the following information.

- a. all conditions that render the diesel generator incapable of responding to an automatic emergency start signal as discussed above;
- b. the wording on the annunciator window in the control room that is alarmed for each of the conditions identified in a;
- c. any other alarm signals that also cause the same annunciator to alarm;
- d. any condition that renders the diesel generator incapable of responding to an automatic emergency start signal which is not alarmed in the control room; and
- e. any proposed modifications resulting from this evaluation.

Sincerely,

Original Signed by
John F. Stolz

John F. Stolz, Chief
Light Water Reactors Branch No. 1
Division of Project Management

ccs: See page 3

OFFICE →	DPM:LWR #1	DPM:LWR #1			
SURNAME →	LEngle:mjf	JFStolz			
DATE →	9/2/77	9/2/77			

Toledo Edison Company

- 3 -

ccs: Donald H. Hauser, Esq.
The Cleveland Electric Illuminating Company
P. O. Box 5000
Cleveland, Ohio 44101

Gerald Charnoff, Esq.
Shaw, Pittman, Potts & Trowbridge
1800 M Street, N. W.
Washington, D. C. 20036

Leslie Henry, Esq.
Fuller, Seney, Henry and Hodge
300 Madison Avenue
Toledo, Ohio 43604

OFFICE →						
SURNAME →						
DATE →						