LICENSEE EVENT REPORT

v	 10	*	ı

CONTROL BLOCK []
CI A R S S 1 1 0 10 1 0 10 10 10 10 10 10 10 10 10
CONTY
EVENT DESCRIPTION AND PROBABLE CONSECUENCES (1)
On 3-22-80, after manually opening SFV-25003 (BWST isolation to DHR
[0]) [suction) several turns to increase the level in the pressurizer, an
old lattempt to close the valve electrically was unsuccessful. The motor
[0] [was observed to be operating but the shaft was not moving. The motor
ole operator was disassembled and the clutch mechanism replaced. A
o similar event in 1977 was reported via LER 77-12.
[OIE]
CODE CODE SUBCODE SUBC
LER RO EVENT YEAR SEQUENTIAL DOCCURRENCE REPORT TYPE NO.
ACTION FUTURE SEECT SMUTDOWN 24 26 27 28 29 33 31 32 TAKEN ACTION OVERLAND WEEKON ACTION OF THE PROPERTY OF THE P
TA (18) X (19) Z (20) LO 10 10 10 1 Y (20) 1 Y (20) 1 A (
The worm shaft clutch and clutch gear exhibited excessive wear, thereby
preventing proper engagement. The defective parts were replaced with
new components which per the vendor are manufactured of an improved
material and heat treating process. The redundant valve will be
inspected and components replaced if warranted.
STATUS STONER OTHER STATUS 30 METHOD OF DISCOVERY
ACTIVITY CONTEST 12 13 Operator observation
AVOUNT OF ACTIVITY (35) N/A N/A N/A N/A N/A N/A
N/A
PERSONNEL INJURIES AUMBER DESCRIPTION (41)
N/A .
OSS OF CH DAVAGE TO FACILITY (1) Z
SSU(C DISCALPTION 45) NAC USE ONLY Local newspapers and wire services. (4-4-80)
NAME OF PREPARER R. W. Colombo 916-452-3211
B004210 262
5007210000