



UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION II
101 MARIETTA ST., N.W., SUITE 3100
ATLANTA, GEORGIA 30303

MAY 8 1980

In Reply Refer To:

RII:JPO

 
50-395

South Carolina Electric and Gas Company
Attn: M. C. Johnson, Vice President
Special Services and Purchasing
P. O. Box 764
Columbia, SC 29218

Gentlemen:

Enclosed is IE Bulletin No. 80-11 which is forwarded to you for information. No written response is required. Should you have any questions regarding this matter, please contact this office.

Sincerely,


James P. O'Reilly
Director

Enclosures:

1. IE Bulletin No. 80-11
2. List of Recently Issued
IE Bulletins

8006060485

MAY 8 1980

South Carolina Electric
and Gas Company

-2-

cc w/encl:

T. B. Conners, Jr.
Conners, Moore and Corber
1747 Pennsylvania Avenue, N.W.
Washington, D.C. 20006

A. A. Smith
Quality Assurance
Post Office Box 8
Jenkinsville, South Carolina 29065

O. S. Bradham, Manager
Nuclear Operations
Post Office Box 8
Jenkinsville, South Carolina 29065

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

SSINS No.: 6820
Accession No.:
7912190695

May 8, 1980

IE Bulletin No. 80-11

MASONRY WALL DESIGN

Description of Circumstances:

In the course of conducting inspections pursuant to IE Bulletin Nos. 79-02 and 79-14 at the Trojan Nuclear Plant, Portland General Electric Co. (PGE) identified a problem with the structural integrity of concrete masonry walls with Seismic Category I piping attached to them. This problem was briefly addressed in IE Information Notice No. 79-28, which was sent to all Construction Permit and Operating License holders on November 16, 1979 (Attachment 1).

The problem was that some walls were found which did not have adequate structural strength to sustain the required piping system support reactions. These structural deficiencies were at that time reported to be attributable to two deficiencies:

- 1) Apparent lack of a final check of certain pipe support locations and reactions to ensure that the supporting elements possessed adequate structural integrity to sustain the required loads.
- 2) Non-conservative design criteria for the reactions from supports anchored into the face of concrete masonry walls; e.g., relying on the combined strength of double block walls without substantial positive connection between the two walls by means other than the bond provided by a layer of mortar, grout or concrete between them.

Continued investigations into the deficiencies identified at the Trojan Nuclear Plant, engineered by Bechtel, confirmed the deficiencies to be attributable to error in engineering judgment, lack of procedures and procedural detail, and inadequate design criteria (details are in Trojan Nuclear Plant's LER No. 79-15, and supplements). Because of this and the generic implications of similar deficiencies with other operating facilities, we have concerns with regard to the adequacy of design criteria used for the design of masonry walls and an apparent lack of design coordination between the structural and piping/equipment design groups.

IE Bulletin 79-02, Revision 2 issued on [redacted] pipe supports attached to masonry wall pipe supports in this category, the ex bolting through the wall or the support Supports that are bolted through mason review for this Bulletin.

DUPLICATE DOCUMENT

Entire document previously
entered into system under:

AND 7912190695

No. of pages: 4

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

November 16, 1979

Attachment 1
SSINS No.: 6870
Accession No.:
7910250475

Dupe.

IE Information Notice No. 79-28

OVERLOADING OF STRUCTURAL ELEMENTS DUE TO PIPE SUPPORT LOADS

Description of Circumstances:

Recently, the NRC was informed that, in the course of the inspections pursuant to IE Bulletin No. 79-02 and 79-14 by the Portland General Electric Co. (PGE) at the Trojan Nuclear Plant, some walls were found which did not have adequate structural strength to sustain the required support reactions. Bechtel Corporation was the Architect Engineer for the plant. These structural inadequacies were reported to be attributable to two deficiencies:

- 1) Apparent lack of a final check of certain pipe support locations and reactions to ensure that the supporting structural elements possessed adequate structural integrity to sustain the required loads.
- 2) Inadequate design criteria for the reactions from supports anchored into the face of concrete block walls; e.g., relying on the combined strength of double concrete block walls without positive connection between the two walls by means other than the bond provided by layer of grout between them.

The NRC is currently pursuing these issues in detail for the Trojan Nuclear Plant to determine the extent of these deficiencies and the generic implications for other Bechtel facilities.

This Information Notice is provided as an early notification of a possible significant matter. It is expected that recipients will review the information for possible applicability to their facilities and the actions being performed under IE Bulletin No. 79-02. Specific action is being requested relating to the adequacy of attachments to concrete block walls under IE Bulletin No. 79-02, Revision 2, item 5.c. No specific actions are requested in response to this Information Notice. If NRC evaluations so indicate, further licensee actions may be requested or required. If you have any questions regarding this matter, please contact the Director of the appropriate NRC Regional Office.

No written response to this IE Information Notice is required.

IE Bulletin No. 80-11
May 8, 1980

Enclosure

RECENTLY ISSUED
IE BULLETINS

Bulletin No.	Subject	Date Issued	Issued To
80-11	Masonry Wall Design	5/8/80	All power reactor facilities with an OL or CP
80-10	Contamination of Nonradioactive System and Resulting Potential for Unmonitored, Uncontrolled Release to Environment	5/6/80	All power reactor facilities with an OL or CP
80-09	Hydramotor Actuator Deficiencies	4/17/80	All power reactor operating facilities and holders of power reactor construction permits
80-08	Examination of Containment Liner Penetration Welds	4/7/80	All power reactors with a CP and/or OL no later than April 7, 1980
80-07	BWR Jet Pump Assembly Failure	4/4/80	All GE BWR-3 and BWR-4 facilities with an OL
80-06	Engineered Safety Feature (ESF) Reset Controls	3/13/80	All power reactor facilities with an OL
80-05	Vacuum Condition Resulting In Damage To Chemical Volume Control System (CVCS) Holdup Tanks	3/10/80	All PWR power reactor facilities holding OLs and to those with a CP
79-01B	Environmental Qualification of Class IE Equipment	2/29/80	All power reactor facilities with an OL
80-04	Analysis of a PWR Main Steam Line Break With Continued Feedwater Addition	2/8/80	All PWR reactor facilities holding OLs and to those nearing licensing
80-03	Loss of Charcoal From Standard Type II, 2 Inch, Tray Adsorber Cells	2/6/80	All holders of Power Reactor OLs and CPs
80-02	Inadequate Quality Assurance for Nuclear	1/21/80	All BWR licenses with a CP or OL
80-01	Operability of ADS Valve Pneumatic Supply	1/11/80	All BWR power reactor facilities with and OL