P. A. Morris, Director, Office of Operations Evaluation

J. P. O'Reilly, Director, Region I

N. C. Moseley, Director, Region II

J. G. Keppler, Director, Region III

E. M. Howard, Director, Region IV

R. H. Engelken, Director, Region V

PROPOSED BULLETIN - MISAPPLICATION OF CRANE COMPANY TEN-INCH VALVE

We propose to issue the enclosed Bulletin the week of September 9, 1974.

Your comments will be appreciated prior to close of business September 11, 1974. Regional comments may be called to the appropriate Regional Coordinator.

> Original signed by J. G. Davis

John G. Davis, Deputy Director for Field Operations

Enclosure: As Stated

cc: H. D. Thornburg Regional Coordinators POOR ORIGINAL

(50-269,270

	0-53) AECM 0240	GPO C43	10 0		897	
DATE	9/4/74	********************	16 81465-1	520-284		
SURNAME	JGDavis viim					
OFFICE	. 12		***************	- crapted become consequences that the consequences		
	RO:DDFO		****************			

8001020 892

MISAPPLICATION OF CRANE COMPANY 10 INCH 300 POUND CAST ALLOY STEEL VALVE - CATALOG NUMBER 151 1/2 LU.

A recent unusual event report submitted by a licensee of a PWR plant, supplied by B&W, indicated the failure of valve internals in a valve in the low pressure injection system. This has been the third failure of this nature in a two year period.

A. Description of Circumstances

The low pressure injection system was being operated in the decay heat removal mode when it was noted that flow could not be throttled below 4000 gpm. The system had been in operation for an extended period at flows less than 3000 gpm. Visual inspection of the valve revealed that the guide pin on the base of the valve disc had broken off. Previous failures had been with the disc guide bar and the disc guide pin.

The valve manufacturer advised the licensee that this valve was not intended for regulating service. Operation in a regulating mode causes vibration and/or cavitation and results in failure.

B. Action Requested

Please supply this office, in writing within 30 days after receipt of this bulletin, the following requested information:

- 1. Are similar valves used in any safeguard system in your facility?
- 2. Are they used as flow regulating or throttle valves?
- 3. If the valves are used for flow regulation or as throttle valves,

dupe

what action have you taken or do you plan to take to minimize the potential for failure of valve internals?

4. If this bulletin does not apply to your facility, a negative report is requested.