



UNITED STATES
ATOMIC ENERGY COMMISSION
DIRECTORATE OF REGULATORY OPERATIONS
REGION III
799 ROOSEVELT ROAD
GLEN ELLYN, ILLINOIS 60137

TELEPHONE
(312) 858-2660

DEC 17 1974

Consumers Power Company
ATTN: Mr. Stephen H. Howell
Vice President
1945 Parnall Road
Jackson, Michigan 49201

Docket No. 50-329
Docket No. 50-330

Gentlemen:

The enclosed RO Bulletin requests action by you with regard to your power reactor facilities with operating license or construction permit.

Should you have questions regarding this Bulletin or actions requested of you, please contact this office.

Sincerely,

James G. Keppler
Regional Director

Enclosure:
RO Bulletin 74-16

THIS DOCUMENT CONTAINS
POOR QUALITY PAGES

Approved by GAO, B-180225 (R0072), clearance expires
7/31/77. Approval was given under a blanket clearance
specifically for identified generic problems.

bcc: DR Central Files
RO Files
PDR
Local PDR
K. Callen
W. North
M. Cherry

8006120 735

Q

✓

10

December 17, 1974
DRO Bulletin No. 74-16

IMPROPER MACHINING OF PISTONS IN COLT INDUSTRIES (FAIRBANKS-MORSE)
DIESEL-GENERATORS

We recently received information from Northeast Nuclear Energy Company (NNECO), Baltimore Gas and Electric Company (BG&E), and Colt Industries describing a deficiency in the machining of pistons in a Fairbanks-Morse emergency diesel generator, type H7B.

DESCRIPTION OF CIRCUMSTANCES:

NNECO reported that the four capscrews retaining a piston insert in an upper piston of the diesel engine had broken away and were found lying in the engine crankcase. The capscrews were found during a routine field inspection prior to operating the equipment.

NNECO's and Colt Industries' investigations indicated that the cause of the failure was improper machining of the underside of the piston crown. The improper machining left an elevated, ring-shaped surface inside the piston. This prevented the piston and piston insert from mating properly. As a result, during the compression cycle, the resultant space between the surfaces of the two parts allowed the piston crown to flex and be forced down on the insert surface. This subjected the capscrews to an alternating stress, causing their eventual failure.

During the inspection of the remaining pistons, two other pistons were found with the same machining error. However, the capscrews in these pistons had not failed.

BG&E reported that they had found two incorrectly machined pistons. In addition, they found that several locking strips, which are attached to each pair of capscrews, had cracked at the bolt-hole locations.

Colt Industries stated that the probable cause of the failure of the locking strips was an improper torque sequencing of the capscrews during installation.

Colt industries indicated that they have initiated a program, directed by their service representatives, to inspect all diesel generators in the field that could have these conditions.

*dupe of
8006060540*

ACTION REQUESTED OF LICENSEES:

1. Notify this office in writing within 20 days whether engines of the make and type described above are used at your nuclear power facilities with operating license or construction permit.
2. If engines of this make and type are used, your written reply to item 1 above should include your schedule for examination of the potentially affected engines.
3. Upon completion of any required examinations, provide to this office, in writing within 30 days, the results of the examinations and a description of any repairs found to be necessary.