

LICENSEE EVENT REPORT

CONTROL BLOCK: (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

01 | A | L | J | M | F | 2 | 0 | 0 | - | 0 | 0 | 0 | 0 | 0 | - | 0 | 0 | 3 | 4 | 1 | 1 | 1 | 1 | 4 | 5

01 | L | 0 | 5 | 0 | 0 | 0 | 3 | 6 | 4 | 7 | 1 | 2 | 0 | 9 | 8 | 0 | 3 | 9

02 | On 12-9-80 APCo determined that certain Unit 2 concrete block walls did not meet
03 | seismic operational requirements, due to deviations from original design (i.e. portions
04 | of vertical reinforcing and/or accompanying grout were omitted). An engineering evalua-
05 | tion has determined that a total of 50 walls may be effected. Of the 50 total, 27
06 | have safety related piping, conduit or equipment attached to the wall or are position-
07 | ed such that should their failure occur during a seismic event, damage to safety re-
08 | lated equipment might occur. The remaining 23 total do not fall in the above category.

09 | Z | Z | B | C | z | z | z | z | z | z | z | z | Z | Z | 11 | 12 | 13 | 14 | 15 | 16

17 | 8 | 0 | 0 | 0 | 3 | 0 | 1 | T | 0 | X | X | Z | Z | 0 | 0 | 0 | 0 | Y | N | Z | Z | 19 | 19 | 19 | 26

10 | This occurrence is attributable to construction activities not being performed in
11 | accordance with design drawings. APCo plans to obtain design approved corrective
12 | action and implement the design approved corrective action. Additional details will
13 | be submitted in a follow-up to this report.

15 | Z | 0 | 0 | 0 | NA | IE Bulletin 80-11 Testing

16 | Z | Z | NA

17 | 0 | 0 | 0 | NA

18 | 0 | 0 | 0 | NA

19 | Z | NA

20 | Z | NA

NAME OF PREPARER: W. G. Hairston PHONE:

8012300547

9267-1-15 GPO

LER No. 80-003/01T-0

Page 2

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (continued)

This report is being submitted under Tech. Spec. 6.9.12i. The health/safety of the public were not affected by this occurrence.