



720

UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
REGION I  
631 PARK AVENUE  
KING OF PRUSSIA, PENNSYLVANIA 19406

Docket No. 50-334

JAN 27 1981

Duquesne Light Company  
ATTN: Mr. C. N. Dunn  
Vice President  
Operations Division  
435 Sixth Avenue  
Pittsburgh, Pennsylvania 15219

1981 JAN 29 AM 9 12

RECEIVED REGISTRATION  
SERVICES UNIT

Gentlemen:

The enclosed IE Bulletin No. 81-01, "Surveillance of Mechanical Snubbers," is forwarded to you for action. A written response is required.

In order to assist the NRC in evaluating the value/impact of each Bulletin on licensees, it would be helpful if you would provide an estimate of the manpower expended in conduct of the review and preparation of the report(s) required by the Bulletin. Please estimate separately the manpower associated with corrective actions following identification of problems through the Bulletin.

If you desire additional information regarding this matter, please contact this office.

Sincerely,

*Boyce H. Grier*  
Boyce H. Grier  
Director

Enclosures:

1. IE Bulletin No. 81-01
2. List of Recently Issued IE Bulletins

CONTACT: D. L. Capton  
(215-337-5266)

cc w/encls:

- F. Bissert, Technical Assistant Nuclear
- R. Washabaugh, QA Manager
- J. Werling, Station Superintendent
- G. Moore, General Superintendent, Power Stations Department
- J. J. Carey, Director of Nuclear Operations
- R. Martin, Nuclear Engineer
- J. Sieber, Superintendent of Licensing and Compliance, BVPS

8102180 136

Q

SSINS No.: 6820  
Accession No.:  
8005050075

UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
OFFICE OF INSPECTION AND ENFORCEMENT  
WASHINGTON, D.C. 20555

IE Bulletin No. 81-01  
January 27, 1981  
Page 1 of 7

SURVEILLANCE OF MECHANICAL SNUBBERS

Description of Circumstances:

Several instances of failures of mechanical snubbers supplied by International Nuclear Safeguards Corporation (INC) have been identified that indicate possible deficiencies in these snubbers. A summary of the failures that have occurred is provided below:

1. On August 9, 1974, the Tennessee Valley Authority submitted event report BFAO-50-260/741W identifying 11 of 14 INC Model MSVA-1A snubbers that were found inoperable on Browns Ferry Nuclear Power Station Unit 2 and subsequently identified 5 of 14 inoperable units on Browns Ferry Nuclear Power Unit No 3. All of these units were found to be frozen, and the cause was attributed to a failure to lubricate the parts during assembly. The failed snubbers were replaced with new units produced by the same manufacturer.
2. On April 12, 1976, the St. Lucie Plant Unit 1 facility of Florida Power and Light Company submitted event report No. 50-335-76-9 wherein five INC Model MSVA-1 snubbers were identified as inoperable because they were found to be frozen. The failures were caused by oxidation on the internals and by improper assembly. All INC mechanical snubbers were replaced with units produced by another manufacturer.
3. On April 8, 1977, Iowa Electric Light and Power Company submitted event report No. 77-23 for the Duane Arnold Energy Center facility that identified 13 INC Model 1MSVA-1 Type AS snubbers to be frozen; the cause of failure was attributed to large amounts of interior oxidation. The units were replaced with those produced by another manufacturer.
4. On December 5, 1979, personnel from the Nuclear Regulatory Commission visited Department of Energy (DOE) facilities at Richland, Washington, to obtain information on DOE experience with INC snubbers at the Fast Flux Test Facility (FFTF). The DOE-owned 4,000 mechanical pipe restraints (snubbers) at the FFTF examined more than 800 of these

DUPLICATE DOCUMENT

Entire document previously  
entered into system under:

ANO 8005050075

No. of pages: 8