

LICENSEE EVENT REPORT

LER 77-4130

CONTROL BLOCK

--	--	--	--	--	--	--	--	--	--

[PLEASE PRINT ALL REQUIRED INFORMATION]

LICENSEE NAME: [01] [] [] [] [] [] [] [] [] []
LICENSE NUMBER: [00] [00] [00] [00] [00] [00] [00] [00] [00] [00]
LICENSE TYPE: [4] [1] [1] [1] [1] [1]
EVENT TYPE: [0] [3]

CATEGORY: [01] CONT [] []
REPORT TYPE: [L] []
REPORT SOURCE: [L] []
DOCKET NUMBER: [0] [5] [0] [0] [2] [1] [3]
EVENT DATE: [0] [5] [3] [1] [7] [7]
REPORT DATE: [0] [6] [3] [0] [7] [7]

EVENT DESCRIPTION

[02] On two occasions, during installation of new style spent fuel racks, the overhead
[03] crane control malfunctioned, lifting one of the fuel racks approximately 12 inches
[04] and 6 inches respectively and also lifting the adjacent attached racks. The
[05] involved racks were removed from the pool for examination, found un-damaged and
[06] re-installed.

SYSTEM CODE: [F] [D]
CAUSE CODE: [E]
COMPONENT CODE: [C] [K] [T] [B] [R] [K]
PRIME COMPONENT SUPPLIER: [N]
COMPONENT MANUFACTURER: [X] [9] [9] [9]
VIOLATION: [N]

CAUSE DESCRIPTION

[08] Mechanical wear of the "UP" pushbutton internal mechanism caused the button to
[09] stick in the depressed position instead of returning to neutral when released.
[10] The "UP", "DOWN" and "OFF" buttons and internals were replaced.

FACILITY STATUS: [E]
POWER: [1] [0] [0]
OTHER STATUS: [N/A]
METHOD OF DISCOVERY: [A]
DISCOVERY DESCRIPTION: [N/A]

FORM OF ACTIVITY RELEASED: [Z]
CONTENT OF RELEASE: [Z]
AMOUNT OF ACTIVITY: [N/A]
LOCATION OF RELEASE: [N/A]

PERSONNEL EXPOSURES

[13] NUMBER: [0] [0] [0] TYPE: [Z] DESCRIPTION: [N/A]

PERSONNEL INJURIES

[14] NUMBER: [0] [0] [0] DESCRIPTION: [N/A]

OFFSITE CONSEQUENCES

[15] [N/A]

LOSS OR DAMAGE TO FACILITY

[16] TYPE: [Z] DESCRIPTION: [N/A]

PUBLICITY

[17] [N/A]

ADDITIONAL FACTORS

[18] Cause Description(Cont') The malfunction on the 2nd occasion was due to a loose
[19] wire short in the pushbutton "UP" circuit.

8103040823 Marshall S. Morris

PHONE: 203-267-2556