



74

UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION I
631 PARK AVENUE
KING OF PRUSSIA, PENNSYLVANIA 19406

July 24, 1980

Docket Nos. 50-317
50-318

Baltimore Gas and Electric Company
ATTN: Mr. A. E. Lundvall, Jr.
Vice President, Supply
P. O. Box 1475
Baltimore, Maryland 21203

Gentlemen:

The enclosed IE Bulletin No. 80-18, "Maintenance of Adequate Minimum Flow Thru Centrifugal Charging Pumps Following Secondary Side High Energy Line Rupture," is forwarded to you for action. A written response is required.

In order to assist the NRC in evaluating the value/impact of each Bulletin on licensees, it would be helpful if you would provide an estimate of the manpower expended in conduct of the review and preparation of the report(s) required by the Bulletin. Please estimate separately the manpower associated with corrective actions necessary following identification of problems through the Bulletin.

If you desire additional information regarding this matter, please contact this office.

Sincerely,

James M. Allan
Boyce H. Grier
Director

Enclosures:

1. IE Bulletin No. 80-18 and Enclosure with 2 Attachments
2. List of Recently Issued IE Bulletins

CONTACT: E. G. Greenman
(215-337-5267)

cc w/encls:

- R. M. Douglass, Manager, Quality Assurance
- L. B. Russell, Plant Superintendent
- T. Sydnor, General Supervisor, Operations QA
- R. C. L. Olson, Principal Engineer
- J. Deegan, Assistant General Supervisor, Programs Unit
- J. A. Tiernan, Manager, Nuclear Power
- R. E. Denton, General Supervisor, Training and Technical Services

8008220084

Enclosure 1

SSINS No.: 6820
Accession No.:
8005050062

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

IE Bulletin No. 80-18
Date: July 24, 1980

MAINTENANCE OF ADEQUATE MINIMUM FLOW THRU CENTRIFUGAL CHARGING PUMPS
FOLLOWING SECONDARY SIDE HIGH ENERGY LINE RUPTURE

Description of Circumstances:

Letters similar to the May 8, 1980 notification made pursuant to Title 10 CFR Part 21 (enclosure) were sent from Westinghouse to a number of operating plants and plants under construction (list, within enclosure) in early May, 1980.

The letters and the enclosed "Part 21" letter contain a complete description of the potential problem summarized below. The letters indicated that under certain conditions the centrifugal charging pumps (CCPs) could be damaged due to lack of minimum flow before presently applicable safety injection (SI) termination criteria are met. The particular circumstances that could result in damage vary somewhat from plant to plant, but involve unavailability of the pressurizer power operated relief valves (PORVs), with operation of one or more CCPs repressurizing the reactor during SI following a secondary system high energy line break. Since the SI signal automatically isolates the CCP mini-flow return line, the flow through the CCPs is determined by the individual pump characteristic head vs. flow curve, the pressurizer safety valve setpoint, and the flow resistances and pressure losses in the piping and in the reactor core. That minimum flow may not be adequate to insure pump cooling, and resulting pump damage could violate design criteria before current SI termination criteria are met.

Westinghouse recommends that plant specific calculations outlined in the letter (enclosure) be performed to determine if adequate minimum flow is assured under all conditions. If adequate minimum flow is not assured, Westinghouse recommends specific equipment and procedure modifications which will result in adequate minimum flow. The recommended modifications assure availability of the necessary minimum flow by assuring that the mini-flow bypass line will be open when needed, but will be closed at lower pressures when the extra flow resulting from bypass line closure might be necessary for core cooling.

DUPLICATE DOCUMENT

Entire document previously
entered into system under:

ANO 8005050062

No. of pages: 13