

UNITED STATES NUCLEAR REGULATORY COMMISSION REGION II 101 MARIETTA ST., N.W., SUITE 3100 ATLANTA, GEORGIA 30303 NOV 2 1 1980

In Reply Refer To: RII:JPO 50-437

> Offshore Power Systems ATTN: A. R. Collier, President P. O. Box 8000 Jacksonville, FL 32211

Jentlemen:

Enclosed is IE Bulletin No. 80-24 which is transmitted for information with regard to your nuclear power facility.

Should you have any questions regarding this Bulletin, please contact this office.

Sincerely,

James P. O'Reilly Director

Enclosures:

- 1. IE Bulletin No. 80-24
- List of Recently Issued IE Bulletins





SSINS No.: 6820 Accession No.: 8008220270

UNITED STATES OFFICE OF INSPECTION AND ENFORCEMENT WASHINGTON, D.C. 20555

November 21, 1980

IE Bulletin No. 80-24: PREVENTION OF DAMAGE DUE TO WATER LEAKAGE INSIDE CONTAINMENT (OCTOBER 17, 1980 INDIAN POINT 2 EVENT)

Desc iption of Circumstances:

On O tober 24, 1986 IE Information Notice No. 80-37 described an event that occu red at the Indian Point Unit 2 (IP-2) facility. On October 17, 1980, upon containment entry for repair to a nuclear instrument, it was discovered that several inches of water had accumulated on the containment floor without the operators' knowledge. This accumulation was later determined to have amounted to over 100,000 gallons which flooded the reactor vessel pit and wetted the lower nine feet of the reactor vessel while the reactor was at operating

The flooded condition resulted from the following combination of conditions: (1) There were significant multiple service water leaks from piping and fan coolers onto the containment floor. This system had a history of leakage; (2) Both containment sump pumps were inoperable, one due to blown fuses and the other due to binding of its float switch; (3) The significance of two containment sump level indicating lights which indicated that the water level was continuously above the pump-down level was not recognized by the operators; (4) There was no high water level alarm and the range of sump level indicating lights failed to indicate the overflowing sump level; (5) The moisture level indicators for the containment atmosphere did not indicate high moisture levels, apparently due to an error in calibration and/or ranging which made them insensitive to the moisture levels resulting from relatively small cold water leaks; (6) The hold-up tanks which ultimately receive water pumped from the containment sump also received water from other sources (Unit 1 process water, lab drain water, etc). These other water sources masked the effect of cessation of water flows from the Unit 2 sump; (7) The fan cooler condensate wier level measuring instruments were not properly calibrated; (8) There was no water level instrumentation in the reactor vessel pit and the pumps were ineffective since they discharge to the containment floor for ultimate removal by the containment sump pumps.

This Bulletin is issued to enable the NRC staff to formulate requirements for long term generic corrective actions which will be the subject(s) of future NRC actions. The bulletin requires short term actions which will preclude IP-2 type events at other plants in the interim before the longer term generic actions are accomplished.

IEB 80-24 November 21, 1980 Page 2 of 3

Actions to be Taken by Licensees:

*

- Provide a summary description of all open* cooling water systems present inside containment. Your description of the cooling water systems must include: (a) Mode of operation during routine reactor operation and in response to a LOCA; (b) Source of water a... typical chemical content of water; (c) Materials used in piping and coolers; (d) Experience with system leakage; (e) History and type of repairs to coolers and piping systems (i.e., replacement, weld, braze, etc.); (f) Provisions for isolating portions of the system inside containment in the event of leakage including vulnerability of those isolation provisions to single failure; (g) Provisions for testing isolation valves in accordance with Appendix J to 10 CFR 50 (h) Instrumentation (pressure, dew point, flow, radiation detection, etc.) and procedures in place to detect leakage; and (i) Provisions to detect radioactive contamination in service water discharge from containment.
- For plants with open cooling water systems inside containment take the following actions:
 - a. Verify existence or provide redundant means of detecting and promptly alerting control room operators of a significant accumulation of water in containment (including the reactor vessel pit if present).
 - b. Verify existence or provide positive means for control room operators to determine flow from containment sump(s) used to collect and remove water from containment.
 - c. Verify or establish at least monthly surveillance procedures, with appropriate operating limitations, to assure plant operators have at least two methods of determining water level in each location where water may accumulate. The surveillance procedures shall assure that at least one method to remove water from each such location is available during power operation. In the event either the detection or removal systems become inoperable it is recommended that continued power operation be limited to seven days and added surveillance measures be instituted.
 - d. Review leakage detection systems and procedures and provide or verify ability to promptly detect water leakage in containment, and to isolate the leaking components or system. Periodic containment entry to inspect
- * An Open system utilizes an indefinite volume, such as a river, so that leakage from the system could not be detected by inventory decrease. In addition, a direct radioactive pathway might exist to outside containment in the event of a LOCA simultaneous with a system leak inside containment. A closed system utilizes a fixed, monitored volume such that leakage from the system could be detected from inventory decrease and a second boundary exists to prevent loss of containment integrity as a result of a system leak inside containment.

IEB 80-24 November 21, 1980 Page 3 of 3

for leakage should be considered.

e. Beginning within 10 days of the date of this bulletin, whenever the reactor is operating and until the measures described in (a) through (d) above are implemented, conduct interim surveillance measures. The measures shall include where practical (considering containment atmosphere and ALARA considerations) a periodic containment inspection or remote visual surveillance to check for water leakage. If containment entry is impractical during operation, perform a containment inspection for water leakage at the first plant shutdown for any reason subsequent to receipt of this bulletin.

- f. Establish procedures to notify the NRC of any service water system leaks within containment via a special licensee event report (24 hours with written report in 14 days) as a degradation of a containment boundary.
- For plants with <u>closed</u> cooling water systems inside containment provide a summary of experiences with cooling water system leakage into containment.
- 4. Provide a written report, signed under oath or affirmation, under the provisions of Section 182a of the Atomic Energy Act of 1954, in response to the above items within 45 days of the date of this bulletin. Include in your report where applicable, your schedule for completing the actions in response to items 2 (a) through (d). Your response should be sent to the Director of the appropriate Regional Office with a copy forwarded to the Director, NRC, Office of Inspection and Enforcement, Washington, D.C. 20555.

If you desire additional information regarding this matter please contact the appropriate IE Regional Office.

Approved by GAO, B180225 (R0072); clearance expires November 30, 1980. Approval was given under a blanket clearance specifically for identified generic problems.

IEB 80-24 November 21, 1980

RECENTLY ISSUED IE BULLETINS

| Bulletin No. | Subject | Date Issued | Issued Te |
|---------------------------|---|-------------|--|
| 80-24 | Prevention of Damage Due to Water Leakage Inside Con- tainment (October 17, 1980 Indian Point 2 Event) | 11/21/80 | All nuclear power facilities with an OL or CP |
| 80-23 | Failures of Solenoid Valves Manufactured by Valcor Engineering Corporation | 11/14/80 | All nuclear power facilities with an OL or CP |
| 80-22 | Automation Industries, Model 200-520-008 Sealed- Source Connectors | 9/11/80 | All radiography licensees |
| 80-21 | Valve yokes supplied by Malcolm Foundry Company, Inc. | 11/6/80 | All light water reactor facilities holding OLs or CPs |
| Supplement 3 to 79-10B | Environmental Qualification of Class 1E Equipment | 10/24/80 | All power reactor facilities with an OL |
| Supplement 2 to 79-01B | Environmental Qualification of Class 1E Equipment | 9/30/80 | All power reactor facilities with an OL |
| 80-22 | Automation Industries, Model 200-520-008 Sealed- source Connectors | 9/11/80 | All radiography licensees |
| 79-26 Revision 1 | Boron Loss from BWR Control Blades | 8/29/80 | All BWR power facilities with an OL |
| 80-20 | Failures of Westinghouse Type W-2 Spring Return to Neutral Control Switches | 7/31/80 | To each nuclear power facility in your region having an OL or a CP |
| 80-19 | Failures of Mercury- Wetted Matrix Relays in Reactor Protective Systems of Operating Nuclear Power Plants Designed by Combus- tion Engineering | 7/31/80 | All nuclear power facilities having either an OL or a CP |
| 80-18 ; | Maintenance of Adequate Minimum Flow Thru Centrifugal Charging Pumps Following Secondary Side High Energy Line Rupture | 7/24/80 | All PWR power reactor facilities holding OL and to those PWRs nearing licensing |