



UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION I
631 PARK AVENUE
KING OF PRUSSIA, PENNSYLVANIA 19406

DEC 13 1980

Docket Nos. 50-277
50-278

Philadelphia Electric Company
ATTN: Mr. S. L. Daltroff
Vice President
Electric Production
2301 Market Street
Philadelphia, Pennsylvania 19101

Gentlemen:

The enclosed Supplement No. 4 to IE Bulletin No. 80-17, "Failure of Control Rods to Insert During a Scram at a BWR" is forwarded to you for action. A written response is required.

In order to assist the NRC in evaluating the value/impact of each Bulletin on licensees, it would be helpful if you would provide an estimate of the manpower expended in conduct of the review and preparation of the report(s) required by the Bulletin. Please estimate separately the manpower associated with corrective actions following identification of problems through the Bulletin.

If you desire additional information regarding this matter, please contact this office.

Sincerely,

James M. Allan
Boyce H. Grier
Director

Enclosures:

1. Supplement No. 4 to IE Bulletin No. 80-17
2. List of Recently Issued IE Bulletins

CONTACT: D. L. Capton
(215-337-5266)

cc w/encls:

W. T. Ullrich, Station Superintendent
Troy B. Conner, Jr., Esquire
Eugene J. Bradley, Esquire
Raymond L. Hovis, Esquire
Michael J. Scibinico, II, Assistant Attorney General

8101070

069

Q

SSINS No.: 6820
Accession No.:
8006190074
IEB 80-17 Sup. 4

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

December 18, 1980

IE Supplement 4 to Bulletin No. 80-17: FAILURE OF CONTROL RODS TO INSERT
DURING A SCRAM AT A BWR

NRC staff evaluation of failures of the continuous monitoring system (CMS) for the scram discharge volume (SDV) at an operating BWR has identified the need for licensee actions in addition to those requested by IEB 80-17 and Supplements 1-3. The purpose of these actions is to provide assurance that the CMS has been tested to demonstrate operability as installed, remains operable during plant operation, and is periodically surveillance tested to demonstrate continued operability.

The occurrence of CMS failures at Dresden Nuclear Power Station was discussed in IE Information Notice 80-43, which was issued on December 5, 1980 to those operating BWR's with CMS recently installed. Subsequently, investigation into the cause of the failure to receive the alarm with the SDV essentially full revealed several items which required correction, including:

1. Excess portions of transducer cable were placed in physical positions which would increase external noise sensitivity.
2. The UT transducers were not placed in a physical position to optimize system sensitivity.
3. A certain amount of "cross-talk" was occurring between redundant transducers located a few feet apart on the same run of 4" pipe.

Station and vendor personnel shortened and rerouted transducer cables to improve noise rejection. Vendor specialists optimized transducer placement and synchronized both transducers to the same ultrasonic instrument internal clock to minimize cross-talk and improve signal to noise characteristics. Following these actions the CMS appeared to function properly.

Further difficulties were encountered when apparently minor quantities of water leaked into the SDV as a result of control rod drive scram valve maintenance activities and minor scram outlet valve leakage. It appears that the transducers are located on a section of SDV piping which forms a local low point. Accordingly, small amounts of water accumulate to a depth which triggers the high level alarm (at 1 volume. The licensee in conducted a specific analysis for a control rod drive scram point to 2-1/2". The system alarm time delay was also

DUPLICATE DOCUMENT

Entire document previously
entered into system under:

ANO 8006190074
No. of pages: 5