LICENSEE EVENT REPORT

EXHIBIT A

CONTROL BLOCK:
0 1 A R A N 0 2 0 0 1 - 10 0 0 0 - 10 0 0 4 1 1 1 1 1 0 0 57 CAT 58 5
CON'T HEPORT L 6 0 5 0 0 0 3 6 8 7 1 10 1 5 8 0 8 1 1 1 1 3 8 0 9 SOURCE 60 61 DOCKET NUMBER 68 69 EVENT DATE 74 75 HEPORT DATE 80
[0] During Mode 1 operation, with the "B" HPSI pump out of service, it was
[0]3 [discovered that a cover pane], previously removed from the "C" HPSI pump
[0]4 proom cooler, 2 VUC-11B, for cooler inspection, had not been reinstalled.
[0]5] [The open panel allowed an indeterminate amount of room air flow to bypass]
[0]6 the room cooler cooling coils, degrading the cooler performance & techni-
[0]7] [cally rendering the "C" HPSI pump, 2P89C, inoperable. No similar occur-
rences. Reportable per T.S. 6.9.1.9.b.
SYSTEM CAUSE CAUSE SUBCODE SUB
LEBIHO EVENTYEAR REPORT NO. CODE 1 1796 O 32 NC ODE 1 1796 ODE 1
cause of the occurrence was insufficient procedural guidelines for the
transfer of responsibility for maintenance activities. Procedures will
[1] be revised to address the transfer of responsibilities to prevent
recurrence.
FACILITY STATUS STATUS 30 METHOD OF DISCOVERY DESCRIPTION 32 NA DISCOVERY DESCRIPTION 32
ACTIVITY CONTENT RELEASED OF RELEASE AMOUNT OF ACTIVITY (35) NA LOCATION OF RELEASE (36) NA 1 6 2 33 Z 33 NA NA 15
PERSONNEL EXPOSURES THUMBER TYPE 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0
PEHSONNEL INJURIES NUMBER DESCRIPTION 41 NA 1 N 12 PEHSONNEL INJURIES NUMBER DESCRIPTION 41 12
LOSS OF OR DAMAGE TO FACILITY (43) TYPE DESCRIPTION 1 9 42 N.
PUBLICITY ISSUED DESCRIPTION 45 NRC USE ONLY
NAME OF PREPARER Chris N. Shively PHONE 501/968-2519