(7.77)	LICENSEE EVENT REPORT
	CONTROL BLOCK: []]] [[PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION]
0 1 7 8	C T H N P 1 2 0 0 - 0 0 0 0 - 0 0 3 4 1 1 1 1 1 4 57 CAT 58 5
CON'T 0 1 7 8	REPORT L 6 0 5 0 - 0 2 1 3 7 1 1 1 8 8 0 8 1 2 0 3 8 0 9 SOURCE 60 61 DOCKET NUMBER 68 69 EVENT DATE 74 75 REPORT DATE 80
0 2	While operating at 100% steady state power the operator was stepping in the control
0 3	bank rods one step. While performing this function both audible and visual alarms
0 4	indicated two dropped rods. Also a turbine load runback had been initiated. The
0 5	indicated dropped rods were verified to have been dropped and the reactor was
06	immediately manually tripped per our Emergency Operating Procedures. This incident
07	is reportable under Technical Specifications Appendix A, Section 6.9.2.b(2)
[0]8]	requiring a plant shutdown by limiting condition for CONTINUED ON ATTACHMENT
Santana Santana	9 SYSTEM CAUSE CAUSE COMPONENT CODE SUBCODE SUBCODE
7 8	R B 11 E 12 B 13 C R D R V E 14 Z 15 Z 16 20 SEQUENTIAL OCCURRENCE REPORT TYPE NO.
	17 REPORT 8 0 1 6 20 28 29 30 31 32 COMPONENT
	ACTION FUTURE COMPONENT SUBMITTED FORM SUB. PRIME COMPONENT SUBMITTED FORM SUB. SUPPLIER WANUFACTURER WITHOUT ACTION AND CORRECTIVE ACTIONS (27) CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)
1110	I Investigation into the problem showed that the Westinghouse Contactor, Type Table,
Ti Ii	Style #1502677, associated with the moveable gripper coils for these two rods had
1112	a badly burnt arc chute and the auxiliary contacts had been rubbing on one side which
	could have impeded the operation of the contactor. This contactor was replaced.
	These contactors are cleaned and inspected each refueling CONTINUED ON ATTACHMENT
7 8	FACILITY STATUS STATUS (30) METHOD OF DISCOVERY DESCRIPTION (32) STATUS STATUS N/A A A A A A A A A A
7 8	9 10 12 13 44 45 46 ACTIVITY CONTENT AMOUNT OF ACTIVITY (35) AMOUNT OF ACTIVITY (35) LOCATION OF RELEASE (36)
1 6	$\begin{bmatrix} \frac{1}{2} & 33 & \frac{1}{2} & 34 \\ 9 & 10 & 11 \\ 9 & 10 & 11 \end{bmatrix}$ $44 \qquad 45$ 80
1 7	1 10 10 10 10 10 ESCRIPTION OS N/A
7	PERSONNEL INJURIES NUMBER DESCRIPTION 41 N/A
1 8	LOSS OF OR DAMAGE TO FACILITY (3)
1 9	TYPE DESCRIPTION N/A
2 0	PUBLICITY ISSUED DESCRIPTION Courant, Middletown Press, UPI, AP [Y](4) Hartford Courant, Middletown Press, UPI, AP 68 69 80 2
, 8	

ATTACHMENT LER 80-16/3L

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES CONTINUED

operation 3.10. There were no effects on the health and safety of the public.

CAUSE DESCRIPTION AND CORRECTIVE ACTION CONTINUED

outage as part of the PM program. Possible replacement of these contactors with a more state-of-art contactor is being investigated at this time.