

LICENSEE EVENT REPORT

CONTROL BLOCK: _____ (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0 1 | F | L | S | L | S | 1 | 2 | 0 | 0 | - | 0 | 0 | 0 | 0 | 0 | 0 | - | 0 | 0 | 3 | 4 | 1 | 1 | 1 | 1 | 4 | 5

7 3 7 14 15 25 26 30 37 CAT 38

CON'T

0 1 | R | 5 | 0 | 5 | 0 | 0 | 0 | 3 | 3 | 5 | 7 | 0 | 7 | 0 | 1 | 8 | 1 | 3 | 0 | 7 | 3 | 0 | 8 | 1 | 9

7 3 30 31 38 39 44 45 46 47 48 49

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 | During 100% power operation. MD containment pressure transmitter failed

0 3 | intermittently. The power supply was tested and was found to be

0 4 | satisfactory. Action was taken in accordance with T. S. 3. 3. 2. 1. and

0 5 | 3.3.1.1. and the channel (ESFAS and RPS) was placed in bypass. The trans-

0 6 | mitter was replaced with a spare and the channel was returned to service.

0 7 | There was one previous LER of this type (81-21).

0 8 | _____

0 9 | SYSTEM CODE: I E (11) CAUSE CODE: E (12) CAUSE SUBCODE: A (13) COMPONENT CODE: I N S T R U (14) COMP SUBCODE: T (15) VALVE SUBCODE: Z (16)

17 | LER/RO REPORT NUMBER: 81 (21) EVENT YEAR: 81 (22) SEQUENTIAL REPORT NO: 036 (24) OCCURRENCE CODE: 03 (28) REPORT TYPE: L (30) REVISION NO: 0 (32)

ACTION TAKEN: C (18) Z (19) EFFECT ON PLANT: Z (20) SHUTDOWN METHOD: Z (21) HOURS: 0000 (22) ATTACHMENT SUBMITTED: N (23) NRC-4 FORM SUB: N (24) PRIME COMP SUPPLIER: N (25) COMPONENT MANUFACTURER: F 1 2 0 (26)

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 | The spare transmitter (Fischer-Porter, model 50EN1071BCXANS, serial

1 1 | 7112A5510A17) was used to replace the original transmitter (A15). The

1 2 | original transmitter's oscillator and force motor were replaced.

1 3 | _____

1 4 | _____

1 5 | FACILITY STATUS: E (23) % POWER: 100 (29) OTHER STATUS: NA (30) METHOD OF DISCOVERY: A (31) DISCOVERY DESCRIPTION: Operator Observation (32)

1 6 | ACTIVITY CONTENT: Z (33) Z (34) AMOUNT OF ACTIVITY: NA (35) LOCATION OF RELEASE: NA (36)

1 7 | PERSONNEL EXPOSURES: 000 (37) Z (38) DESCRIPTION: NA (39)

1 8 | PERSONNEL INJURIES: 000 (40) NA (41)

1 9 | LOSS OF OR DAMAGE TO FACILITY: Z (42) NA (43)

2 0 | PUBLICITY ISSUED: N (44) NA (45)

NAME OF PREPARER: Paul L. Pace PHONE: (305) 552-3654