

CONTROL BLOCK

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0 1	N	C	M	G	S	2	0	0	-	0	0	0	0	0	0	0	3	4	1	1	1	1	4		5
7	8	9	LICENSEE CODE	14	15													26	LICENSEE TYPE	30	31	CAT	32		

CONT

0 1	REPORT SOURCE	L	6	0	5	0	0	0	3	7	0	7	0	4	0	6	8	3	8	0	5	0	6	8	3	9
7	8	9	40	41															49	EVENT DATE	54	55	REPORT DATE	56		

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 While in mode 5, the ventilation unit condensate drain tank (VUCDT) was released
 0 3 while the composite sampler had been inoperable for more than 30 days (Unit 2)
 0 4 Tech. Specs. became effective on 3/3/83; VUCDT composite sampler declared in-
 0 5 operable same day since it had not yet been installed). This violates the action
 0 6 statement of T.S.3.3.3.8 which is reportable per T.S.6.9.1.11(c). Monitor 2EMF+
 0 7 44, which controls the release of the VUCDT, was operable. Additionally, grab
 0 8 samples taken indicate release specifications were met. Health and safety of
 0 9 the public were unaffected.

7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33		
FACILITY CODE	CLASSE CODE	CRUISE SUBCODE	COMPONENT CODE	COMP. SUBCODE	VALVE SUBCODE					LER/RO REPORT NUMBER	EVENT YEAR	SEQUENTIAL REPORT NO.	OCCURRENCE CODE	REPORT TYPE														
0 9	M	C	I	X	Z					8	3	0	0	4	0	3	L											
ACTION TAKEN	FUTURE ACTION	EFFECT ON PLANT	SHUTDOWN METHOD	HOURS	ATTACHMENT SUBMITTED	NPRO-A FORM SUB	PRIME COMP. SUPPLIER	COMPONENT MANUFACTURER																				
X	G	Z	Z	0	N	N	L	Z	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51		

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 This incident is attributed to personnel error due to assistant shift supervisor
 1 1 misinterpreting worklist instruction. Additionally, insufficient guidance was
 1 2 given in the operating procedure. The VUCDT was red tagged to prevent further
 1 3 releases. The composite sampler was installed, calibrated, and declared oper-
 1 4 able. The operation procedure will be modified, and personnel counseled.

7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	
FACILITY STATUS	% POWER	OTHER STATUS	METHOD OF DISCOVERY	DISCOVERY DESCRIPTION																							
1 5	B	28	L	0	0	0	0	0	0	N/A	29			B	31												

7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	
ACTIVITY RELEASED OF RELEASE	CONTENT	AMOUNT OF ACTIVITY	DISCOVERY DESCRIPTION	LOCATION OF RELEASE																							
1 6	Z	33	Z	34	N/A																						

7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	
PERSONNEL EXPOSURES NUMBER	TYPE	DESCRIPTION																									
1 7	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	

7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	
PERSONNEL INJURIES NUMBER	DESCRIPTION																										
1 8	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	

7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	
LOSS OF OR DAMAGE TO FACILITY TYPE	DESCRIPTION																										
1 9	Z	42	N/A																								

7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	
PUBLICITY ISSUED	DESCRIPTION																										
2 0	N	44	N/A																								

NAME OF PREPARER Phillip B. Nardoci

PHONE (704) 373-7432