

Log # TXX-90157 File # 10200

Ref. # 50.73 50.73(a)(2)(i)

April 26, 1990

William J. Cahill, Jr. Executive Vi.: President

U. S. Nuclear Regulatory Commission

Attn: Document Control Desk Weshington, D. C. 20555

SUBJECT: COMANCHE PEAK STEAM ELECTRIC STATION

DOCKET NO. 50-445

CONDITION PROHIBITED BY THE PLANT'S TECHNICAL SPECIFICATIONS

LICENSEE EVENT REPORT 90-005-00

Gentlemen:

Enclosed is Licensee Event Report 90-005-00 for Comanche Peak Steam Electric Station Unit 1, "Inadequate Implementation of Procedural Requirements Resulting in the Failure to Perform a Visual Inspection of Containment Required by Technical Specifications."

Sincerely,

William J. Cahill, Jr.

RHS/daj

Enclosure

c - Mr. R. D. Martin, Region IV Resident Inspectors, CPSES (3)

1822

LICENSEE EVENT REPORT (LER)									APPROVED DMB NO. 3150-0104 EXPIRES: 4/30/92 ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HAS, FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE RECORDS AND REPORTS MANAGEMENT BRANCH (P-530), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON DC. 20555, AND TO THE TAPE RWORK REDUCTION PROJECT (3150-0104) OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC. 20503.											
Facility Name (1) COMANCHE PEAK - UNIT 1									Dockel Number (2) Page (3)											
Title (4)	MO	ANC	ATEIN	MPL	EMEN'	IAT	IONOF	PRO	CEDI	IRAL E	EQUIRE	1015		O 4 4		TO PE	10	16		
	A VIS	SUAL	INSPE	CTI	CN OF	CC	NTAIN	IMEN'	REC	DUIREC	BY TEO	HNICAL	SPECIFIC	ATIONS	NEONE	TOPE	1101	TIVI		
Event. Month	Event Date (5) LER Number (6) Report Date (7) Month Day Year Year Number Number Month Day Year								Facility Nam		Locket Num									
	LAN	1 6141	100	+-	Number	H	Number	1		+		N/A		015	1010	101				
013	217	910	910	-0	1015	-	010	014	216	910	heck one or m	N/A		015	1010	101	1	1		
Power Level (10)	01	0.10	20.4 20.4 20.4 20.4	102(b) 105(a)(105(a)(105(a)(105(a)(1)(ii) 1)(iii) 1)(iv)		\$60.96 \$60.79 \$60.79	(c)(1) (c)(2) (a)(2)(i) (a)(2)(ii) (a)(2)(iii)			50.73(a)(2)(50.73(a)(2)(50.73(a)(2)(50.73(a)(2)(50.73(a)(2)(60.73(a)(2)(or This LER (1	(v) (vii) (viii)(A) (viii)(B)	7	3.71(b) 3.71(c) Other (Specify in Abi NRC Form 36	stract below (GA)	and in Text				
Name	-	-					*********		Rense	6 Contact F	OF THE LEFT (1	2)		Telephor	ne Number					
D. 1	NOB	AMI	ино	200)		-	-		CONTRACTOR STATE	DMPLIA TOOREN Failur		Area Co. 8 1 1	7 819	171-	151	818	319		
Cause	Syste	erri .	Compone	erst	Manufa	oturer	Rep	ortable			Cause	System	Component			PRDS				
			1.1	1	11	1				N.			111	1111		7833		************		
	1		1.1	1	1.1	1							111	1111						
			********	- Australia				Supplem	ıntai Re	роп Ехрел	ted (14)			Expected	Month	Day	I	Year		
□ Yes	SCHOOL SECTION	-	THE RESERVE AND ADDRESS OF THE PERSON NAMED IN	Subm	ission Dat	e)		X No						Submission Date (15)				1		

On March 27, 1990, it was determined that the procedural requirement for the performance of a visual inspection of affected areas following a containment entry was not being fully satisfied. The inspection is required to ensure that no loose debris is present which could be transported to the containment sumps during a loss of coolant accident. No significant safety concerns have been identified. The successful completion of a containment visual inspection prior to entry into the mode for which the Technical Specification is applicable and again subsequent to the event, along with the existence of Station Administrative Procedures governing housekeeping practices, provide a high level of assurance that if a loss of coolant accident had occurred, there would not have been an accumulation of trash on the sump screens causing flow restriction. The root cause of the event was inadequate implementation of a procedural requirement. Administrative controls will be improved to ensure that the required visual inspection is performed.

NHC FOHM 386A	REPORT (LER) NUATION	BRANCI DO. 208	N ES H (P-1 556, I	REC STIMA 530), U	EN PER REDUEST: 60 TE TO THUS. NUCLE	XPIRES SPONS D.D HRS SE REC AR REC PERWO	FORWAR CORDS AN BULATORY ORK REDU	D COMME D REPOR COMMISS CTION PR	RTS MA	ORMATION EGARDING NAGEMENT ISHINGTON. (9150-0104).	
Facility Name (1)		Docket Number (2)			LERN	lurriber (6)				Pa _s 6 (3)	
			Year		8	equential Number		Number		E	DE DE
COMANCE	HE PEAK - UNIT	015101010141415	910	-	0	1015	1-	010	012	OF	016

I. DESCRIPTION OF EVENT

A. PLANT OPERATING CONDITIONS BEFORE THE EVENT

On March 27, 1990, at 1100 CST, Comanche Peak Steam Electric Station (CPSES) Unit 1 was in Mode 3, Hot Standby. The Reactor Coolant System (RCS) (EIIS: (AB)) was at a temperature of 557 degrees F and pressure of 2300 psig.

B. REPORTABLE EVENT DESCRIPTION (INCLUDING DATES AND APPROXIMATE TIMES OF MAJOR OCCURRENCES)

Event Classification: Any operation or condition prohibited by the plant's Technical Specifications.

On March 27, 1990, at approximately 1020 CST, a system engineer (contractor, nonlicensed) entered the containment building (EIIS: (NH)) to perform a system walkdown. He exited containment at approximately 1100 CST. At approximately 1300 CST, a discussion between the system engineer and his supervisor (utility, licensed) revealed that the system engineer had not satisfied the procedural requirement of the Station Administrative Procedure governing containment entry. The procedure requires that a visual inspection be conducted in affected areas within containment to verify that no loose debris is present. The documentation of this inspection is required to satisfy the surveillance requirement of Technical Specification 4.5.2c.2. The intent of Technical Specification 4.5.2c.2 is to ensure that no loose debris is present in the containment which could be transported to the containment sump (EIIS: (DRN)(BP)(BE)) and cause restriction of the pump (EIIS: (P)(BP)(BE)) suctions during loss of coolant accident (LOCA) conditions. Upon discovery of the condition, the Shift Supervisor (utility, licensed) was notified, and Technical Specification 4.0.3 was entered. Operations personnel (utility, nonlicensed) performed a visual inspection of all accessible areas of containment in accordance with Operations Testing Procedures, and Technical Specification 4.0.3 was exited at approximately 1755 CST. The preliminary investigation of the event determined that adequate controls did not exist to provide assurance that additional examples of noncompliance with the procedure governing containment entries had not occurred since Mode 4 was entered on March 16, 1990, when the affected Technical Specification became applicable.

NRC FORM 986A		E EVENT	REP		T (L			RYO	MMO	ISSIO	ESTI COL BUR BRA DC.	DEN NOH	TION V ES I (P-1	TIME STIME SOIO).	DUES ATE U.B.	ER R	EXPI ESPO BO.O H HE I EAR APER	RES NSI IRB. REG REG	HO. 31 4/30/96 FORW ORDS IULATO PRK REI	MPLY ARD AND RY OC	OOM REP DMMI	OR'S	ON, WA	NAGEI ISHING (3150-0	MENT STON
Facility Name (1)			Dooke	Number	(2)			-				_		LER	Numb	or (6)		_		I			ape (3		
											Yes				Num				Revision Number	NO.					
COMANCE	E PEAK	- UNIT 1	01	510	01	01	01	4	14	115	91	0	-	0	10	1	5	-	011	ماد	11	3	OF	0	16

C. STATUS OF STRUCTURES, SYSTEMS, OR COMPONENTS THAT WERE INOPERABLE AT THE START OF THE EVENT AND THAT CONTRIBUTED TO THE EVENT

There were no inoperable structures, systems, or components which contributed to this event.

D. CAUSE OF EACH COMPONENT OR SYSTEM FAILURE, IF KNOWN

There were no system or component failures which contributed to this event.

E. FAILURE MODE, MECHANISM, AND EFFECT OF EACH FAILED COMPONENT

There were no component failures which contributed to this event.

F. FOR FAILURES OF COMPONENTS WITH MULTIPLE FUNCTIONS, LIST OF SYSTEMS OR SECONDARY FUNCTIONS THAT WERE ALSO AFFECTED

There were no component failures which contributed to this event.

G. FOR FAILURES THAT RENDERED A TRAIN OF A SAFETY SYSTEM INOPERABLE, AN ESTIMATE OF THE ELAPSED TIME FROM THE DISCOVERY OF INOPERABILITY UNTIL THE TRAIN WAS RETURNED TO SERVICE

There were no component or system failures which rendered a train of a safety system inoperable.

APPROVED OMB NO. 9150-0104
EXPIRES: 4780/92
ESTIMATED BURDEN PER RESPONSE TO DOMPLY WITH THIS INFORMATION
COLLECTION REQUEST: BOLD HRS. FORWARD COMMENTS REGARDING
BURDEN ESTIMATE TO THE RECORDS AND REPORTS MANAGEMENT
BRANCH (P-530), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON,
DC. 2055S, AND TO THE PAPERWORK REDUCTION PROJECT (9-50-0-104)
OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC. 20509.

Facility Name (1)

Dookel Number (2)

LER Number (6)

Page (3)

Veat

Sequential
Number

Revision
Number

H. THE METHOD OF DISCOVERY OF EACH COMPONENT OR SYSTEM FAILURE OR PROCEDURAL ERROR

The failure to follow the procedural requirement to conduct a visual inspection of the affected areas of containment was identified approximately 2 hours after the containment entry during a discussion between the system engineer and his supervisor. The procedure noncompliance was documented and reviewed in accordance with Station Administrative Procedures. During the disposition process it was determined that sufficient programmatic controls could not be demonstrated to provide assurance that additional examples of noncompliance with procedures governing containment entries had not occurred subsequent to entry into Mode 4.

I. CAUSE DETERMINATION

The root cause of this event is inadequate implementation of a procedural requirement. A contributing factor is considered to be insufficient training of plant personnel on the procedural guidance governing containment entry. Although the procedural guidance related to the Technical Specification requirement for a visual inspection has been in place since 1987, no specific group within the utility organization was assigned responsibility for developing a positive control mechanism to ensure procedural compliance.

J. SAFETY SYSTEM RESPONSES THAT OCCURRED

There were no manual or automatic safety system responses as a result of this event.

K. FAILED COMPONENT INFORMATION

Q

There were no component failures associated with this event.

LICENSEE EVENT	ESTIM OOLLÉ BURDI BRANC DC. 20 OFFIG	ATED CTION EN EI DH (P-	BURE N RE STIM 530). AND MANA	DEN PI	EX EM REB T: BO. TO THE ILICIEA HE PAP	PIRES PONS D HAS E REC IR REC	BULATORY	PLY WITH DOMMED REPORT COMMISSION PR	ITE MA ION, WA OJECT	(3150-0104)		
Facility Name (1)	Dooket Number (2)	LER Nurreser (6)							Fage (3)			
		Year			Numb	itia/		Nurrexer				
COMANCHE PEAK - UNIT	015101010141415	910	-	0	10	15	-	010	0.15	OF	016	

II. ASSESSMENT OF THE SAFETY CONSEQUENCES AND IMPLICATIONS OF THIS EVENT

Prior to entry into Mode 4, Hot Shutdown, a visual inspection of containment is performed in accordance with Operations Testing Procedures to verify that no loose debris is present in the containment which could be transported to the containment sump and cause restriction of pump suctions during LOCA conditions. Immediately following discovery of the event. Operations personnel reperformed the visual inspection. All acceptance criteria for the containment closeout inspection were satisfied, and the inspection was completed on March 27, 1990 at 1755 CST. Additional administrative controls provide a measure of assurance that trash and debris will not accumulate in containment. Station Administrative Procedures governing housekeeping practices provide guidance to employees regarding their responsibilities for the removal of tools, equipment, materials, trash or debris from the work area upon completion of work activities. The successful performance of the containment closeout inspection along with the existence of housekeeping controls for work activities provides a high level of assurance that if a LOCA had occurred, flow restriction resulting from the accumulation of trash on the sump screens would not have occurred. It is therefore concluded that this event did not adversely affect the safe operation of CPSES Unit 1 or the health and safety of the public.

III. CORRECTIVE ACTIONS

A. IMMEDIATE CORRECTIVE ACTIONS

Immediate corrective actions focused on establishing administrative control over containment entry activities and satisfying Technical Specification Surveillance requirements. The following actions were taken:

- The Security Post Order for the containment access point was changed to require the Security officer to check that each work party entering containment has the correct documents for performance of the required visual inspection.
- A sign was placed at the containment access point advising work parties
 entering containment of the documentation requirements for containment entry.

	LICENSEE EVENT REPORT (LER) TEXT CONTINUATION						ORDS ANDULATORY	PLY WITH	ENTS NA HON, WA	NAGEMEN BHINGTO
Facility Name (1)	Dooket Nurroer (2)		L	R Numbe	(E)			I	Page (3)
COMANCHE PEAK - U	NIT 1 01 51 01 01 01 41 41	Year	-	Numb	15	-	Number O LO	016	OF	016

- The Operations Department performed a visual inspection in accordance with the applicable station procedure to verify that no loose debris was present in all accessible areas of containment.
- The Operations Department began keeping a Control Room log of containment entries to ensure that affected Technical Specification requirements are satisfied following completion of each containment entry.

The desirability of continued reliance on the temporary administrative controls over containment access will be evaluated following full implementation of actions to prevent recurrence.

B. ACTIONS TO PREVENT RECURRENCE

Station Administrative Procedures will be revised to include a mechanism for ensuring that a visual inspection of the areas affected within containment is performed and documented following the completion of a containment entry, once containment integrity is established. Responsibility for ensuring that the procedural requirements are satisfied has been assigned. The development of administrative barriers ensuring procedural compliance eliminates the need to perform extensive training of plant personnel while assuring a more positive control on containment entry.

IV. PREVIOUS SIMILAR EVENTS

There have been no previous similar events reported pursuant to 10CFR50.73.