

Commonwealth Edison Quad Cities Nuclear Power Station 22710 206 Avenue North Cordova, Illinois 61242-9740 Telephone 309/654-2241

RLB-93-054

March 26, 1993

U. S. Nuclear Regulatory Commission Document Control Desk Washington, DC 20555

Reference: Quad Cities Nuclear Power Station Docket Number 50-265, DPR-30, Unit Two

Enclosed is Licensee Event Report (LER) 93-007, Revision 00, for Quad Cities Nuclear Power Station

This report is submitted in accordance with the requirements of the Code of Federal Regulations, Title 10, Part 50.73(a)(2)(ii)(B). Any event or condition that resulted in the condition of the nuclear power plant, including its principal safety barriers being seriously degraded, or that resulted in the nuclear plant being in a condition that was outside the design basis of the plant.

Respectfully,

COMMONWEALTH EDISON COMPANY QUAD CITIES NUCLEAR POWER STATION

R. L. Bax Station Manager

RLB/TB/plm

Enclosure:

cc: J. Schrage T. Taylor INPO Records Center NRC Region III

0501 9304060222 930327 PDR ADOCK 05000265 5 PDR

	4						LIC	ENSE	E EVEN	IT REPO	DRT	(LER)					For	m Rev 2.1
Facili	ty Name	(1)											Doc	ket Nu	mber (2	)	Page	(3)
Quad Cities Unit Two									01 01 21 61 5 1 of 0 3									
Title	(4)		4				1. (may 1) - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1								×1 ×1	81	- Sambard	×14
																	111.0	6
B Loop	Main S	team I:	solatio	Nalves	Exceed	ed Ti	echnic	<u>al 5</u>	pecifi	catior	n.Lei	akage	Limit	s for	Contain	ment	Isolatio	n Valves
Event Date (5)				LER Number (6)				Report Date		ate .	2 (7)	Other Facilities Involved (8)				(8)		
month Day fear		fear	VII Sequential VII F			Number		Month	Uay	Y	Tear	Tacility		Names	DOCK	et Numpe	r(s)	
				6. P. F												01 5	1 01 01	01 1 1
013	017	9  3	913	- 01	017		01	0	01 3	21	7	9 3				01 5	0 0 0	01 1 1
				THIS REP	ORT IS	SUB	MITTED	PUR	SUANT	TO THE	E RE	QUIREN	MENTS	OF 100	FR			
OPER	ATING			(Check o	ne or	more	of th	e fo	liowin	(1) (p)	1)							
MUI	DF (3)	1.1	1	20.4	02(b)			_120	.405(0	)	1.	50	).73(a	)(2)(i	(v)		73.71(b	)
POWER	1			20.4	05(a)(	1)(i	)	_ 50	.36(c)	(1)		50	).73(a	)(2)()	()		73.71(c	) <u>.</u> .
LEVEL		101.1	1.00	20.4	05(a)(	1)(i	i)	_ 50	.36(c)	(2)		50	0.73(a	)(2)(	rii)	1	Other (	Specify
(10)	0	0	0	20.4	05(a)(	1)(1	ii)	_ 50	.73(a)	(2)(i)			).73(a	)(2)(	(A)(A)		in Abst	ract
44444	14444	44444	1111114	20.4	05(a)(	1)(ii	() <u>X</u>	_ 50	.73(a)	(2)(33	0 1	50	).73(a	)(2)(	(iii)(B)		below a	nd in
RAA	94949	1949	199997	20.4	05(a)(	1)(v	) ]	_150	.73(a)	(2)(1)	(1)].	50	0.73(a	)(2)()	()		Text)	
							LICEN	SEE	CONTAC	T FOR	THI	S LER	(12)					
Name														-	TE	LEPHO	NE NUMBE	R
														AREA	CODE			
David	Kunzma	nn, Ter	chnical	Staff, E	xt. 21	62								31	0 9	61 5	4 -	2 2 4
			COMPI	ETE ONE	LINE F	OR E	ACH CO	MPON	ENT FA	ILURE	DES	CRIBED	IN T	HIS RE	PORT (1	31	-	in the second
CAUSE	SYSTER	H COI	MPONENT	MANUFA	C-  R	EPOR	TABLE	111	114 5	AUSE	SY	STEM	COMP	ONENT	MANUF	-3A	REPORTA	BLE 1/1/1
				TURER		TO N	PRDS	999	994						TURE	R	TO NPR	DS 1////
		++	-	+ + +				48	11/1-						+ + +	-		
	L	-				r u err		1111	111					1_1_	+	_	1	
			SUPPLI	MENTAL R	CPORT	EXPE	TED (	14]	-						Expec	ted	Month	Day   Yei
															Submis Data	5100		
X Ye	s (If y	es. con	nplete	EXPECTED	SUBMIS	SION	DATE)			NO		1			Date	(15)	0 6	2 5 9

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)

# ABSTRACT:

During performance of combined Local Leak Rate Test of the "B" loop MSIV's, the leakage exceeded the 11.5 scfh Tech Spec limit of T.S. 3.7.A.2.e. The measured leakage was 89.32 scfh. Further testing will be done to identify the leakage path. A supplemental report will be issued when the cause of the leakage is identified and repairs have been completed.

This report is being submitted to comply with 10 CFR 50.73 (a)(2)(11)(B).

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)	Page (3)		
		Year //// Sequential //// Revision			
Quad Cities Unit Two	0 1 5 1 0 1 0 1 0 1 21 61	5 9 1 3 - 0 1 0 1 7 - 0 1 0	01 2 OF 01 3		

TEXT Energy Industry Identification System (EIIS) codes are identified in the text as [XX]

#### PLANT AND SYSTEM IDENTIFICATION:

General Electric - Boiling Water Reactor - 2511 MWt rated core thermal power.

EVENT IDENTIFICATION: B loop main steam isolation valves exceeded technical specification leakage limits for containment isolation valves.

#### A. CONDITIONS PRIOR TO EVENT:

Unit:	Two		Event	Date:	March 7.	1993	Event	Time:	0922
Reactor	Mode:	1	Mode	Name:	SHUTDOWN		Power	Level:	0%

This report was initiated by Deviation Report D-4-2-93-019.

SHUTDOWN Mode (1) - In this position, a reactor scram is initiated, power to the control rod drives is removed, and the reactor protection trip systems have been deenergized for 10 seconds prior to permissive for manual reset.

## B. DESCRIPTION OF EVENT:

On March 7, 1993, Quad Cities Unit Two was shutdown for the cycle 12 refueling and maintenance outage. At 0922 hours, while Local Leak Rate Testing (LLRT), the "B" Main Steam Isolation Valves, it was determined that the measured combined leakage rate of 89.32 standard cubic feet per hour (scfh) was in excess of the individual MSIV Technical Specification (3.7.A.2.a.3) limit of 11.5 scfh.

An individual LLRT of the outboard MSIV AO-2-203-2B measured a rate of 76.7 scfh.

The inboard MSIV AO-2-203-1B measured a rate of 12.62 scfh. Both the combined test and the individual tests were performed using the more conservative method of pressure decay.

## C. APPARENT CAUSE OF EVENT:

This report is being submitted in accordance with the requirements of the Code of Federal Regulations, Title 10, Part 50.73(a)(2)(11)(B). Any event or condition that resulted in the condition of the nuclear power plant, including its principal safety barriers being seriously degraded, or that resulted in the nuclear plant being in a condition that was outside the design basis of the plant.

The cause of the excessive leakage cannot be determined until repairs have been completed and the valves have been retested. A supplemental report documenting these repairs and any corrective actions taken will be issued.

FACILITY NAME (1)	DOCKET NUMBER (2)	LE	R NUMBE	R (6)			Pe	age (	3)
		Yea	11/1	Sequentia Number	1///	Revision Number			
Quad Cities Unit Two	0 1 5 1 0 1 0 1 0 1 2 1 6	5 9 1	3 -	01017	-	010	01 3	OF	01

#### D. SAFETY ANALYSIS OF EVENT:

The safety consequences of this event were minimal since LLRT is a conservative method for quantifying containment leakage. It is realistic to expect the leakage to be equal to the lesser leakage of the two valves, which when tested with the more conservative pressure decay method only exceeded the Technical Specification requirement of 11.5 scfh with a leakage of 12.62 scfh.

### E. CORRECTIVE ACTIONS:

No corrective actions have been taken at this time. A supplemental report will be issued which will document the corrective actions taken to bring the MSIV leakage below the required limit (NTS# 2652009301901).

# F. PREVIOUS EVENTS:

254/89/014 Leak rate from all valves and penetrations including MSIVs on Unit 1 in excess of Technical Specification Limit.

# G. COMPONENT FAILURE DATA:

Component failure data is not available at this time since repairs have not been completed. Failure data will be included in the Supplemental Report.