

LICENSEE EVENT REPORT UPDATE REPORT - PREVIOUS REPORT
DATE 10-27-81

CONTROL BLOCK: 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 During steady state power operation, a leak of unknown origin in the Reactor Coolant
0 3 System in excess of 1 GPM was identified in containment. The leak was traced to
0 4 Isolation Valve 2-RC-403 which is the block valve for power operated pressure relief
0 5 valve 2-RC-402. 2-RC-403 was isolated and the leakage reduced to less than 1 GPM, in
0 6 compliance with Technical Specification 3.4.6.2.b. 2-RC-402 was declared inoperable
0 7 in accordance to Technical Specification 3.4.3.a. The block valve 2-RC-403 was repair-
0 8 ed during the 1981 refuel. Similar incidents LER 79-15.

0 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 The valve 2-RC-403 is a 2½ inch pressure seal gate valve with a motor operator, rated
1 1 at 2500 PSI, ASME III, Class I, SA-182, stainless steel. The leak in 2-RC-403 was
1 2 repaired by replacing the seal ring between the body and bonnet. The valve was then
1 3 put back into service. The power operated relief valve 2-RC-402 was then declared
1 4 operable.

1 5 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

8204090183 820402
PDR ADDCK 05000336
S PDR

NAME OF PREPARER Joseph M. Bergin

PHONE (203) 447-1791 X 4462