LICENSEE EVENT REPORT
CONTROL BLOCK: [] [] (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)
0 1 C T M N S 2 0 0 0 - 0 0 0 0 - 0 0 3 4 1 1 1 1 1 4 5 5 EICENSE CODE 14 15 LICENSE NUMBER 25 26 LICENSE TYPE 30 57 CAT 58
REPORT L G O S O O O O O O O O O O O O O O O O O
[0] Acid Emergency Supply Charging Pump Suction). The valve was placed in manual operation
[0]4] and the plant operated in accordance with Technical Specification Action Statement
[0]5] 3.5.2.a for 47 hours. Following the motor failure on 2-CH-514 a plant trip occurred
[0]6] due to unrelated problems. The subsequent recovery and plant startup was made without
[0]7] the realization that Action Statement 3.5.2.a applied. LER 82-09 was submitted 5/3/82
Tol8] for the occurrence. Similar events: None.
SYSTEM CAUSE CODE COMPONENT CODE COMPONENT CODE SUBCODE SUBCOD
[1] The ground on the motor of the valve operator (Limitorque SMB-00) had overheated due to
[1] [an incorrect size. It was replaced with the correct size and put back into operation.]
[1] [A sampling of safety related Limitorque Operators has been made for similar problems
1 3 with no discrepancies.
1 4 6
FACILIT STATUS SPOWER OTHER STATUS 30 METHOD OF DISCOVERY DESCRIPTION 32 A (31) Operator observation
7 8 9 10 12 13 44 45 46 ACTIVITY CONTENT RELEASE OF RELEASE AMOUNT OF ACTIVITY (35) NA N
NUMBER TYPE DESCRIPTION (39) NA NA PERSONNEL INJURIES NUMBER DESCRIPTION (41) NUMBER DESCRIPTION (41)
1 8 0 0 0 40 NA
LOSS OF OR DAMAGE TO FACILITY 43 TYPE DESCRIPTION NA NA NA PUBLICITY NRC USE ONLY
NA B205250092 B20517 PDR ADDCK 05000336 PDR 447-1791 (Ext. 4421)