LICENSEE EVENT REPORT

CONTROL BLOCK: [] [] [(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)
01 I L Z I S 2 2 0 0 - 0 0 0 0 - 0 0
CON'T
O 1 SOURCE L G O 5 O 0 O 0 3 O 4 7 O 9 O 6 7 8 8 1 O 6 7 8 9 EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)
During testing, RWST to charging PP suction vlv, 2MOV-VC112E, failed to
open remotely degrading system per T.S.3.8.1.B. Vlv was opened locally
0 4 and stroked 3 times remotely. Parallel redundant vlv 2MOV-VC112D was
o s operable to permit proper system function, thus the health and safety
o 6 of the public were not affected.
0 7
7 8 9
TO 19 TO TO THE TOTAL TO THE TOTAL TO THE TOTAL THE TOTA
TAKEN ACTION FUTURE EFFECT ON PLANT METHOD HOURS 22 ATTACHMENT FORM SUB. SUPPLIER MANUFACTURER SUPPLIER SUPPLIE
CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27) 1 0 Limitorque (model SMB 00) valve operator torqued out. MCC was locally
overridden, in order to open the valve. The valve was subsequently
stroked 3 times from the control room - failure symptoms could not be
duplicated. The limitorque was inspected during valve operation and
the torque settings were verified to be correct. No further action is necessary at this time.
FACILITY STATUS SPOWER OTHER STATUS 30 METHOD OF DISCOVERY DESCRIPTION 32 1 5 E 28 1 0 0 29 N/A B 31 Control Board Indication 7 8 9 10 12 13 44 45 46
RELEASED OF RELEASE AMOUNT OF ACTIVITY 35 N/A LOCATION OF RELEASE 36
NUMBER TYPE DESCRIPTION 39 1 7 0 0 0 37 Z 38 N/A
PERSONNEL INJURIES 13 NUMBER DESCRIPTION 41 N/A
7 8 9 11 12 LOSS OF OR DAMAGE TO FACILITY 43 TYPE DESCRIPTION 43
7 8 9 10 N/A
PUBLICITY ISSUED DESCRIPTION 45 NAC USE ONLY N/A
78/0/70 242 S Joe Reiss 312-746-2084 x-347 0
PHONE: