

Unit 2

## LICENSEE EVENT REPORT

Report No.

CONTROL BLOCK:

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0 1 P A P B S 2 2 0 0 - 0 0 0 0 0 0 0 0 3 4 1 1 1 1 4 5  
7 8 9 14 15 25 26 30 37 CAT 58  
LICENSEE CODE LICENSE NUMBER LICENSE TYPE

CON'T

0 1  
7 8  
REPORT SOURCE 60 61 DOCKET NUMBER 68 69 EVENT DATE 74 75 REPORT DATE 80  
6 0 5 0 - 0 2 7 7 7 1 0 1 0 7 8 8 1 0 2 4 7 8 9

## EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 During routine surveillance testing, two 4KV emergency bus sequential  
0 3 loading relays (Westinghouse 1876094) were found outside of the limits  
0 4 of tech spec (Table 3.2.B). These relays allow loading of the Diesel  
0 5 Generators during a loss of power. Because a diesel generator automatic  
0 6 actuation and load acceptance test for a loss of power was successfully  
0 7 performed during previous refueling outage and the actual setpoint was  
0 8 less than 1 percent above the upper limit, safety significance is minimal.  
7 8 9 80

0 9  
7 8  
SYSTEM CODE 9 10 CAUSE CODE 11 CAUSE SUBCODE 12 COMPONENT CODE 13 COMP. SUBCODE 14 VALVE SUBCODE 15  
E E 11 D 12 Z 13 R E L A Y X 14 M 15 Z 16  
17 LER/RO REPORT NUMBER 21 EVENT YEAR 22 SEQUENTIAL REPORT NO. 23 OCCURRENCE CODE 24 REPORT TYPE 25 REVISION NO. 26  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32  
1 7 8 0 4 1 0 1 T 0  
ACTION TAKEN 33 FUTURE ACTION 34 EFFECT ON PLANT 35 SHUTDOWN METHOD 36 HOURS 37 ATTACHMENT SUBMITTED 38 NPRO-4 FORM SUB. 39 PRIME COMP. SUPPLIER 40 COMPONENT MANUFACTURER 41  
G 18 Z 19 Z 20 Z 21 0 0 0 0 Y 23 N 24 N 25 W 1 2 0 26  
33 34 35 36 37 38 39 40 41 42 43 44 45

## CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 The cause of this occurrence is attributed to an error in  
1 1 determining the setpoint and calibration span of the relays. The relays  
1 2 on both Unit 2 and Unit 3 were recalibrated to the midrange of the  
1 3 technical specification limits. The surveillance test has been revised  
1 4 to eliminate this deficiency.  
7 8 9 80

1 5 FACILITY STATUS 28 % POWER 29 OTHER STATUS 30 METHOD OF DISCOVERY 31 DISCOVERY DESCRIPTION 32  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32  
E 28 0 0 0 29 N/A B 31 Surveillance Test  
ACTIVITY CONTENT 33 RELEASED OF RELEASE 34 AMOUNT OF ACTIVITY 35 LOCATION OF RELEASE 36  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32  
Z 33 Z 34 N/A N/A  
PERSONNEL EXPOSURES 37 NUMBER 38 TYPE 39 DESCRIPTION 39  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32  
0 0 0 37 Z 38 N/A  
PERSONNEL INJURIES 40 NUMBER 41 DESCRIPTION 41  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32  
0 0 0 40 N/A  
LOSS OF OR DAMAGE TO FACILITY 42 TYPE 43 DESCRIPTION 43  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32  
Z 42 N/A

PUBICITY

ISSUED DESCRIPTION 45

NRC USE ONLY

2 0 N 44  
7811090141 SNV Cooney  
NAME OF PREPARER

PHONE (215) 841-5020