## LICENSEE EVENT REPORT

PLICENSE COLIE  O TO THE POINT ON THE ALL REQUIRED INFORMATION)  O TO THE POINT OF THE POINT OF THE ALL REQUIRED INFORMATION)  O TO THE POINT OF THE
CON'T  O 1  SOURCE 60  61  DOCKET NUMBER  GS  EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (1)  During normal operation S/G level channel 2 LI-538 was found to be indicating for Lo-Lo S/G level Rx trip and for Fs/Fw mismatch with Lo S/G    Vative for Lo-Lo S/G level Rx trip and for Fs/Fw mismatch with Lo S/G    LICENSE TYPE JO 57 CAI 58    LICENSE TYPE JO 57 CAI 58    LICENSE TYPE JO 57 CAI 58   LICENSE TYPE JO 57 CAI 5
HEPORT L G O S O O O O O O O O O O O O O O O O O
During normal operation S/G level channel 2 LI-538 was found to be indicating 6 percent higher than the other two channels. This is non-conservative for Lo-Lo S/G level Px trip and for Fs/Fw mismatch with Lo S/G level Px trip and for Fs/Fw mismatch with Lo S/G level Px trip and for Fs/Fw mismatch with Lo S/G level Px trip and for Fs/Fw mismatch with Lo S/G level Px trip (TS table 3.1.1).Redundant channels were operable and available, so the health and safety of the public was not affected.
vative for Lo-Lo S/G level Px trip and for Fs/Fw mismatch with Lo S/G  level Px Trip (TS table 3.1.1). Redundant channels were operable and  available, so the health and safety of the public was not affected.
level Rx Trip (TS table 3.1.1).Redundant channels were operable and  available, so the health and safety of the public was not affected.
available, so the health and safety of the public was not affected.
0 7   8 7 8 9 SYSTEM CAUSE CAUSE
7 8 9 SYSTEM CAUSE CAUSE
CVCTEM CALLES
DYDIEM CAUSE CAUSE
TIA 11 E 12 E 13 IN S T R U 14 TT 15 Z 16
TO REPORT NUMBER 21 22 23 24 25 20 6 7 CODE TYPE REVISION NO.
ACTION FUTURE EFFECT SHUTDOWN TAKEN ACTION ON PLANT METHOD HOURS (22) ATTACHMENT NPRD-4 PRIME COMP. COMPONENT MANUFACTURER
CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)
High reading was due to some dirt in XMTR sensing lines and XMTR
oscillator PN805B217U01, being out of tune. Oscillator was retuned
and sensing lines blown down. Oscillators becoming out of tune has not
been a recurring problem. These XMTR sensing lines are being blown
down at each refueling. No further action is required.
FACILITY STATUS  STATUS  STATUS  OTHER STATU
RELEASED OF RELEASE AMOUNT OF ACTIVITY 35 NA LOCATION OF RELEASE 36 NA
PERSONNEL EXPOSURES NUMBER TYPE DESCRIPTION (39) NA  7811240 (34) NA
PERSONNEL INJURIES NUMBER DESCRIPTION(1) NA 1910
LOSS OF OR DAMAGE TO FACILITY (43)
PUBLICITY (A)
NA NA NA NA NA NA NA
NAME OF PREPARER John Campbell PHONE 746-2084 X-244 0