

UNION CARBIDE CORPORATION

METALS DIVISION

137 47TH STREET, P.O. BOX 97, NIAGARA FALLS, N.Y. 14302

RECEIVED

MAR 25 1982 > U. S. Nuclear Regulatory

Commission

Mail Section

NMSS

Marketo 11, 1982

TELEPHONE: 716-278-3000

CABLE: TWIX NO. 710-524-16

TECHNOLOGY DEPARTMENT - ENGINEERING

> Mr. A. J. Hazle, Director Hazardous Waste Control Division Colorado Department of Health 4210 East 11th Street Denver, CO 80220

Subject: Uravan Tailings Ponds 2 and 3 - File No. 11206

Dear Mr. Hazel:

Stability Evaluation" dated June 26, 1981, which was subsequently transmitted to Mr. Hazle by Mr. Scarano on August 31, 1981. There were two specific recommendations for remedial action enumerated on Page 6 which UCC has addressed.

Item (a) referred to erosion at the upper part of the tailings slope at the northernmost end of the Pond 2 perimeter. This was repaired by grading the tailings to their original configuration. No change has occurred in this area since the repair was completed in November 1981.

Item (b) noted some minor seepage exiting at several places along the toe of the berm at Pond 3. Dr. Castro suggested installing a transverse perforated pipe to increase the flow capacity within the drainage layer. Our consultants, Acres American Inc., recommended the scheme shown in sketch SF-7835 which differed from Dr. Castro's by having the transverse pipe end near but not be connected directly to the drain pipe. Mr. John Berry of Acres American discussed this change with Dr. Castro and it was agreed that the modified installation would be satisfactory. There were six transverse drains installed along the toe of the berm for Pond 3.

It was also suggested by Dr. Castro that in the event similar seepages were to develop, the installation of additional transverse drains would be in order. Pond 2 developed one seep which was corrected by installing a perforated pipe as shown in the attached sketch SF-7834. The collected seep was independently piped through HDPE pipe to sump number 3. All drainage work was completed by Finley Contracting Company in November 1981.

If you have any questions please contact the undersigned.

TJK/mau Attachments

DOCKETED USNRC MAR 2 6 1982 P MAIL SECTION DECKET DLERK original not recit

Very truly yours,

T. J. Kagetsu

FEE EXEMP


APR 1 2 1982


8204210645 820311 PDR WASTE PDR WM-20

REV


UNION CARBIDE CORPORATION METALS DIVISION

UNION CARBI	DE CORPORA	SF- 7835					
MOTIODA	AL TRANSV	ERSE DE	AINS -	POND 3	930 256		11200
URAVAN	DEPARTMENT	BLDC NO	WJB	RKJ	RB	10.1581	NONE
ME V				HE V			

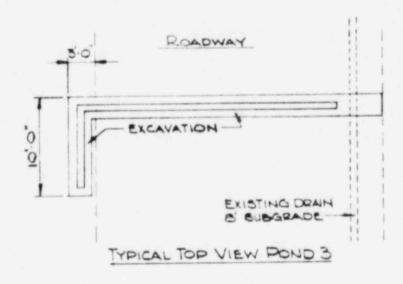

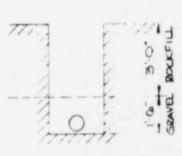

TYPICAL TRENCH

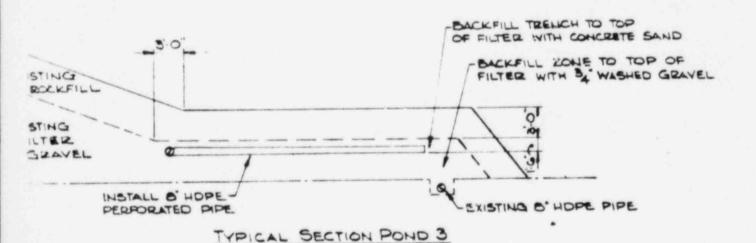

'UNION CARBIDE CORPORATION METALS DIVISION							SF- 7834			
TITLE ADDIT	TIONAL DRA	IN - PON	10 2				112		11206	
URAVAN	DEPARTMENT	BLOG NO	BLW	CHICKLU BA	RKJ		RB	1015-81	NONE	
REV		Y. 5 - 12 - 14 - 14 - 14 - 14 - 14 - 14 - 14	775-51	#1.0	No.				-	
AEV				At V						

