

LICENSEE EVENT REPORT

CONTROL BLOCK: 1

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

01 | NJSGS22 | 00-00000000-003 | 4111114 | 5

CON'T
 REPORT SOURCE: L6 | 050003117 | 0722828 | 0818829

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES 10

02 | At 1340 hours, July 22, 1982, No. 24 Accumulator level was determined to be below the
03 | operating band. No. 24 Accumulator was immediately declared inoperable and Action
04 | Statement 3.5.1a was entered at 1340 hours. At 1440 hours, No. 24 Accumulator level
05 | was restored to the specified limits. The accumulator was declared operable and
06 | Action Statement 3.5.1a was terminated. Later that day, at 1743 hours, No. 23 Accumu-
07 | lator was declared inoperable and Action Statement 3.5.1a was entered at 1743 hours.
08 | No. 23 Accumulator level was restored to the specified limits. No. 23 Accumulator was
09 | declared operable and Action Statement 3.5.1a was terminated at 1844 hours.

0 9	S F 11	B 12	A 13	I N S T R U 14	T 15	Z 16		
17	8 2 21	- 23	0 6 0 24	/ 27	0 3 28	L 30	- 31	0 32
X 18	F 19	Z 20	Z 21	0 0 0 0 37	Y 23	N 24	N 25	B 0 8 0 44

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS 27

10 | The cause of both occurrences was drift of level indications. Sightglass indications
11 | were installed on both accumulators. The level transmitters will be calibrated at
12 | the next scheduled outage. A Design Change Request, 2EC-1424, has been submitted to
13 | replace the level transmitters and install additional isolation valves at the next
14 | refueling outage.

15 | E28 | 08329 | NA30 | A31 | Operational Event32

16 | Z33 | Z34 | NA35 | NA36

17 | 00037 | Z38 | NA39

18 | 00040 | NA41

19 | Z42 | NA43

20 | N44 | NA45

8208310400 820818
 PDR ADPOCK 05000311
 S PDR

NRC USE ONLY

NAME OF PREPARER: R. Heller PHONE: (609) 541-5900 629