## LICENSEE EVENT REPORT

CONTROL BLOCK: [ ] [ ] [ ] (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)
0 1 M D C C N 1 2 0 0 - 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5 5 7 8 9 LICENSE CODE 14 16 LICENSE NUMBER 25 26 LICENSE TYPE 30 57 CAT 58 5
CON'T  O 1  SOURCE L 6 0 5 10 0 0 3 11 7 7 0 8 3 1 8 2 8 0 9 3 0 8 2 9  EVENT DESCRIPTION AND PROBABLE CONSEQUENCES 10  At 1320 during performance of surveillance testing, 12 auxiliary feed-
0 3 water pump governor linkage vibrated loose rendering the pump inoper-
[0]4] able. The linkage was repaired and the pump returned to service at
0 5 1415. The redundant auxiliary feedwater pump remained operable
0 6 throughout the event.
0 7 Similar events: none.
08 80
SYSTEM CODE SUBCODE COMPONENT CODE SUBCODE SUB
CAUSE DESCRIPTION AND CORRECTIVE ACTIONS   CODE   TYPE   NO.   CODE   TYPE   TYPE   NO.   TYPE
10 Loose nut connecting governor lever to connecting rod backed off its pin
causing pin to come out. Pin was reinserted, and nut tightened. Other
Aux Feed Pumps were checked for loose governor linkage nuts, but all
were tight. A monthly preventive maintenance procedure is being revised
to include the tightening of governor linkage nuts if necessary.
FACILITY STATUS SPOWER OTHER STATUS 30 METHOD OF DISCOVERY DESCRIPTION 32  1 5 E 28 1 0 0 29 N/A B 31 Surveillance Test  7 8 9 10 12 13 44 45 46 80
ACTIVITY CONTENT RELEASED OF RELEASE AMOUNT OF ACTIVITY 35  1 6 Z 33 Z 34 N/A  PERSONNEL EXPOSURES  AMOUNT OF ACTIVITY 35  N/A  44  80
NUMBER TYPE DESCRIPTION (39)  N/A  7 8 9 PERSONNEL INJURIES 13  80
7 8 9 11 12 DESCRIPTION 41) N/A R210130578 820930
TYPE DESCRIPTION PDR ADDCK OSOUGHT S PDR ADDCK OSOUGHT S PDR
PUBLICITY ISSUED DESCRIPTION 45 N/A N/A N/A N/A N/A N/A N/A
NAME OF PREPARER M. A. Junge/R. W. L'Heureux PHONE: 301-269-4969/4869