

APPENDIX A

NOTICE OF VIOLATION

Jersey Central Power and Light Company

Docket No. 50-219

Based on the results of an NRC inspection conducted on September 5-7, 1978, it appears that certain of your activities were not conducted in full compliance with conditions of your NRC Facility License No. DPR-16 as indicated below. These items are infractions.

- A. Technical Specification 4.5.Q requires that all hydraulic snubbers listed in Table 3.5.1 be visually inspected in accordance with the schedule provided. Based on failures observed during a previous inspection, the licensee was required to visually inspect all hydraulic snubbers in Table 3.5.1 at least three times between April 29, 1978 and August 31, 1978.

Contrary to the above, two hydraulic snubbers (Nos. 23 and 24 in the Core Spray System, elevation 51) listed in Table 3.5.1 were not visually inspected during the period of January 13, 1978 to September 9, 1978.

- B. Technical Specification 6.8.1 states in part: "Written procedures shall be established, implemented, and maintained...." Procedure 775.1.003, Revision 1, Inspection of Bergen Patterson Hydraulic Snubbers states in part: "If the accumulator telltale indicates greater than the +1/2 tolerance...bleed out some of the fluid...; if the accumulator telltale indicates lower than -1/2 tolerance... add GE Silicon Fluid SF1154...to correct the level."

Contrary to the above, during the conduct of Procedure 775.1.003 on August 10, 1978, eleven telltales indicated outside the $\pm 1/2$ tolerance and no corrective action was taken.

7812070291