

.....

COOPER NUCLEAR STATION P.O. BOX 98, BROWNVILLE, NEBRASKA 68321 TELEPHONE (402) 825-3811

CNSS948082

March 17, 1994

U.S. Nuclear Regulatory Commission Document Control Desk Washington, D.C. 20555

Dear Sir:

Cooper Nuclear Station Licensee Event Report 94-003 is forwarded as an attachment to this letter.

Sincerely,

R. L. Gardner Plant Manager

RLG/nc

Attachment

cc:	L. J. Callan
	G. R. Horn
	J. M. Meacham
	R. E. Wilbur
	V. L. Wolstenholm
	D. A. Whitman
	INPO Records Center
	NRC Resident Inspector
	R. J. Singer
	CNS Training
	CNS Quality Assurance

1628

NRC FORM (5-92)	4 366	т. Т.		U.1	S. MUCLE	AR R	EGULATO	RY COM	MISSION		APPROVED B	OMB NO. IRES 5/31	3150-0 /95	104
(See	rever	LIC:	ENSEI	EVENT RE	PORT s/charac	(L)	ER) i for ea	ch blo	ock)	ESTIMAT THIS II FORWARD THE IN (MNBB 7 WASHING REDUCTI MANAGEM	TED BURDEN PE NFORMATION CO COMMENTS RE FORMATION AND 7714), U.S. NU GTON, DC 20555 TON, DC 20555 TON, PROJECT MENT AND BUDGE	R RESPON LLECTION GARDING RECORDS CLEAR REG -0001, A (3150-0 T, WASHIN	NSE TO REQUES BURDEN MANAG BULATOR ND TO 1 1043, IGTON, I	COMPLY WIT T: 50.0 HRS ESTIMATE T EMENT BRANC COMMISSION (HE PAPERWOR OFFICE 0 0C 20503.
FACILITY	r name r NUC	(1) LEAR	STATI	N						DOCKET	NUMBER (2) 05000298	3	1	PAGE (3) OF 4
TITLE (4	• Tec Imr	hnica	1 Spe 1v As	cification V sembled Part	iolati iculat	on e/	for I Lodine	nope Fil	rable ter A	Radia	tion Monit ies	ors (a	used	Вy
EVEN	T DATE	(5)	) (	LER NUMBER (6	)	1	REPOR	T DAT	E (7)		OTHER FACIL	ITIES INV	VOL VED	(8)
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISI	CON R	MONTH	DAY	YEAR	FACILITY NAME			DOCKET NUMBER	
02	15	94	94	003	00					FACILITY NAME			DOCKET NUMBER	
OPERAT	TING	I	THIS R	EPORT IS SUBMITT	ED PURSU	ANT	TO THE	REQUIR	EMENTS	OF 10 CF	R §: (Check (	one or mo	re) (11	)
MODE	(9)	N	20.	402(b)	Contraction of the local division of		20.4050	c)			50.73(a)(2)(i	V)	73	.71(b)
20.405(a)(1)(i)				50.36(c)(i)				50.73(a)(2)(v)			73	.71(c)		
LEVEL (10) 100		20.405(a)(1)(ii)				50.36(c)(2)			50.73(a)(2)(vii)			OTHER (Specify in		
20.405(a)(1)(			405(a)(1)(iii)	x 50.73(a)(2)(i)			)	50.73(a)(2)(viii)(A)						
			20.405(a)(1)(iv)				[50.73(a)(2)(ii)			50.73(a)(2)(viii)		(iii)(B)	Abstract below and in Text, NRC Form 366A)	
			20,405(a)(1)(v)				50.73(a)(2)(iii)			50.73(a)(2)(x)				
	international	Mich. Hickory	A send rains		LICENSE	FF C	ONTACT F	OR TH	IS LER	(12)	Andre and an and an and an and a state of the		A good a service of the	
NAME					E. 1 WE. P. 51				and a state of the	h	TELEPHONE NUM	IBER (Inc	lude Ar	ea Code)
John	R. M	yers									(402) 82	25-381	1	
			CO	APLETE ONE LINE F	OR EACH	COM	PONENT F	ALLURI	DESCR	BED IN T	HIS REPORT (1	3)	-	
CAUSE	SYST	EM C	OMPONEN	MANUFACTURER	REPORT TO NE	TABL	E		AUSE	SYSTEM	COMPONENT	MANUFAC	TURER	REPORTABLE TO NPRDS
D	IL		MON	KOZO	N									
anne stantend	And the second second	nera franatis	SUPPLEM	ENTAL REPORT EXP	CIED (1	43	and a second	an and a super-	The Lot Area in the second	Constitution and	VDECIED	MONTH	1 04	Y YEAR
YES (If y	ves, co	mplete	EXPECTED	SUBMISSION DATE	).		XW	0		SU DA	BMISSION TE (15)	and the second second		

ABSTRACT (Limit to 1400 spaces, i.e., approximately 15 single-spaced typewritten lines) (16)

On February 15, 1994, RMV-RM-30B, the Radwaste Building High Range Gaseous Effluent Radiation Monitor, was declared inoperable at 1:48 pm upon discovering a missing O-ring in the lower portion of the sample assemble that could have resulted in an inaccurate sample if the monitor was required to operate. Continued investigation determined that an additional O-ring was missing in the upper portion of the sample assembly. Following O-ring installation a. I leak testing, the monitor was declared operable at 2:39 pm on February 18. On February 22 at 5:35 pm, two similar monitors, RMV-RM-20B, Turbine Building High Range Gaseous Effluent Radiation Monitor, and RMP-RM-3B, Elevated Release Point High Range Gaseous Effluent Radiation Monitor, were declared inoperable upon determining that O-rings were also missing in the upper portion of the sample assemblies. Following O-ring installation and leak testing, these monitors were returned to service on February 25 at 4:45 pm.

The lower O-ring was not installed during previous surveillance testing or maintenance. The upper O-rings were removed to allow use of an alternate sample cartridge, and were not replaced when the original configuration was restored. Personnel have been made aware of the situation and procedures will be revised to provide additional guidance on the replacement and testing of the sample assembly.

NRC FORM 366A (5-92)	U.S. N LICENSEE EVENT REPOR TEXT CONTINUAT	APPROVED BY ONB NO. 3150-0104 EXPIRES 5/31/95 ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (MNBB 7714., U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104.), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.				
New York Contract of Contract						
	FACILITY NAME (1)	DOCKET NUMBER (2)		LEK NUMBER (D		PAGE (3)
COOPER MICT	THE OTHERTON		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	
COUPER NUCL	CAR STATION	05000298	94	003	00	2 OF 4

TEXT (If more space is required, use additional copies of NRC Form 366A) (17)

#### A. Event Description

On February 15, 1994, the particulate/iodine filter sample assembly for the Radwaste Building High Range Gaseous Effluent Radiation Monitor (RW monitor), RMV-RM-30B, was found loose in the sample holder. Investigation revealed an O-ring was missing in the lower portion of the sample assembly. It was determined that the missing lower O-ring had the potential to dilute sample flow during post accident conditions. The monitor was declared inoperable at 1:48 pm. Upon discovery of the condition in the RW monitor, the two similar high range gaseous effluent radiation monitors, RMV-RM-20B, Turbine Building High Range Gaseous Effluent Radiation Monitor, and RMP-RM-3B, Elevated Release Point High Range Gaseous Effluent Radiation Monitor (ERP monitor), were inspected. During this inspection O-rings were found to be installed in the lower portion of the sample assembly. Based upon the as-found conditions, these monitors were considered operable.

On February 18, review of a vendor drawing for the RW monitor filter assembly showed an O-ring in the upper portion of the filter assembly. However, a parts list that indicated the O-rings applicable to the drawing was not available. The O-rings for the sample assembly were replaced as shown on the drawing and upon completion of leakage testing the RW monitor declared operable at 2:39 pm. Engineering confirmed the drawing's applicability to these installations and a subsequent inspection of the ERP and Turbine Building monitors on February 22 determined that the O-ring for the upper portion of the sample assembly was missing. The monitors were declared inoperable at 5:35 pm. Subsequently, the appropriate O-rings were installed, testing completed, and the monitors declared operable on February 25 at 4:45 pm.

#### B. Plant Status

The plant was in power operation at approximately 100 percent power at the time of this discovery.

## C. Basis for Report

Technical Specification section 3.2.H requires the RW, ERP, and Turbine Building monitors to be operable. In the event the monitors are inoperable, the preplanned alternative method of sampling is to be initiated within 72 hours, and the monitor restored to operability within 7 days. In the as-found condition, the monitors may not have provided representative release rate indications during post accident monitoring. This condition could provide non-conservative indications should a major release have occurred and this is considered a condition prohibited by Technical Specifications, reportable in accordance with 10CFR50.73(a)(2)(i).

MRC FORM 366A (5-92)	U.S. MU	APPROVED BY OMB NO. 3150-0104 EXPIRES 5/31/95						
LIĆ	ENSEE EVENT REPOR TEXT CONTINUATI	ESTIMA THIS I FORWAR THE I (MHBB WASHIN REDUCT MANAGE	ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND RUDGET WASHINGTON DC 20503					
F	ACILITY NAME (1)	DOCKET NUMBER (2)		LER MUMBER (6	)	PAGE (3)	)	
COOPER NUCLEAR	TAD CTATION		YEAR	SEQUENTIAL	REVISION NUMBER			
OUDTER NUULEAR	O TULT TON	05000298	94	003	00	3 OF 3	3	

TEXT (If more space is required, use additional copies of MRC Form 366A) (17)

### D. <u>Cause</u>

The high range monitors are calibrated on a 12 month frequency. At the time of the calibration, the sample cartridge may be disassembled and the filter paper and iodine cartridge replaced. It is apparent that during a prior calibration the O-ring in the lower portion of the filter assembly of the RW monitor was not installed. The last calibration of the monitor was performed in August, 1993. Personnel responsible for performing the most recent calibration were uncertain if the O-ring was present. Based upon this, it is unknown when the O-ring was omitted from the filter assembly.

The missing upper O-ring is attributable to the use of an alternate particulate/iodine cartridge. The best estimate is that use of the alternate cartridge began in 1985. Because of physical differences between the original and alternate cartridges, their use resulted in a loose fit of the particulate filter and iodine cartridge within the sample assembly. To provide a tight fit (i.e., greater compression), the O-ring in the upper portion of the sample assembly was removed. Discussions with the vendor indicated that the O-ring was not required if a tight fit was obtained. When use of the original cartridge was subsequently "caumed, the O-ring was not replaced. No instructions were available to the Chemistry Technicians specifying the need for O-rings in this installation, and no technical review of the installation of the alternate cartridge was conducted, resulting in the failure to identify the need for O-rings upon reinstallation of the original cartridge design. Additionally, the existing surveillance procedure did not require leak testing of the particulate/iodine sample assembly.

# E. Safety Significance

The high range gaseous effluent radiation monitors operate during accident conditions to predict offsite releases as a basis for protective action recommendations. The initial indications of radioactive releases would be identified by the normal range gaseous effluent radiation monitors. In the event of significant releases, the normal range monitors transfer the indication functions to the high range monitors, and, if releases continue to increase, the normal range monitors will automatically cease operation. Additionally, other indications of accident significance would be utilized in the formulation of protective action recommendations. Dose assessments, utilized as the basis for protective action recommendations, are initially based on indicated noble gas releases, but are updated with field monitoring team data as soon as it is available. It is unlikely that a significant effect regarding the protective accion recommendations would have occurred.

NRC FORM 366A U.S. NUCLEAR REGULATORY COMMISSION (5-92) ' LICENSEE EVENT REPORT (LER) TEXT CONTINUATION		APPROVED BY OMB NO. 3150-0104 EXPIRES 5/31/95					
		ESTIMATED BURDEN PER RESPONSE TO COMPLY WIT THIS INFORMATION COLLECTION REQUEST: 50.0 HRS FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANC (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSION WASHINGTON, DC 20555-0001, AND TO THE PAPERWOR REDUCTION PROJECT (3150-0104), OFFICE O MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.					
FACILITY NAME (1)	DOCKET NUMBER (2)		LER NUMBER (6)		PAGE (4)		
COOPER NUCLEAR STATION	05000298	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	4 OF 4		
		24	003	00			
TEXT ([f more space is required, use additional copies of	of NRC Form 366A) (17	0					
F. Safety Implications							
The safety implications associated wi the plant in operation at full power.	th this deficie	ncy ai	e most sign	ificant	with		
G. <u>Corrective Action</u>							
The missing O-rings were replaced and the monitors to service to ensure the monitors utilize a similar sample ass installation differences. Standby mo these sampling systems are not suscep	a leak test was repairs were es embly, but, wou nitors are also tible to a simi	s cond ffecti ld not being lar co	ucted prior ve. The no be affected examined to ondition.	to retu rmal ran d due to ensure	urning nge 9 e that		
To prevent recurrence, personnel have procedures for replacement of the car radiation monitors will be revised to O-rings and require leakage testing w replaced.	been made awar tridge and filt provide guidan then the cartrid	e of t er in ce on ge and	the situation the gaseous the replacen filter or (	n and th effluer ment of D-rings	ne nt the are		
H. <u>Similar Events</u>							
None.							
SUPPLEMENTAL INFORMATION							
Manufacturer: Kaman Sciences Corpora Model: KMG-HRH	tion						
EIIS Component Code: MON							
EIIS System Code: IL							