NRC FOR (7-77)	
1	CONTROL BLOCK:
0 1	I I
CON'T	REPORT SOURCE L 6 0 5 0 0 2 6 5 7 0 8 0 2 8 2 3 0 8 2 7 8 2 9 EVENT DESCRIPTION AND PROBABLE CONSEQUENCES 10
0 2	On August 2, 1982, an Equipment Attendant, while performing his rounds, found the
03	outboard gland and packing nut off and the lantern ring and packing partially out
04	of the 2-1001-65C RHRS Service Water main pump. The pump could have performed its
0 5	design function, but continued operation in this condition may have led to a de-
06	graded mode of operation. Since the pump was one of two 100% capacity pumps, its
07	removal from service for maintenance did not prevent the RHR Service Water System
0 8 7 8	from meeting its design criteria. All surveillances required by Technical Specifica 9 tion 3.5.B.2 were completed prior to taking the pump out of service. SYSTEM CAUSE CAUSE CAUSE CAUSE CAUSE
09	$ \begin{array}{c} \begin{array}{c} \begin{array}{c} \begin{array}{c} \begin{array}{c} \begin{array}{c} \begin{array}{c} \end{array} \\ \end{array} \end{array} \end{array} \end{array} \\ \begin{array}{c} \\ \end{array} \end{array} \\ \begin{array}{c} \end{array} \end{array} \\ \end{array} \\ \end{array} \end{array} \\ \begin{array}{c} \end{array} \end{array} \\ \end{array} \\ \end{array} \end{array} \\ \end{array} \end{array} \\ \end{array} \end{array} \\ \end{array} \\ \end{array} \\ \end{array} \\ \end{array} \\ \end{array} \end{array} \\ \end{array} \\ \\ \end{array} \end{array} \\ \\ \end{array} \\ \end{array} \\ \end{array} \\ \end{array} \\ \\ \end{array} \\ \end{array} \\ \\ \end{array} \\ \end{array} \\ \\ \\ \end{array} \\ \\ \end{array} \\ \\ \end{array} \\ \\ \end{array} \\ \\ \\ \end{array} \\ \\ \\ \end{array} \\ \\ \\ \\ \\ \\ \\ \\ \end{array} \\$
	Image: Secure transmission Secure transmission Occurrence Report Report Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image: Secure transmission Image:
	ACTION FUTURE COMPONENT TAKEN ACTION ON PLANT SHUTDOWN HOURS 22 ATTACHMENT NPRD-4 PRIME COMPONENT MANUFACTURER ATTACHMENT FORM SUB PRIME COMPONENT MANUFACTURER MANUFACTURER A 18 X 19 Z 20 Z 21 0 0 0 0 N 23 Y 24 N 25 1 0 7 5 6
	CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27) 40 41 42 43 44 47
10	The cause of this occurrence is still under investigation. A supplemental report
1 1	will be submitted when the cause has been established. The immediate corrective
1 2	action was to repack the pump on August 2, 1982. The installation of mechanical
13	seals on these pumps is being investigated. This may provide a long term solution
1 4 7 8	to this problem.
15	FACILITY STATUS SPOWER OTHER STATUS 30 METHOD OF DISCOVERY DISCOVERY DESCRIPTION 32 LE 28 0 8 2 29 NA B 31 Operator Observation 32 0 10 12 13 44 45 46 000000000000000000000000000000
	CTIVITY CONTENT ELEASED OF RELEASE AMOUNT OF ACTIVITY 35 Z 33 Z 34 NA LOCATION OF RELEASE 36 NA 44 45
17	PERSONNEL EXPOSURES NUMBER TYPE DESCRIPTION 39 0 0 0 37 Z 38 NA
	9 PERSONNEL INJURIES 13 NUMBER DESCRIPTION (41)
7 8	9 11 12 80 LOSS OF OR DAMAGE TO FACILITY (43)
19 7 8	Z 42 NA B2070B028B B20827 3 10 NA DR ADOCK 05000265 30
20	ISSUED DESCRIPTION (45)
2 8	0 10 68 69 80-3 NAME OF PREPARER W. Leaverton PHONE 309-654-2241, ext. 198 8