

LICENSEE EVENT REPORT

CONTROL BLOCK: [] [] [] [] [] [] (1) (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

[0] [1] [C] [A] [5] [0] [5] [2] (2) [0] [0] - [0] [0] [0] [0] [0] [0] - [0] [0] (3) [4] [1] [1] [1] [1] (4) [] [] (5)

CON'T [0] [1] REPORT SOURCE [L] (6) [0] [5] [0] [0] [0] [3] [6] [1] (7) [0] [8] [0] [6] [8] [2] (8) [0] [8] [3] [1] [8] [2] (9)

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10) While in Mode 2 Control Element Assembly (CEA) #86 slipped and dropped in excess

[0] [3] of 7 inches (indicated position) in violation of Technical Specification 3.1.3.1.

[0] [4] This event has no effect on public health and safety since they do not affect the
[0] [5] ability of the CEA to insert into the core whenever required.

[0] [9] SYSTEM CODE [I] [A] (11) CAUSE CODE [E] (12) CAUSE SUBCODE [B] (13) COMPONENT CODE [C] [R] [D] [R] [V] [E] (14) COMP. SUBCODE [Z] (15) VALVE SUBCODE [Z] (16)

(17) LER/RO REPORT NUMBER [] EVENT YEAR [8] [2] SEQUENTIAL REPORT NO. [] OCCURRENCE CODE [] REPORT TYPE [L] REVISION NO. [0]

ACTION TAKEN [B] (18) FUTURE ACTION [Z] (19) EFFECT ON PLANT [Z] (20) SHUTDOWN METHOD [Z] (21) HOURS [0] [0] [0] [0] (22) ATTACHMENT SUBMITTED [N] (23) NPRD-4 FORM SUB. [N] (24) PRIME COMP. SUPPLIER [N] (25) COMPONENT MANUFACTURER [C] [4] [9] [0] (26)

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

[1] [0] The cause for the slippage is slow operation of the grippers which prevented one
[1] [1] of the grippers (upper or lower) from making up to the CEA prior to the other
[1] [2] gripper releasing. Corrective measures adopted included exercising the CEA and
[1] [3] application of hydrazine to remove oxide deposits, and circuit modifications.

[1] [5] FACILITY STATUS [B] (28) % POWER [0] [0] [0] (29) OTHER STATUS [NA] (30) METHOD OF DISCOVERY [A] (31) DISCOVERY DESCRIPTION [Low Power Physics Testing] (32)

[1] [6] ACTIVITY CONTENT [Z] (33) RELEASED OF RELEASE [Z] (34) AMOUNT OF ACTIVITY [NA] (35) LOCATION OF RELEASE [] (36)

[1] [7] PERSONNEL EXPOSURES NUMBER [0] [0] [0] (37) TYPE [Z] (38) DESCRIPTION [NA] (39)

[1] [8] PERSONNEL INJURIES NUMBER [0] [0] [0] (40) DESCRIPTION [NA] (41)

[1] [9] LOSS OF OR DAMAGE TO FACILITY TYPE [Z] (42) DESCRIPTION [NA] (43) 8209140277 820831 PDR ADOCK 05000361 PDR

[2] [0] PUBLICITY ISSUED [N] (44) DESCRIPTION [NA] (45)

NAME OF PREPARER H. B. Rav HBPay / TLMordy PHONE 714/492-7700