



1. LER NUMBER: 82-091/03L-0
11. LASALLE COUNTY STATION: UNIT 1
111. DOCKET NUMBER: 050-373
- VI. EVENT DESCRIPTION:

On August 18, 1982 at 1825 hours, during the performance of LIS-RI-01, Steam Line High Flow RCIC Calibration and Functional Test, Differential Pressure Indicating Switch 1E31-N013A setpoint was found out of tolerance. Also, DPIS 1E31-N013B was found to have a reset problem.

Technical Specification 3.3.2 requires this instrumentation to be operable and their setpoints be consistent with table 3.3.2-2.

V. PROBABLE CONSEQUENCES OF THE OCCURRENCE:

In accordance with Technical Specification 3.3.2, the RCIC system was declared inoperable. DPIS 1E31-N013B would have performed its isolation actuation function when required. All ECCS systems were operable at the time of the occurrence. Safe plant operation was maintained at all times.

VI. CAUSE:

Upon investigation, DPIS 1E31-N013A had a broken locking device which allowed setpoint drift. DPIS 1E31-N013B could not be reset during the performance of LIS-RI-01 due to the reset function being out of adjustment. Both switches are Barton Model 288A.

VII. CORRECTIVE ACTION:

A new locking device was installed on 1E31-N013A on August 20, 1982 and the switch was declared operable. The resetting function of 1E31-N013B was adjusted on August 18, 1982.

Prepared by: R. W. Houston