CONTROL BLOCK [ ] [ ] [ ] (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)	
0 1 C T M N S 1 2 0 0 - 0 0 0 0 - 0 0 3 4 1 1 1 1 1 4 5 5 CAT 58	
CON'T SOURCE 60 61 DOCKET NUMBER 68 69 EVENT DATE 74 75 REPORT DATE 80 EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)	
[0]2 [On August 17, 1982, at 0450 hours and August 24, 1982, at 0500 hours, while performing	_
[0]3 [Gas Turbine Emergency Fast Start Test, the Gas Turbine failed to start when given a fas	t
[0]4] [start signal from the Control Room. Operations personnel re-energized the 14G bus and	1
[0]5 [declared the Gas Turbine inoperable. Technical Specification 3.9.a. requires the	
[0]6 [Diesel Generator and Gas Turbine Generator (both emergency power sources) to be operabl	e
[0]7 [at all times. There were no consequences. See attached sheet.	_
7 8 9 SYSTEM CAUSE CAUSE COMP. VALVE	80
CODE CODE SUBCODE COMPONENT CODE SUBCODE SUBCO	
LER/RO EVENT YEAR REPORT NO.  17 REPORT NUMBER 21 22 23 24 26 27 28 29 30 31 31 32  ACTION FUTURE ON PLANT METHOD HOURS 22 ATTACHMENT SUBMITTED FORM SUB. SUPPLIER MANUFACTURE IX 18 X 19 X 19 X 20 X 37 40 41 23 Y 24 X 26 X 37 40 41 23 X 24 X 26 X 37 40 41 X 23 X 24 X 26 X 37 40 41 X 23 X 24 X 26 X 37 40 41 X 23 X 24 X 26 X 37 40 41 X 23 X 24 X 26 X 37 40 41 X 25 X 26 X 27 X 28 X 29 X 30 X 31 X 32 X 32 X 32 X 33 X 34 X 35 X 36 X 37	P 2 26
The air start motor did not receive an air supply. Rust contamination in the air pres	s-J
[1]1   ure regulating valve jammed the valve. On the first incident the air pressure regulat	
ing valve was cleaned, inspected and reinstalled. On the second incident the valve wa	S
replaced with a rebuilt unit from the vendor. During the 1982 Refuel Outage the air r	e j
ceiver will be sandblasted and coated and the air line replaced with better material.	80
FACILITY STATUS 30 METHOD OF DISCOVERY DESCRIPTION 32 NA	80
7 8 9 ACTIVITY CONTENT 12 13  AMOUNT OF ACTIVITY 35  RELEASED OF RELEASE AMOUNT OF ACTIVITY 35  NA N	80
NUMBER OF TYPE DESCRIPTION (39)  NA  PERSONNEL INJURIES  NA  NA	80
NUMBER DESCRIPTION 41 NA	
1 8 9 11 12 LOSS OF OR DAMAGE TO FACILITY 43 TYPE DESCRIPTION 43	80
1 9 Z 42 NA SPORTAGE	80
7 PUBLICITY   S209240309 820916   NAC USE ONLY   PDR ADDCK 05000245   PDR 68 69	80.5
NAME OF PREPARED Trudy Schweikert Thull PHONE (203) 447-1791	0