NRC FORM 366 (12-81)	LICENSEE EVENT REPORT	APPROVED BY OME 3130-0011 EXPIRES 4-30-82
CONTROL BLOCK	1) IPLEASE PRINT OR TYPE ALL	REQUIRED INFORMATION
O 1 N C M G S 1 2	0 0 - 0 0 0 0 0 - 0 0 3 4 1	ENSE TYPE 30 37 CAT 50 S
O 1 SOURCE L 6 0 5	0 0 0 3 6 9 0 0 9 2 7 8 2 6	1 1 0 5 8 2 9
O 2 While in mode 1, t	he chiller package for Train B of conti	rol room Ventilation
System (VC) trippe	d due to high bearing temperature and v	was declared inoperable.
A similar incident	occurred on Train A on 10/12/82. Thes	se incidents violate
0 5 T.S.3.7.6 and are	reportable pursuant to T.S.6.9.1.13(b)	Because of the
o e availability of a	redundant train, health and safety of t	the public were
0 7 unaffected.		
0.8		
SYSTEM CODE S G 10	CAUSE SUBCODE COMPONENT CODE SUBS	Z 15 LZ 16
LER/RO EVENT YEAR 17 REPORT 8 2 21 22 ACTION PUTURE EFFECT ON PLANT X 18 G 19 Z 2 35	SEQUENTIAL REPORT NO	SPIME COMP. SUPPLIER 24 13 25 12 13 12 13 14 15 16 17 18 18 18 18 18 18 18 18 18
CAUSE DESCRIPTION AND COR	ARECTIVE ACTIONS (27) ature was high due to excess oil in the	chiller (oil heats
1 because compressor	's transmission operates in the oil who	en reservoir is over
1 2 [filled). A proced	ural deficiency could have led to exces	ss oil being placed in
1 3 the chiller packag	e. The excess oil was removed from the	chiller packages while
	0	le on the same days they
1 5 E 28 0 5 0 29 12 12		90
	A LOCATIO	N/A
PERSONNEL EXPOSURES	CRIPTION 39	
17 6000023	N/A	40
PERSONNEL INJURIES	1	
1 8 0 0 0 0 N/A	Dit liberi, seconder.	***
1 9 Z 42 N/A	S PDR	80
PUBLICITY ISSUED DESCRIPTION 45 N/A N/A		NRC USE ONLY
NAME OF PREPARE	a Phillip B. Nardoci PHONE	(704) 373-7432

2. 11