

Charles W. Jackson  
Vice President

Consolidated Edison Company of New York, Inc.  
Indian Point Station  
Broadway & Bleakiey Ave.,  
Buchanan, NY 10511  
Telephone (914) 737-8116

November 9, 1982

Re: Indian Point Unit No. 2  
Docket No. 50-247

Mr. Ronald C. Haynes, Regional Administrator  
Region I  
U.S. Nuclear Regulatory Commission  
631 Park Avenue  
King of Prussia, Pennsylvania 19406


Dear Mr. Haynes:

In accordance with the Technical Specifications of Facility Operating License No. DPR-26, the following confirms notification on November 8, 1982 to Mr. Peter Koltay of your office, by Mr. Michael Blatt of Consolidated Edison of a Reportable Occurrence LER 82-045. This event is the type defined in Technical Specification, Section 6.9.1.7.1.c.

The Cycle 5/6 spent fuel inspection program includes a video examination of fuel assemblies scheduled to be returned to the core for Cycle 6. As a result of the review of videotapes of fuel assembly F-44, Con Edison was informed by Westinghouse at 3:25 p.m. on November 8 that an upper end plug from one fuel rod was observed to be lodged between the upper end plugs of adjacent fuel rods within this assembly. The end spring for the affected fuel rod was visible, extending out of the top of the rod, indicating that the fuel pellets remained contained inside the rod. No other significant anomalies were observed for this assembly. The affected assembly will not be returned to the core for Cycle 6.

Consolidated Edison believes that this report also satisfies the requirements of 10 CFR Part 21.

Very truly yours,

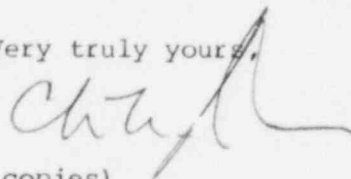

cc: Mr. William McDonald, Director (2 copies)  
Office of Management Information and  
Program Control  
c/o Distribution Services Branch, DDC, ADM  
U.S. Nuclear Regulatory Commission  
Washington, D. C. 20555

Mr. T. Foley, Senior Resident Inspector  
U.S. Nuclear Regulatory Commission  
P. O. Box 28  
Buchanan, New York 10511

8211230043 821109  
PDR ADOCK 05000247  
S PDR

IE 29