LICENSEE EVENT REPORT

LIGHT REPORT
CONTROL BLOCK: [] [] (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)
0 1 C A S 0 S 2 2 0 0 - 0 0 0 0 - 0 0 3 4 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
CCN'T 0 1 REPORT L 6 0 5 0 0 3 6 1 7 1 0 1 9 8 2 8 1 1 1 7 8 2 9 3 SOURCE 60 61 DOCKET NUMBER 68 69 EVENT DATE 74 75 REPORT DATE 80
On November 2, 1982, an error was discovered in a temporary modification on low level
[0]3 cut off controls made to the Spray Chemical Tank (T-105) on October 19, 1982. This
ola error would have prevented both trains of the system from delivering the full required
ols amount of NaON solution into the Containment Spray System. In addition, Train B
old was inoperative due to the fact that its level instrument was inoperable during this
o[7] L period. The public health and safety were not affected by this occurrence since
the CSS was operable at all times and the IRS was operable at a reduced efficiency, assuming a design basis event. CAUSE CAU
S A 10 X X X X X X X X X X X X X X X X X X
LER/RO EVENT YEAR SEQUENTIAL REPORT NO. LIZIT TYPE TYPE NO. LIZIT TO THE NO. LER/RO LIZIT TYPE NO. LIZIT TYPE N
ACTION FUTURE ON PLANT SHUTDOWN METHOD HOURS (2) ATTAGHMENT SUBMITTED FORM SUB. PRIME COMP. SUPPLIER MANUFACTUR_R Z 2 3 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4
CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27) The inoperability of both trains of the Iodine Removal System (IRS) was due to a
design error in the temporary modification and inoperability of Train B was due to
improperly installed heat tracing causing erroneous low level signals. The
temporary modification was corrected on November 3, 1982. The instrument problem
was corrected, tank level circuitry recalibrated and the instrument returned to service on November 5, 1982.
FACILITY STATUS 30 METHOD OF DISCOVERY DESCRIPTION 32 1 5 B 28 0 0 0 0 0 29 NA OTHER STATUS 30 Engineering Review
ACTIVITY CONTENT 12 13 44 45 46
RELEASED OF RELEASE AMOUNT OF ACTIVITY (35) NA PERSONNEL EXPOSURES AMOUNT OF ACTIVITY (35) NA LOCATION OF RELEASE (36) NA 80
7 8 9 DESCRIPTION (39)
1 8 0 0 0 0 0 0 NA
LOSS OF OR DAMAGE TO FACILITY (43) TYPE DESCRIPTION NA 8211290522 821117 NA 8211290522 821117 PARCE ADDICK 05000361
ISSUED (CESCRIPTION (45) NA
NAME OF PREPARER H. S. REV. HB Rmy / NUMBER 711/492-770