## LICENSEE EVENT REPORT

	Elocitote Evelville on
•	CONTROL BLOCK: (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)
0 1	1 L Z I S I 2 0 0 - 0 0 0 0 - 0 0 3 4 1 1 1 1 1 4 5 5 1 CAT 58 5
CON'T 0 1 7 8	REPORT L 6 0 5 0 0 0 3 0 4 7 0 1 3 1 8 3 8 0 9  EVENT DESCRIPTION AND PROBABLE CONSEQUENCES 10  EVENT DESCRIPTION AND PROBABLE CONSEQUENCES 10
0 2	O DG failed to accept load greater than 50% during operability
0 3	check for taking 2A RHR pump out of service. This violated Tech Spec
0 4	3.15.2.C. With O DG out of service 2B DG was declared inoperable due
0 5	to an oil leak and placed unit in violation of Tech Spec 3.15.2.H.
0 6	Unit ramp down was started. The health or safety of the public was
0 7	not affected.
08	9 SYSTEM CAUSE CAUSE COMP. VALVE
n 9 7 8	SYSTEM CAUSE CAUSE SUBCODE COMPONENT CODE SUBCODE SUBC
	17 REPORT   8   3   3   23   24   26   27   28   29   30   31   31   32   31   32   33   34   39   35   36   37   40   41   23   42   43   42   43   43   45   44   47   60   60   60   60   60   60   60   6
10	Cooper-Bessemer Turbo Charger MDL. ET-18EK9V seized reducing capacity
111	to 50%. The Turbo was replaced. O DG tested satisfactorily. This
1 2	is the second failure of this type. Preventative Maintenance Programs
1 3	are being expanded to improve monitoring of Turbo Charger performance.
1 4	The 2B DG Oil Filter Gasket was replaced, the DG tested satisfactorily.
7 8	FACILITY SPOWER OTHER STATUS 30 METHOD OF DISCOVERY DESCRIPTION 32 NA BO
	ACTIVITY CONTENT 12 13 AMOUNT OF ACTIVITY (35) AMOUNT OF ACTIVITY (35) AMOUNT OF ACTIVITY (35) AMOUNT OF ACTIVITY (36) AMOUNT OF ACTIVITY (37) AMOUNT
1 7	PERSONNEL EXPOSURES NUMBER TYPE DESCRIPTION 39 NA 80
1 8	PERSONNEL INJURIES NUMBER 0 0 0 0 0 0 0 0 NA  NA  NA
1 9 7 8	LOSS OF OR DAMAGE TO FACILITY 43  TYPE DESCRIPTION  NA  8303170354 830309  PUBLICITY PDR ADOCK 05000304  ISSUED DESCRIPTION 45  NA  PDR ADOCK 05000304  PDR ADOCK 05000304
2 0	N (44) 1973 1975 1975 1975 1975 1975 1975 1975 1975
	NAME OF PREPARER G. Fanning PHONE: (312) -746-2084 x-325 §