

LICENSEE EVENT REPORT

UPDATE REPORT - PREVIOUS
REPORT DATE 10/1/81

CONTROL BLOCK: [| | | | |] (1)

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

[0][1] [G][A][E][I][H][2] [2][0][0]-[0][0][0][0]-[0][0] [3] [4][1][1][1][1] [4] [5]
7 8 9 14 15 25 26 30 57 CAT 58

CON'T
REPORT SOURCE [L] [6][0][5][0][0][0][3][6][6] [7][0][9][0][3][8][1] [8][1][1][3][0][8][2] [9]
60 61 68 69 74 75 80

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

[0][2] While increasing power from 238 Mwt, during the performance of the "HPCI
[0][3] STEAM LINE DELTA P INSTRUMENT F.T. AND C." procedure, the N005 HPCI
[0][4] Steam Line dp Switch was found to actuate at 204.5" H2O. Tech. Specs.
[0][5] Table 3.3.2-2, item 5.1. requires actuation at <=/= 300 percent of rated
[0][6] flow (a dp of <=/= 196" H2O). Redundant switch, N004, was in tolerance.
[0][7] Plant operation and the health and safety of the public were not affected
[0][8] by this repetitive event (as last reported on LER 50-366/1980-041).

[0][9] [S][F] [11] [E] [12] [E] [13] [I][N][S][T][R][U] [14] [S] [15] [Z] [16]
9 10 11 12 13 18 19 20

[17] LER/RO REPORT NUMBER [8][1] [] [0][8][4] [] [0][3] [] [X] [] [1]
21 22 23 24 26 27 28 29 30 31 32

ACTION TAKEN [E] [18] FUTURE ACTION [F] [19] EFFECT ON PLANT [Z] [20] SHUTDOWN METHOD [Z] [21] HOURS [0][0][0][0] [22] ATTACHMENT SUBMITTED [IN] [23] NPD-4 FORM SUB. [N] [24] PRIME COMP. SUPPLIER [N] [25] COMPONENT MANUFACTURER [B][0][8][0] [26]
33 34 35 36 37 40 41 42 43 44 47

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

[1][0] The cause of this event has been attributed to setpoint drift. The
[1][1] switch, a Barton Model 288A, was recalibrated, successfully functionally
[1][2] tested, and returned to service. An engineering study to find a means
[1][3] of preventing or reducing the frequency of recurrence has recommended a
[1][4] Design Change. Recommended corrective measures are being evaluated.

FACILITY STATUS [C] [28] % POWER [0][1][0] [29] OTHER STATUS [NA] [30] METHOD OF DISCOVERY [B] [31] DISCOVERY DESCRIPTION [Surveillance Testing] [32]
7 8 9 10 12 13 44 45 46 80

ACTIVITY CONTENT RELEASED OF RELEASE [Z] [33] [Z] [34] AMOUNT OF ACTIVITY [NA] [35] LOCATION OF RELEASE [NA] [36]
7 8 9 10 11 44 45 80

PERSONNEL EXPOSURES NUMBER [0][0][0] [37] TYPE [Z] [38] DESCRIPTION [NA] [39]
7 8 9 11 12 13 80

PERSONNEL INJURIES NUMBER [0][0][0] [40] DESCRIPTION [NA] [41]
7 8 9 11 12 80

LOSS OF OR DAMAGE TO FACILITY TYPE [Z] [42] DESCRIPTION [NA] [43]
7 8 9 10 80

PUBLICITY ISSUED [N] [44] DESCRIPTION [NA] [45]
7 8 9 10 80

8212090335 821130
PDR AD0CK 05000366
S PDR

NAME OF PREPARER S. B. Tipps

PHONE (912) 367-7851