

LICENSEE EVENT REPORT

Attachment to AECM-84/0004

Page 1 of 1

CONTROL BLOCK:

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

01 MS GG S1 2 0 0 - 0 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CONT

01 REPORT SOURCE L 6 0 5 0 0 0 4 1 6 7 0 8 1 7 8 3 8 0 1 1 2 8 4 9
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

02 On August 17, 1983, during a surveillance, the M4-R4 contacts in Agastat
03 Relay 95X for MOV 1E22-F010 were found failed in the open state. The
04 contacts must close to remove the overload protection from the valve
05 circuit as required by T.S.3.8.4.2. The affected system was inoperable
06 for other reasons. This is reported pursuant to T.S.6.9.1.13.b and was
07 reported in PRD 83/12 under 10 CFR 21. This is a final report.

08
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

09 SYSTEM CODE I B 11 CAUSE CODE X 12 CAUSE SUBCODE Z 13 COMPONENT CODE RELAY X 14 COMP SUBCODE C 15 VALVE SUBCODE Z 16
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

17 LER RO REPORT NUMBER 8 3 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

ACTION TAKEN C 18 FUTURE ACTION C 19 EFFECT ON PLANT Z 20 SHUTDOWN METHOD Z 21 HOURS 0 0 0 0 22 ATTACHMENT SUBMITTED N 23 NPD-4 FORM SUB N 24 PRIME COMP. SUPPLIER A 25 COMPONENT MANUFACTURER A 1 0 9 26
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

10 The relay failure was due to mech. interface of a nylon movable contact
11 arm & the barrier strip on the melamine phenol relay base. The failures
12 are applicable to Agastat GP series relays manufactured prior to 8/77.
13 Replacement of safety-related, normally energized pre 8/77 Agastat
14 GP series relays is expected to be completed prior to the next Startup.

15 FACILITY STATUS 8 28 % POWER 0 0 0 29 OTHER STATUS NA 30 METHOD OF DISCOVERY B 31 DISCOVERY DESCRIPTION Surveillance Testing 32
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

16 ACTIVITY CONTENT RELEASED OF RELEASE Z 33 Z 34 NA 35 AMOUNT OF ACTIVITY NA 36 LOCATION OF RELEASE NA 37
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

17 PERSONNEL EXPOSURES NUMBER 0 0 0 37 TYPE Z 38 DESCRIPTION NA 39
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

18 PERSONNEL INJURIES NUMBER 0 0 0 40 DESCRIPTION NA 41
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

19 LOSS OF OR DAMAGE TO FACILITY TYPE Z 42 DESCRIPTION NA 43
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

20 PUBLICITY ISSUED N 44 DESCRIPTION NA 45
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

8401240455 840112
PDR ADOCK 05000416
S PDR

NRC USE ONLY

NAME OF PREPARER Ron Byrd

PHONE:



MISSISSIPPI POWER & LIGHT COMPANY

Helping Build Mississippi

P. O. BOX 1640, JACKSON, MISSISSIPPI 39205

January 12, 1984
84 JAN 16 15:34

NUCLEAR PRODUCTION DEPARTMENT

U. S. Nuclear Regulatory Commission
Region II
101 Marietta St., N.W., Suite 2900
Atlanta, Georgia 30303

Attention: Mr. J. P. O'Reilly, Regional Administrator

Dear Mr. O'Reilly:

SUBJECT: Grand Gulf Nuclear Station
Unit 1
Docket No. 50-416
License No. NPF-13
File 0260/L-835.0
Update Report - M4-R4 Contacts
in Agastat Relay 95X for
MOV 1E22-F010 Found Failed
in Open State
LER 83-121/03 X-2
AECM-84/0004

This letter submits an update to previous reports submitted on September 16 and November 10, 1983. The event for which the reports were submitted occurred on August 17, 1983 during a surveillance when the M4-R4 contacts in Agastat Relay 95X for MOV 1E22-F010 were found failed in the open state. The contacts must close to remove the overload protection from the valve circuit as required by Technical Specification 3.8.4.2. The event was reported pursuant to Technical Specification 6.9.1.13.b.

Our investigation into the cause of the relay failure is complete. Replacement of safety-related, normally energized, pre-August 1977 Agastat GP series relays is expected to be completed prior to the next Startup. Attached is LER 83-121/03 X-2 which is a final report. AECM-84/0024, dated January 6, 1984, provides additional information on the Agastat GP series relays and the replacement program.

Yours truly,

L. F. Dale
Manager of Nuclear Services

EBS/SHH:sad
Attachment

cc: (See Next Page)

MISSISSIPPI POWER & LIGHT COMPANY

AECM-84/0004

Page 2

cc: Mr. J. B. Richard (w/a)
Mr. R. B. McGehee (w/o)
Mr. T. B. Conner (w/o)
Mr. G. B. Taylor (w/o)

Mr. Richard C. DeYoung, Director (w/a)
Office of Inspection & Enforcement
U. S. Nuclear Regulatory Commission
Washington, D. C. 20555

Document Control Desk (w/a)
U. S. Nuclear Regulatory Commission
Washington, D. C. 20555