

CONTROL BLOCK: (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

01 N C M G S 1 2 0 0 - 0 0 0 0 0 - 0 0 0 3 4 1 1 1 1 4 5
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CONT
C 1 REPORT SOURCE L 6 0 5 0 0 0 3 7 0 7 1 2 3 1 8 3 8 0 2 0 8 8 4 9
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)
0 2 During draining operations of the reactor coolant system, residual heat removal
0 3 (ND) pump B was observed to have zero discharge flow and was subsequently tripped
0 4 and ND train B declared inoperable. This constitutes a degradation of the reactor
0 5 coolant system (cold shutdown-loops not filled, T.S.3.4.1.4.2) which is reportable
0 6 per T.S.6.9.1.11(b) and similar to LER 370/84-01 and 369/82-24. Immediate action
0 7 was taken to restore both ND loops to operable status (restored in 43 minutes).
0 8 Had the return to service been further delayed, core cooling could have been
0 9 provided by additional valve cycling. Health and safety of the public were
1 0 unaffected.

0 9 C F 11 D 12 Z 13 P U M P X X 14 X 15 Z 16
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

17 LER/NO REPORT NUMBER 8 3 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

ACTION TAKEN FUTURE ACTION EFFECT ON PLANT SHUTDOWN METHOD HOURS ATTACHMENT SUBMITTED NPRO-4 FORM SUB. PRIME COMP. SUPPLIER COMPONENT MANUFACTURER
X 18 G 19 Z 20 Z 21 0 0 0 0 Y 23 N 24 Z 25 Z 9 9 9 9
32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)
1 0 This is attributed to procedural deficiencies, due to inadequate guidelines
1 1 regarding the water level to be maintained in the reactor coolant (NC) loops
1 2 during ND operation. The fueling water storage tank to ND pump isolation valve
1 3 was cycled to provide core cooling and raise NC system level until flow was
1 4 restored. Procedures will be revised by March 31, 1984. Additional corrective
1 5 actions are detailed in LER 370/84-01.

1 5 D 28 0 0 0 0 29 NA A 31 Personnel observation
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

ACTIVITY CONTENT RELEASED OF RELEASE AMOUNT OF ACTIVITY LOCATION OF RELEASE
1 6 Z 33 Z 34 NA NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

PERSONNEL EXPOSURES NUMBER TYPE DESCRIPTION
1 7 0 0 0 37 Z 38 NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

PERSONNEL INJURIES NUMBER DESCRIPTION
1 8 0 0 0 40 NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

LOSS OF OR DAMAGE TO FACILITY TYPE DESCRIPTION
1 9 Z 42 NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

PUBLICITY ISSUED DESCRIPTION
2 0 N 44 NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

NAME OF PREPARER Phillip B. Nardoci PHONE (704) 373-7432

8402280507 840208
PDR ADOCK 05000370
S PDR

NRC USE ONLY

DUKE POWER COMPANY

P.O. BOX 33189

CHARLOTTE, N.C. 28242

HAL B. TUCKER

VICE PRESIDENT
NUCLEAR PRODUCTION

February 8, 1984

TELEPHONE
(704) 373-4531

✓ Mr. James P. O'Reilly, Regional Administrator
U. S. Nuclear Regulatory Commission
Region II
161 Marietta Street NW, Suite 2900
Atlanta, Georgia 30303

Subject: McGuire Nuclear Station Unit 2
Docket No. 50-370
LER/RO-370/83-92

Dear Mr. O'Reilly:

Please find attached Reportable Occurrence Report RO-370/83-92. This report concerns T.S. 3.4.1.4.2, "Two residual heat removal loops shall be operable and at least one RHR loop shall be in operation". This incident was considered to be of no significance with respect to the health and safety of the public.

An event similar to this December 31, 1983 incident occurred on January 9, 1984. LER 370/84-01 which is being submitted relative to the January 9, 1984 event provides further details and expands upon this December 31, 1983 incident, and should be referenced as the attachment to this LER form.

Very truly yours,

H.B. Tucker (BT)

Hal B. Tucker

PBN:jfw
Attachment

cc: Document Control Desk
U. S. Nuclear Regulatory Commission
Washington, D. C. 20555

Mr. W. T. Orders
NRC Resident Inspector
McGuire Nuclear Station

Records Center
Institute of Nuclear Power Operations
1100 Circle 75 Parkway, Suite 1500
Atlanta, Georgia 30339

OFFICIAL COPY

LF22