

NRC FORM 366
(12-81)

U.S. NUCLEAR REGULATORY COMMISSION
LICENSEE EVENT REPORT

APPROVED BY OMB
3150-0011
EXPIRES 4-30-82

CONTROL BLOCK: (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

CON'T

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 At 1115 during normal operation, #12 emergency diesel generator (EDG)
0 3 failed to start during performance of maintenance (T.S. 3.8.1.1). Inves-
0 4 tigation revealed that sufficient pressure was not available in the fuel
0 5 oil line. The line was primed with the manual fuel oil pump and the EDG
0 6 started. EDG was restarted an hour later to verify that the fuel oil
0 7 pump would stay primed. At 1425 the EDG was returned to service.
0 8 Similar events: none.

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 Adjustments to Governor while the diesel generator was shutdown allowed
1 1 fuel oil from fuel header to drain to the clean oil drip tank. A revi-
1 2 sion to maintenance instructions to hand prime the fuel header after
1 3 Governor adjustments will be made to prevent similar events.
1 4

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

8402080349 840118
PDR ADOCK 05000317
S PDR

NAME OF PREPARER M. A. Junge/R. R. Allen

PHONE: (301) 269-4969/4870

BALTIMORE GAS AND ELECTRIC COMPANY

P.O. BOX 1475
BALTIMORE, MARYLAND 21203

NUCLEAR POWER DEPARTMENT
CALVERT CLIFFS NUCLEAR POWER PLANT
LUSBY, MARYLAND 20657

January 19, 1984

Dr. Thomas E. Murley
Regional Administrator
U. S. Nuclear Regulatory Commission
Region 1
631 Park Avenue
King of Prussia, PA 19406

Docket No. 50-317
License No. DPR 53

Dear Dr. Murley:

Attached is LER 33-18/3X, Revision 1, as required per Technical Specification 6.9.

Should you have any questions regarding this report, we would be pleased to discuss them with you.

Very truly yours,

LBR

L. B. Russell
Plant Superintendent

LBR:RRA:bsb

cc: Director, Office of Management Information
and Program Control
Messrs: A. E. Lundvall, Jr.
J. A. Tiernan

IE22
11