		LI	C'ENS ES	78.							CTION BOING ECORDE AR REE 101, A 3150-0	REQUEST BURDEN MANAGE SULATORY	ETIMATE ENT BRAN COMMISSIO PAPERMO OFFICE	
FACILITY MARE (1) LaSalle County Station Unit 1										05000 373				
TITLE (	CAMPAGE AND BAR	NATION AND A STREET		Incomplete		Analy	sis d	of Ne	W Dies	el Puel	selection controls			
EVE	I DATE	(5)	ACTIVITY AND ADDRESSOOD	LER MUMBER (6)	)	REPO	T DATE	(7)		DTHER FACT	ITIES IN	WOULVED (		
NON TH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION MONDER	HON TH	DAY	YEAR				DOCKET 05	C374	
02	08	95	95	005	00	03	10	95	FACILIT	FACILITY MANE		DOCKET US	SARER	
OPERA	T 7 MC	Contraction of the local division of the loc	THIS RE	PORT IS SUSANITTE	D PURSUAN	TO THE	REQUIRE	BAENTS	OF 10 CF	R 5: (Check	one of lac	re) (11		
NODE		1	20.2201(b)			20.2203(a)(3)(1)			50.73(a)(2)(111)			13. 1(0)		
POL	POLER		20.2203(a)(1)			20.2203(e)(3)(ii)				50.73(a)(2)(iv)			1(c)	
LEVEL		100	20.2203(a)(2)(1) 20.2203(a)(2)(11) 20.2203(a)(2)(11)			20.2203(a)(4) 50.36(c)(1) 50.36(c)(2)			50.73(a)(2)(VIII)(A)			OTH		
	State of											Abetro	below	
and the second												and in		
		20.2203(a)(2)(1v)			¥ 50.73(a)(2)(1)			50.73(a)(2)(viii)(8)			BRE FO	· 366A)		
And the second second second second			20.2	203(a)(2)(v)	COMPANY NO. OF COMPANY	And the second s	50.73(a)(2)(11)		50.73(a)(2)(z)			-		
NAME	Tod	ld Kol	lross,	System Engi	LICENSEE		-		(12)	TELEPHONE NU	BER (Inc 5) 357		Code)	
de de contratigente no rela	an - Astrona Possible		COMP	LETE OME LINE P	R EACH CO	PONENT P	ATLURE	DESCR	BED IN T	HIS REPORT (1	3)			
CAUSE	SYST	EM C	CHIPOMENT	MANUFACTURER	REPORTAS TO HIPED	LE MILTE	alay -	ALISE	SYSTEM	COMPONENT	MANUFA	CTURER	TO MPRD	
E					N	CUT: Thirty Cut at a Ray Co	122							
10.000 (10.000 (10.000 (10.000))						大学	228.							
A REAL POINT	ole conservation	Report Daniel Social Street	SUPPLENE	TAL REPORT EXPE	CTED (14)	R BARARA BARA BARARA	President and a second s		E	PECTED	HOHTH	DA	YEA	
T	YES (17 yes, complete EXPECTED SUMMISSION DATE).							-	BLMBRIESION DATE (15)			1		

ABSTRACT (Limit to 1400 epocea, i.e., approximately 15 single-spaced typewritten lines) (1

010013

PDR

9509010200 950310 PDR ADDCK 05000373

On February 8, 1995, at approximately 0920 hours with both Units 1 and 2 in the Run dode at 100% power, it was discovered that the samples of diesel fuel required per Technica Specification 4.8.1.1.2.c.2 had not been taken. The samples are used for the ASTM 276 "Diesel Fuel Oil Particulate Test". Technical Specification 4.8.1.1.2.c.2. require this test to be completed every 31 days (monthly) on the diesel fuel oil storage tanks a d on ne fuel oil shipments. Though the station failed to test the new fuel oil shipments, he 31 d testing requirement on the fuel oil storage tanks was met with satisfactory results. These monthly testing results have demonstrated acceptable fuel quality. Thus, the opera ility o the Diesel Fuel Oil system was maintained.

This event is reportable to the Nuclear Regulatory Commission as a Licensee Event R port in accordance with 10CPR50.73(a)(2)(i)(B), operating in a condition prohibited by Tech ical Specifications.

IE22 0/1

SENT BY	LASALLE STATION	: 8-11-95 :1 U.S. WA	2:08PM : COMMONWEALTH CLEAR REGULATORY COMMISSION	EDISON- 208 526 2930; 2 APPRIMED BY CANS MO. 3150-01.36 EXPIRES 5/31/95					
		EVENT REPORT CONTINUATI	ESTIMATED BARDEN PER RESPONSE TO COMPLY WIT THIS INFORMATION COLLECTION REGISTISSION ON FORMARED COMPLETS REGANDING BURDEN ESTIMATE THE INFORMATION AND RECORDS MANAGEMENT RELAK (NONDE 7714), U.S. BUCLEAR REGULATORY COMMISSION WASHINGTON, DC 20555-0001, AND TO THE PAPERNON REDUCTION PROJECT (3150-0104), OFTICE C MANAGEMENT AND BURGET, WASHINGTON, DC 20503.						
and the second	FACILITY HA	ana ana amin'ny fanana amin'ny fanana amin'ny fanana amin'ny fanana amin'ny fanana amin'ny fanana amin'ny fanan	DOCKET HUMBER (2)		LER MURRER (6)				
	PROTA ATT NO	in hit		YEAR	REGLENTIAL MANDER	REVISION NUMBER			
Las	Sallo County Statio	County Station Unit 1		95	- 005	00	2 OF 3		

TEXT (If more space is required, use additional copies of MRC Form 366A) (17)

### PLANT AND SYSTEM IDENTIFICATION

General Electric - Boiling Water Reactor

Energy Industry Identification System (EIIS) codes are identified in the text as [XX].

# A. CONDITION PRIOR TO EVENT

Unit(s): 1/2	Event Date: 2/08/95	Event Time: 0920 Hours
Reactor Mode(s): 1/1	Modes(s) Name:Run/Run	Power Level(s): 100% /100%

## B. DESCRIPTION OF EVENT

On February 8, 1995, at approximately 0920 hours with both Units 1 and 2 in the Run Mode at 100% power, it was discovered that certain samples of diesel fuel required per Technical Specification 4.8.1.1.2.c.2 had not been taken. The samples are used for the ASTM 2276 "Diesel Fuel Oil Particulate Test". Technical Specification 4.8.1.1.2.c.2 requires this test to be completed every 31 days (monthly) on the diesel fuel oil storage tanks and for new fuel oil shipments. Though the station failed to test the new fuel oil shipments, the diesel fuel oil storage tank 31 day testing requirement was met with satisfactory results. The monthly testing results have demonstrated acceptable fuel quality. Thus, the operability of the diesel fuel oil system was maintained.

This event is reportable to the Nuclear Regulatory Commission (NRC) as a Licensee Event Report in accordance with 10CFR50.73(a)(2)(i)(B), operating in a condition prohibited by Technical Specifications.

#### C. CAUSE OF EVENT

The cause of this event was a failure to properly implement changes to Technical Specification 4.8.1.1.2.c.2 sampling requirements. In April, 1994, this amendment change removed the requirement for the oxidation stability test and added the particulate test. These changes were not properly incorporated into station procedures.

VT BY LASALLE	U.S. MACLEM REGMATORY CONJESION LICENSEE EVENT REPORT (LER) TEXT CONTINUATION									
	FACILITY NA	UNE (1)		OCKET NUMBER (2)	LER MANDER (6)				P SE (3)	
					YEAR	REGUENTIAL MUMBERO	REVISION MURRER	Γ		
LaSalle Cour	ity Station	Unit 1		05000373 95 -		005	00	3 OF	2 3	

TENT (If more space is required, use additional capies of MRC Form 366A) (17)

# D. SAFETY ANALYSIS

The safety consequences of this event were minimal. The storage tanks of all five emergency diesels are tested on a monthly basis against the same test criteria and have produced excellent results. All Diesel Generators (DG)[EK] were operable and available for use.

## E. CORRECTIVE ACTIONS

- 1. Immediate Corrective Actions:
  - a. Tailgate Chemistry and Quality Control Personnel on the requirements of the fuel oil sampling associated with receiving safety related diesel fuel oil into the station. This communication was completed on February 10, 1995.
  - b. Revise the sampling procedures to reflect the required samples for new fuel oil. The procedures requiring revisions are LOP-DO-01, "Receiving Diesel Oil", and LCP-100-62, "Sampling and Analysis of Emergency Diesel Generator Fuel Oil".
- 2. Actions to Prevent Recurrence:
  - a. The Technical Specification change process will be reviewed and enhanced to ensure all changes are implemented properly.
  - b. A review of some portion of previous Technical Specification amendments will be conducted to determined if similar amendment implementation deficiencies exist.

# F. PREVIOUS OCCURRENCES

There are no similar events of this type documented at LaSalle.

G. COMPONENT FAILURE DATA

None.