



Carolina Power & Light Company

SERIAL: NLS-84-228

JUN 1 1984

Director of Nuclear Reactor Regulation
Attention: Mr. D. B. Vassallo, Chief
Operating Reactors Branch No. 2
Division of Licensing
United States Nuclear Regulatory Commission
Washington, DC 20555

BRUNSWICK STEAM ELECTRIC PLANT, UNIT NO. 2
DOCKET NO. 50-324/LICENSE NO. DPR-62
DEFERRAL OF FEEDWATER SPARGER REPLACEMENT

Dear Mr. Vassallo:

INTRODUCTION

By letter dated October 7, 1981 (Serial: No. 81-1652), Carolina Power & Light Company (CP&L) committed to perform the feedwater sparger replacement and nozzle cladding removal recommended by NUREG-0619 during the current Unit 2 refueling outage. Carolina Power & Light Company plans to defer this work pending resolution of the feedwater sparger cracking issue at Northern States Power Company's Monticello Nuclear Generating Plant.

DISCUSSION

The replacement of the feedwater spargers and removal of the feedwater nozzle cladding on Unit 2 was scheduled to be completed during the current refueling outage; however, during recent inspections at Monticello, cracks were discovered in the feedwater spargers. The replacement spargers intended to be used at Brunswick are similar in design to those used at Monticello and, therefore, may be susceptible to the same cracking mechanism. An initial metallurgical analysis, performed by General Electric, indicates the cracks in the Monticello spargers are the result of high cycle fatigue; however, the actual mechanism which causes the cracking is still under evaluation. The anticipated schedule for completion of the analysis and identification of corrective actions does not support replacement of the Brunswick Unit 2 feedwater spargers during the current outage. Carolina Power & Light Company believes that replacement of the Brunswick Unit 2 feedwater spargers prior to resolution of the new cracking phenomenon is premature and does not warrant the radiation exposure or the resource commitment required to complete the work.

A direct visual examination of the existing Brunswick Unit 2 feedwater spargers has been completed. This examination revealed some flow hole cracks ranging from 0.200 inches to 0.500 inches in length. A propagation analysis performed by General Electric for the cracks in the existing Brunswick Unit 2 feedwater spargers indicates the cracks could propagate up to a total of 1.3 inches in length during the next cycle of operation. However, cracks in the

411 Fayetteville Street • P. O. Box 1551 • Raleigh, N. C. 27602

8406130283 840601
PDR ADGCK 05000324
P PDR

App
/10

JUN 1 1984

range of 1.3 inches are acceptable since the feedwater sparger is not a safety-related item, and there is no effect on the vessel system pressure boundaries. The crack areas are small and will not affect feedwater flow distribution. The potential for loose parts is not a concern due to the orientation of the cracks.

As a result of not replacing the feedwater spargers, the cladding removal from the feedwater nozzles will not be performed this outage. The following non-destructive examinations were performed on the feedwater nozzles with no adverse indications:

- 1) Liquid penetrant testing of the accessible portions (approximately 80%) of the feedwater nozzle internal blend radii. The accessible area includes the lower portion of the blend radius which has the highest susceptibility to cracking.
- 2) Ultrasonic testing of the feedwater nozzle external blend radii.
- 3) Ultrasonic testing of the feedwater nozzle safe end forgings.

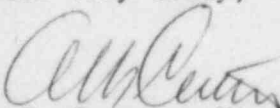
CONCLUSION

Based on the results of the inspections, CP&L has determined that deferral of the feedwater sparger replacement and removal of the feedwater nozzle cladding does not represent a safety concern. Hence, CP&L plans to defer this work until the next refueling outage for Unit 2 (currently scheduled to begin April 19, 1986) contingent upon a satisfactory and timely resolution of the sparger cracking issue at Monticello.

Carolina Power & Light Company's October 7, 1981 submittal also provided a schedule for rerouting the reactor water cleanup piping to each feedwater line and evaluation of the feedwater low-flow controller. Carolina Power & Light Company is still evaluating these two items and will provide their status and schedule in a separate submittal.

Carolina Power & Light Company requests written concurrence with this action by August 1, 1984. Should you have any questions concerning this submittal, please contact Mr. Sherwood R. Zimmerman at (919) 836-6242.

Yours very truly,


A. B. Cutter - Vice President
Nuclear Engineering & Licensing

MAT/ccc (121MAT)

cc: Mr. D. O. Myers (NRC-BSEP)
Mr. J. P. O'Reilly (NRC-RII)
Mr. M. Grotenhuis (NRC)