U.S. NUCLEAR REQULATORY COMMISSION VAC Form 300 APPROVED DAS NO 3180-0104 EXPIRES BOLDS LICENSEE EVENT REPORT (LER) FAGE IS DOCKET NUMBER (2) OF 0 14 LaSalle County Station Unit 2 0 15 10 10 10 13 17 4 TITLE IA Loss of Reactor Water Cleanup Isolation Leak Detection OTHER FACILITIES INVOLVED IN REPORT DATE (7) EVENT DATE IS LER NUMBER (6) DOCKET NUMBERIS PACILITY NAMES SEGUENTIAL DAY MONTH MOYTH YEAR DAY YEAR 0 1510 10101 8 14 0 15 10 10 101 0 1 d 2 7 0 9 1 81 4 8 4 0 4 016 THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CPR & (Check one or more of the following) (11) MODE MI 72.7101 80 73(a)(5)(iv) 72,71(e) 80.7361(21(v) 90.39(a)(1) 20 406 (a)(1)(i) OTHER (Specify in Abe. of below and in Taxt, NRC Farm 366A) 00 73(a)(2)(v8) 0 1 41 5 20 406 (4)(1)(8) 80.38(e)(2) 80.73ia | (2)(will (A) 90.7361(2)(II) 20 406(a)(1)(W) 90 73(a)(7)(ws)(8) 80.73(a)(2)(W) 20.406 ta)(1)(iv) 80.73(a)(2)(x) 80.73w1(21(W) 20 406 (a) (1) (v) LICENSEE CONTACT FOR THIS LER ITE TELEPHONE NUMBER HAME AREA CODE Kermit C. Wittenburg, extension 772 315171-1617611 81115 COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT 1130 TO NPROS MANUFAC REPORTABLE MANUFAC TURER CAUSE SYSTEM COMPONENT CAUSE SYSTEM COMPONENT TO NPROS R 1 21 7 19 JI M TIDIS 1 MONTH DAY YEAR SUPPLEMENTAL REPORT EXPECTED ITAL EXPECTED X NO YES IT YOU COMPAN EXPECTED SUBMISSION DATE! ABSTRACT (Limit to 1400 spaces 18, approximately fifteen single-space typewriten lines) (16) At 0735 on 6/4/84, with U-2 at 45% power, a Tech Starf Engr. started taking data per LOD-15-2. Because of recurring isolations when tak ng RWCU (CE) LD (IJ) readings. a procedure change was approved to allow bypassing the isolation channels until at least 10 min. after the readings had taken place. At 0825 a CST requested permission to perform LIS-RT-202 to calibrate the RWCU LD Trips on Unit 2. Both Channel Bypass Keys had been issued to the TS Engr. for the duration of the test. After verifying compliance with Tech Spec 3.3.2 the SCRE informed the NSO not to remove the Test Switches from the test position unless directed by either the CST or the TS Engineer. While the SCRE realized the time clock requirements to have both channels in bypass, this concern was not adequately communicated to the NSO, CST, or TS Engr. At about 1455 the relieving NSO discovered both switches in bypass and brought this to the attention of the SCRE and SE. All testing was immediately terminated and both trip channels returned to normal.

Corrective actions included a coaching interview with the SCRE to emphasize good communications, Tech Staff and IM Dept. tailgates on the occurrence and a letter to all SE's and SCRE's concerning Tech Spec time clocks associated with surveillances and procedures.

8410100646 840913 PDR ADDCK 05000374 PDR | LaSalle County Station Unit 2 | 0 | 5 | 0 | 0 | 3| 7| 4 8 4 - 0 | 2| 7 - 0| 1 0 | 2 | 0 | 0 | 4

U.S. MUCLEAR REQULATORY COMMISSIO

TEXT IF many speed it required, and additional MRC Form 365A's (17)

I. EVENT DESCRIPTION

At 0735 on June 4, 1984, with Unit 2 at about 45 percent power, a Tech Staff Engineer requested and was granted permission to perform Area Temperature Monitoring on the Unit 2 Leak Detection System in accordance with LOD-15-2. Because of recurring isolations involved with taking these readings, a procedure change was approved to allow bypassing the isolation channels and leaving the channels bypassed for a minimum of ten minutes to verify no isolation alarms occurred from this test. Previous test performance has resulted in an isolation about five minutes after taking the readings.

At 0825 on June 4, 1984, a CST requested and was granted permission to perform LIS-RT-202 to calibrate the Reactor Water Cleanup (RWCU, CE) Ambient Temperature Trip Channels on Unit 2. Both Channel Bypass Switch Keys had been issued to the Tech Staff Engineer for the duration of the test. After verifying compliance with Tech Spec 3.3.2 the Shift Control Room Engineer (SCRE) informed the Unit NSO (Licensed Operator) not to remove the Channel Test Switches from the test position unless directed by either the CST or the Tech Staff Engineer. While the SCRE realized the requirements to have both channels in bypass for no more than one hour or one channel in bypass for no more than two hours, this requirement was not adequately communicated to the NSO, CST, or Tech Staff Engineer.

Both channels were taken to bypass at about 0735. At about 1455, the relieving NSO discovered both Channel Test Switches in bypass and brought this to the attention of the SCRE and Shift Engineer. All testing was immediately terminated and both trip channels returned to normal. In order to complete LIS-RT-202, one key was then issued to the CST and the surveillance satisfactorily completed at approximately 1630.

11. CAUSE

The root cause of this event was the failure of the SCRE to communicate the Technical Specification Requirements/Limitations with regards to removing an Isolation Trip Channel from Operate. This resulted in a loss of administrative control of the evolution by the Shift.

An additional contributing factor included a degraded system performance that required bypassing trip channels while reading the temperature modules. This condition had occurred on at least two previous occasions and had resulted in the procedure change to LOD-15-2 to prevent possible isolations. This degraded performance is under investigation. There also existed a procedural inadequacy of LOD-15-2 that failed to identify Technical Specification requirements with regard to specific time requirements allowed with a trip channel in bypass.

84

HOC Pure 300A 19-63J	LICENSEE EVENT REPORT (LER) TEXT CONTINUATION					APPROVED OMS NO 3150-3104 EXPIRES 8/31/88						
PACILITY NAME IS		DOCKET NUMBER (2)	LER NUMBER IS					PAGE ID				
			PAR	18	BOUENTIA	-	REVISION		П			
LaSalle County S	y Station Unit 2	0 15 10 10 10 13 17 14	8 4	_	0 2	7 -	91	0 3	OF	0 14		

DCT IS more space a required, use additional ARC Auso 386A's/ 117)

III. PROBABLE CONSEQUENCES OF THE OCCURRENCE

The channel test switches in bypass defeated the RWCU ambient and differential temperature trips as well as the RWCU differential flow trip. The associated Control Room alarm windows and horns were still available. Both the NSO and the CST were aware of which instruments were being tested per the instrument surveillance and would have acted on any alarm indication not caused by the surveillance procedure. The CST also informed the NSO whenever he went on break or lunch and when he returned. In addition, the Technical Staff Engineer was periodically monitoring all the temperatures associated with the bypassed switches. All parameters involved remained within the Technical Specification and at no time were the health and safety of the plant personnel or public in jeopardy.

IV. CORRECTIVE ACTIONS

Corrective actions included:

- Conducting a coaching interview with the SCRE involved to emphasize
 the importance of complete communication with all personnel involved
 in any evolution. Special emphasis was given to verifying understanding of the directions given by the SCRE in the performance
 of any evolution, and maintaining proper control of all evolutions
 in progress.
- LOS-15-2 was revised to identify the Tech Spec Requirements/Limitations for bypassing the Trip Channels involved.
- Tailgates with the Instrument Mechanics, SCRE's and all Operating crews were conducted to review the occurrence.
- 4. Training of all Technical Staff personnel was conducted which reviewed the occurrence and stressed the importance of being aware of Technical Specifications that impact upon their activities in the plant.
- 5. A letter from the Assistant Superintendent of Operating was sent to all Shift Engineers and Shift Control Room Engineers which presented guidelines, actions and responsibilities for maintaining Technical Specification timeclocks during the performance of surveillances, routine procedures and special testing of the RPS, PCIS, ECCS, ATWS, RCIC and RPT Systems.

NIC Perm 200A 0-431	LICENSEE EVENT RE	LICENSEE EVENT REPORT (LER) TEXT CONTINUATION							0. 3186-4	180-0104		
PACILITY NAME (1)		DOCKET NUMBER (2)	LER HUMBER IN					PAGE (3)				
			YEAR		SEGUENTIAL		ASVERN					
LaSalle Cou	nty Station Unit 2	0 15 10 10 10 1 317 14	8 4	-	0 2 7	-	011	0	4 05	0	14	

V. CORRECTIVE ACTIONS (Continued)

6. An efficient method of tracking Technical Specification timeclocks associated with surveillances will be researched for incorporation into plant routines. (AIR 01-84-67096)

V. PREVIOUS OCCURRENCES

No previous occurrences of this event have been observed.

VI. NAME AND TELEPHONE NUMBER OF PREPARER

Kermit C. Wittenburg, (815)357-6761, extension 772.

September 13, 1984

U.S. Nuclear Regulatory Commission Document Control Desk Washington, D.C. 20555

Dear Sir:

Reportable Occurrence Report #84-027-01, Docket #050-374 is being submitted to your office to supercede previously submitted Reportable Occurrence Report 84-027-00.

G. J. Diederich Superintendent

LaSalle County Station

GJD/MLD/kg

Enclosure

xc: NRC, Regional Director

INPO - Records Center

File/NRC

IE22 1/1