

Mailing Address
Alabama Power Company
600 North 18th Street
Post Office Box 2641
Birmingham, Alabama 35291
Telephone 205 783-6090

R. P. McDonald
Senior Vice President
Flintridge Building

84 SEP 25 P 1: 08



September 18, 1984

Docket Nos. 50-364

Mr. J. P. O'Reilly
Regional Administrator
U. S. Nuclear Regulatory Commission
Region II, Suite 3100
101 Marietta Street, N. W.
Atlanta, GA 30303

Joseph M. Farley Nuclear Plant - Unit 2
LER No. 84-006-00

Dear Mr. O'Reilly:

In response to a telephone request by Mr. Norman Merriweather of your staff concerning LER No. 84-006-00 for Farley Nuclear Plant - Unit 2, attached are copies of pertinent design drawings for diesel generator 2B. These drawings show the diesel generator control circuitry before and after modifications made to correct the malfunction reported in LER No. 84-006-00.

If there are any questions, please advise.

Yours very truly,


R. P. McDonald

RPM/CLB:ddb-D10

cc: Mr. L. B. Long
Mr. S. A. Varga
Mr. E. A. Reeves
Mr. W. H. Bradford
Mr. N. Merriweather


B410120224 840918
PDR ADDCK 05000364
S PDR

IE22
/ ~~IE22~~

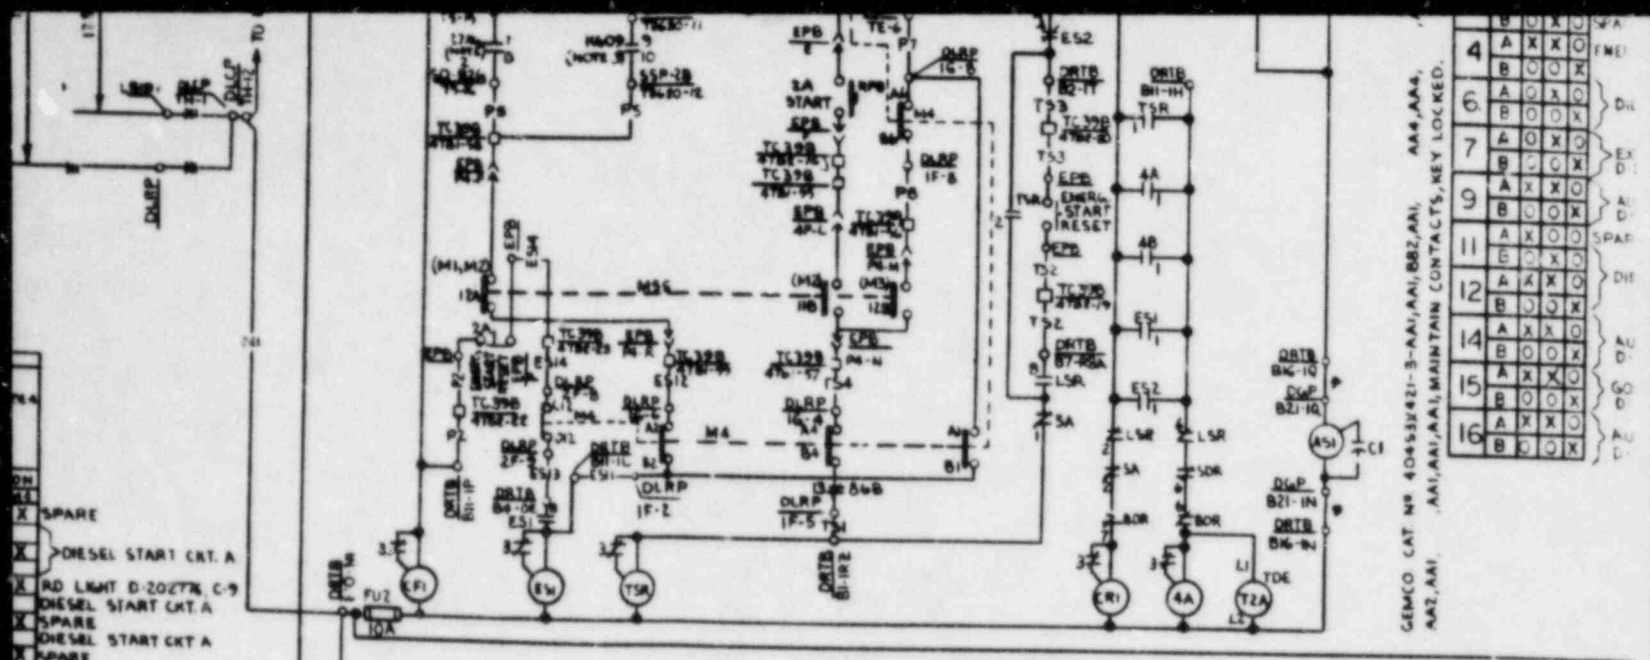

4	A	X	X	O
5	B	O	X	X
6	A	O	X	X
7	A	O	X	X
8	B	O	X	X
9	A	X	X	O
10	B	O	X	X
11	A	X	X	O
12	B	O	X	X
13	A	X	X	O
14	B	O	X	X
15	B	O	X	X
16	A	X	X	O

DIESEL GENERATOR STOP

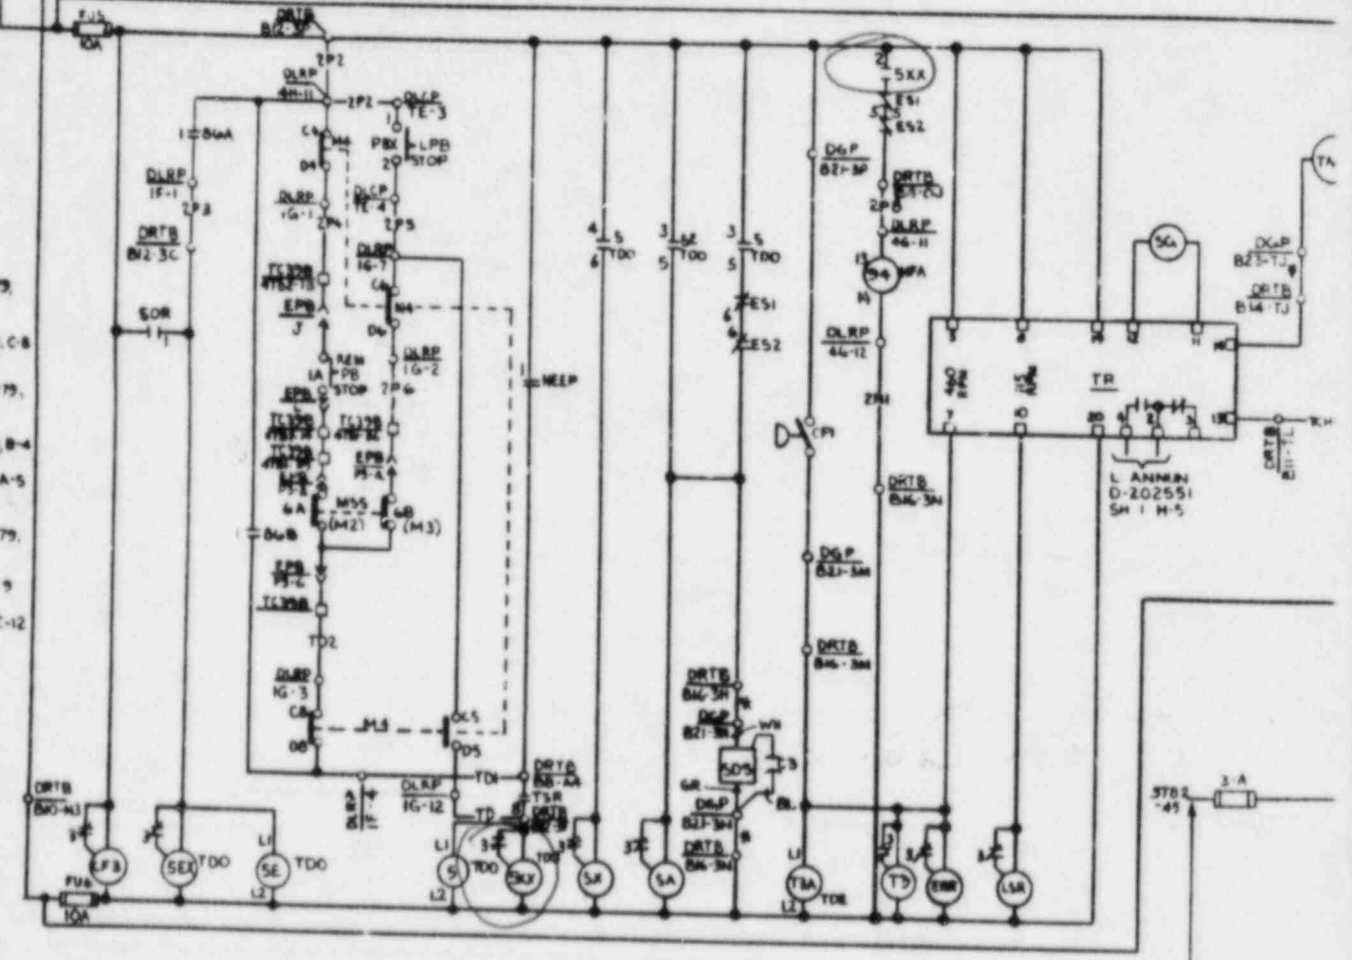

NOTE: WEST TYPE W-2, SWITCH LOCK
 SIMILAR TO SWITCH
 STYLE 50846506101 EXCEPT WITH 7 STAGES
 HANDLE 677C10101
 MAINTAINED CONTACTS
 MODE 4 POSITION TO BE LOCKED

94
 TRIP D60B (D-107142)
 SPARE

Prior to Modification

REV A	9-14-88	REV 7	9-2-91	REV 6	1-4-90	REV 5	1-4-91	REV 4	3-2-98	REV
INC. PCN 5-82-2286		INC. PCN 8-60-744-1		INCORP. 2BE-660 # 2AE-670		REVISED AS NOTED		INC. BE-4492, 2BE-911		REV D

Mailing Address
Alabama Power Company
600 North 18th Street
Post Office Box 2641
Telephone 205 783-6090

R. P. McDonald
Senior Vice President-
Nuclear Generation
Flintridge Building

DSM



Alabama Power
the southern electric system

June 18, 1984

Docket No. 364

Document Control Desk
U. S. Nuclear Regulatory Commission
Washington, D.C. 20555

Dear Sir:

Joseph M. Farley Nuclear Plant, Unit 2, Licensee Event Report No. LER 84-006-00 is being voluntarily submitted. This report was prepared using a draft version of IEEE Std. 805-1984 since a final version has not been published.

If you have any questions, please advise.

Yours very truly,

R. P. McDonald

RPM/DSM:sam

Enclosure

xc: IE, Region II

~~84062209 PDR~~ 3pt

bc: Mr. J. M. Farley
Mr. W. O. Whitt
Mr. S. E. Bradley
Mr. W. H. Bradford
Mr. R. P. McDonald
Mr. H. O. Thrash
Mr. R. L. George
Mr. J. W. McGowan
Mr. D. S. Mask
Mr. W. G. Hairston, III
Mr. L. S. Williams
Mr. W. G. Ware
Mr. T. H. Nesbit
INPO Records Center
ANI Library
File: A-3.1/F-6

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1) Joseph M. Farley - Unit 2	DOCKET NUMBER (2) 0 5 0 0 0 3 6 4	PAGE (3) 1 OF 0 2
--	--------------------------------------	----------------------

TITLE (4)
Diesel Generator Output Breaker Did Not Open After Diesel Tripped

EVENT DATE (5)			LER NUMBER (6)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)		
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAMES		
05	19	84	84	006	00	06	18	84			
									DOCKET NUMBER(S) 0 5 0 0 0		

OPERATING MODE (9) 1	THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR § (Check one or more of the following) (11)										
POWER LEVEL (10) 1 0 0	20.402(b)			20.406(c)			80.73(a)(2)(iv)			73.71(b)	
	20.406(a)(1)(i)			80.30(a)(1)			80.73(a)(2)(v)			73.71(e)	
	20.406(a)(1)(ii)			80.30(a)(2)			80.73(a)(2)(vi)			X OTHER (Specify in Abstract below and in Text, NRC Form 356A) Voluntary Report	
	20.406(a)(1)(iii)			80.73(a)(2)(i)			80.73(a)(2)(vii)(A)				
	20.406(a)(1)(iv)			80.73(a)(2)(ii)			80.73(a)(2)(vii)(B)				
20.406(a)(1)(v)			80.73(a)(2)(iii)			80.73(a)(2)(ix)					

LICENSEE CONTACT FOR THIS LER (12)							TELEPHONE NUMBER				
NAME W. G. Hairston, III							AREA CODE		2 0 5 8 9 9 7 5 1 5 6		
							2 0 5				

COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)											
CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NRC		CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NRC	

SUPPLEMENTAL REPORT EXPECTED (14)							EXPECTED SUBMISSION DATE (15)		MONTH	DAY	YEAR
<input type="checkbox"/> YES (If yes, complete EXPECTED SUBMISSION DATE) <input checked="" type="checkbox"/> NO											

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)

On 5-19-84, a maintenance run of Diesel Generator 2B was performed. This run was performed following scheduled maintenance during the preceding six days and prior to returning the diesel to operable status. At 2043, the diesel tripped on High Jacket Water Temperature (non-essential engine protection), however the generator output breaker did not open automatically. The plant operator observed this and opened the breaker remotely. A review of the circuit design revealed that under certain circumstances the generator output breaker would not have opened if the diesel tripped following a non-emergency test start. A design change has been implemented to correct this condition. Emergency starting and operation would not have been affected. Health/safety of the public was not affected.

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME (1) Joseph M. Farley - Unit 2	DOCKET NUMBER (2) 0 5 0 0 0 3 6 4	LER NUMBER (8)			PAGE (3)	
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER		
		8 4	0 0 6	0 0	0 2	OF 0 2

TEXT (if more space is required, use additional NRC Form 388A's) (17)

On 5-19-84, during steady state operation with the unit in Mode 1 at 100% power, a maintenance run of Diesel Generator 2B was being performed. The diesel had been removed from service for scheduled maintenance during the preceeding six days and had not yet been restored to operable status. At 2043, the diesel tripped on High Jacket Water Temperature (non-essential engine protection); however, the generator output breaker did not open automatically. The plant operator observed that control room instrumentation indicated a reverse power condition and opened the generator output breaker remotely. The reverse power condition existed for only a few seconds.

Following a design review, it was determined that, with the existing circuit design, the generator output breaker may or may not have opened if the diesel tripped following a non-emergency test start. Since a certain amount of variance exists in relay actuation times, the trip signal would not have remained in long enough to open the breaker in all cases. Therefore, the generator output breaker might have opened at some times and not at others. This circuitry had been tested during the initial startup testing program and found to operate properly.

Investigation revealed that the remaining four diesel generators incorporated a different circuit design not subject to this condition. The circuit for Diesel Generator 2B was modified to be consistent with the circuits for the other diesel generators. The modified circuitry was tested satisfactorily.

The affected portion of the circuitry is used only during non-emergency test starts and would not have been used in the event that the diesel had started in response to an emergency condition. Therefore, emergency operation of the diesel generator was not affected.

Work on the Amot thermostatic valve in the jacket water system had been included in the maintenance performed on the diesel generator. Following the high temperature occurrence, further maintenance on the Amot valve was performed and the system tested satisfactorily. Following satisfactory performance of FNP-2-STP-80.1 (Diesel Generator 2B Operability Test), Diesel Generator 2B was declared operable at 0358 on 5-24-84.