MC ferm	LICENSEE EVENT REPORT (LER)										U.S. NUCLEAR REGULATORY COMPISSION APPROVED OME NO 3150-C104 EXPIRES 8/31/85										
ACILITY	NAME (1	,				-		-						DOC	KET NUMBER	R (2)			PA	6135	
LaSalle County Station Unit 1										0 1	15 10 10 10 131 7				3 1 OF 012						
TITLE (4)								-								-	-			1010	
Mec	hanic	al F	ire	Per	etrat	ion	15														
Mechanical Fire Penetrations EVENT DATE (6) LER NUMBER (6) REPORT DAT									TE (7)	OTHER FACILITIES INVOLVED (B)											
MONTH DAY		YEAR	YE	YEAR SEQUENTIAL NUMBER			REVISION			DAY	YEAR	FACILITY NA			AMES			OCKET NUMBERIS			
			+-		NUMBER		1	MOMBER			+	LaSalle Unit 2		2	0		151	0 10	1013	31714	
								1								T					
0 6	2 8	8 14	8	4 -	0 4	11	0	0	0 7	2 3	8 4					0	151	0 10	101	1 1	
			THI	REPO	RT IS BUBA	HTTE	D PURSUA	NT 1	O THE R	EQUIRE	MENTE OF	0 CFR & 1	Check one or more	of the	a fallowing) (111			-		
MODE (9)				20.402(b)					20.406(c)				80.73(a)(2)(iv)			73.71(e)					
POWER LEVEL 019 10				20.406(a)(1)(l) 20.406(a)(1)(H)					80.36 le)(1)		80.73(a)(2)(v)				73.71(e)					
								80.36(c)(2) 80.73(a)(2)(i)				60.73(a)(2)(vii)				X OTHER (Specify in Abstract					
				20.408(a)(1)(iii) X 20.408(a)(1)(iv)								X	60.73(a)(2)(viii)(A)			Special Report					
								80.73(e)(2)(ii)				80.73(a)(2)(viii)(8)									
				20.406(a)(1)(v)					60,73(a)(2)(iii)			50.73(a)(2)(x)									
								-	ICENSEE	CONTAC	CT FOR THE	S LER (12)									
NAME																	LEPHO	NE NUM	BER		
Edward A. McVey, extension 771												AREA CODE									
Long of Hereit, excellent //												8 1 1 1 5		315	71-	1617	611				
					COMP	ETE	ONE LINE	FOR	EACH C	OMPONE	NT FAILUR	E DESCRIBE	D IN THIS REPO	PT (1	3)						
CAUSE	SYSTEM COMPONEN		MANUFAC TURER		REPORTABLE TO NPROS				CAUS	SYSTEM	COMPONENT		MANUFAC- TURER		REPORTABLE TO NPDDS						
×	ZIZ	SIE	IA	IL)	(IX I X	1X	N				X	ZIZ	SIEJAI	LX	1 X1 X1	X I X N					
X	ZIZ	SIE	IA	IL)	XIXIX	IX	N						111		111						
		-			_		NTAL RE	PORT	EXPECT	ED (14)			ala anno anti-		EXPEC	***		MONTH	DAY	YEAR	
					1184										SUBMIS	SION					

On June 28, 1984, at approximately 1400 the Technical Staff identified three mechanical penetrations on fire rated walls/floors that were not sealed properly. The penetrations were located in the 815' Auxiliary Building floor at column lines 14-L and 16-L, and in the 786' Auxiliary/Turbine Building wall at 18-R. The affected walls/floors separate fire areas with safety related equipment. The penetrations were identified during the performance of a walkdown of accessible fire walls in Units 1 and 2. The walkdown was being performed to identify any fire penetrations that were not on the sleeve/penetration schedule and was specified as corrective action in LER 373/84-038-00. The penetrations were sealed on July 3, 1984, under Work Request L38390 in accordance with Technical Specification 3.7.6 Action a. Hourly fire watches are in effect in these areas at all times.

8408060055 840723 PDR ADOCK 05000373 S PDR TEST.

LICENSEE EVENT RE	REPORT (LFR) TEXT CONTINUATION					EXPIRES BOOKS				
FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)					PAUL (3)			
		YEAR		SEQUENTIAL NUMBER		MEVISION NUMBER		T		
LaSalle County Station Unit 1	0 5 0 0 0 3 7 3	814	_	0 4 1	_	0 0	0 2	OF	0 2	

EXT (If more space is required, use additional NRC Form 365A's) (17)

1. EVENT DESCRIPTION

The Technical Staff identified three mechanical penetrations on fire rated walls/floors that were not sealed properly. The penetrations were located in the 815' Auxiliary Building floor at column lines 14-L and 16-L, and in the 786' Auxiliary/Turbine Building wall at 18-R. These fire rated assemblies separate fire areas with safety related equipment located in them. The penetrations were identified while the Technical Staff was performing a walkdown of accessible fire walls in Units 1 and 2 to identify any discrepancies in the sleeve schedule in accordance with corrective action specified in LER 373/84-038-00. The Technical Staff notified the Fire Marshal and initiated repairs promptly.

11. CAUSE

At the time of the occurrence on June 28, 1984, at approximately 1400, both units were in the Run (1) Mode with Unit 1 at approximately 90 percent power and Unit 2 at approximately 65 percent power.

The penetrations were not sealed properly because they were not identified on the sleeve schedule and consequently were not identified during the performance of the mechanical fire penetrations surveillance.

III. PROBABLE CONSEQUENCES OF THE OCCURRENCE

The probable consequences of the occurrence were minimal since an hourly fire watch is in effect in the referenced areas at all times.

IV. CORRECTIVE ACTIONS

Repairs and inspections of the penetrations were completed on July 3, 1984, under Work Request L38390 in accordance with Technical Specification 3.7.6. Action a. The walkdown will be completed to identify any other discrepancies in the sleeve schedule (Action Item Record 1-84-67104) and Technical Staff surveillance LTS-1000-10 will be revised to reflect the findings of the walkdown (Action Item Record 1-84-67105).

V. PREVIOUS OCCURRENCES

A previous occurrence of this type was identified in LER 373/84-038-00.

VI. NAME AND TELEPHONE NUMBER OF PREPARER

Edward A. McVey, 815/357-6761, extension 771.

July 23, 1984

U. S. Nuclear Regulatory Commission Document Control Desk Washington, D.C. 20555

Dear Sir:

Reportable Occurrence Report #84-041-00, Docket #050-373 is being submitted to your office in accordance with 10 CFR 50.73.

G. J. Diederich Superintendent LaSalle County Station

GJD/MLD/kg

Enclosure

xc: NRC, Regional Director

INPO-Records Center

File/NRC

1822