APPENDIX A NOTICE OF VIOLATION Docket No.: 50-382 Entercy Operations, Inc. Operating License No.: NPF-38 Waterford Steam Electric Station, Unit 3 During an NRC inspection conducted on February 2 through March 14, 1992, violations of NRC requirements were identified. In accordance with the "General Statement of Policy and Procedure for NRC Enforcement Actions," 10 CFR Part 2. Appendix C, the violations are listed below: A. 10 CFR Part 50.73(b) requires the contents of licensee event reports to contain a clear, specific, narrative description of the event and a description of any corrective actions planned as a result of the event, including those to reduce the probability of similar events occurring in the future. Contrary to the above, Licensee Event Report 92-001, which addressed a problem with the core operating limit supervisory system (COLSS) azimuthal tilt alarm setting and surveillance test deficiencies, failed to address relaced problems found on the COLSS margin alarms associated with peak linear heat generation rate and departure from nucleate boiling ratio. This is a Severity Level V Violation (Supplement I) (VIO 92003-1). Criterion V of Appendix B to 10 CFR Part 50 and the licensee's approved quality assurance program description require that activities affecting quality shall be prescribed by and accomplished in accordance with documented instructions, procedures, or drawings of a type appropriate to the circumstances. The specified postmaintenance retest for Work Authorizations 01071582 and 01071648 stated, "OPS QA to perform VT-2 of S/G primary manways at normal RCS operating temperature and pressure." Contrary to the above, the postmaintenance retest was signed off by inspection personnel as completed when, in fact, the VT-2 inspections were performed at 490°F, which was below normal RCS operating temperature of at least 544°F. This is a Severity Level IV violation (Supplement I) (VIO 92003-3). Pursuant to the provisions of 10 CFR Part 2.201, Entergy Operations, Inc., is hereby required to submit a written statement or explanation to the U.S. Nuclear Regulatory Commission, ATTN: Document Control Desk, Washington, D.C. 20555 with a copy to the Regional Administrator, Region IV, and a copy to the NRC Resident Inspector, within 30 days of the date of the letter transmitting this Notice of Violation (Notice). This reply should be clearly marked as a "Reply to a Notice of Violation" and should include for each violation: (1) the reason for the violation or, if contested, the basis for disputing the violation, (2) the corrective steps that have been taken and the results achieved, (3) the corrective steps that will be taken to avoid further violations, and (4) the date when full compliance will be achieved. If an adequate reply is not received within the time specified in this Notice, an 204100150 920403 ADDCK 05000382

order may be issued to show cause why the license should not be modified, suspended, or revoked, or why such other action as may be proper should not be taken. Where good cause is shown, consideration will be given to extending the response time.

Dated at Arlington, Texas, this 3rd day of april

1992