VERMONT YANKEE NUCLEAR POWER CORPORATION



P.O. Box 157, Governor Hunt Road Vernon, Vermont 05354-0157 (802) 257-7711

> November 30, 1995 BVY 95-129

U.S. Nuclear Regulatory Commission Washington, D.C. 20555

Attn:

Document Control Desk

References:

Operating License DPR-28

Docket No. 50-271

Reportable Occurrence No. LER 95-017 Supp. 1

Dear Sir:

As defined by 10 CFR 50.73, we are reporting the attached Reportable Occurrence as LER 95-017, Supplement 1.

Very truly yours,

Robert J. Wanczyk

Plant Manager

RJW/dm

CC:

Regional Administrator

USNRC Region I

475 Allendale Road

King of Prussia, PA 19406

9512050010 951130 PDR ADDCK 05000271 TESS !

U.S. NUCLEAR REGULATORY COMMISSION

LICENSEE EVENT REPORT (LER)

APPROVED BY OMB NO. 3150-0104 EXPIRES 04/30/98

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS MANDATORY INFORMATION COLLECTION REQUEST: 50.0 HRS. REPORTED LESSONS LEARNED ARE INCORPORATED INTO THE LICENSING PROCESS AND FED BACK TO INDUSTRY. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (T-6 F33), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.

FACILITY NAME (1)

VERMONT YANKEE NUCLEAR POWER STATION

DOCKET MUMBER ()

PAGE (3) 01 OF 04

TITLE (4) Technical Specification 4.6.E Not Met Due to Components Not Included in the Inservice Test Program Scope

EVE	NT DATE	(5)	LER NUMBER (6)					REPORT DATE (7)				OTHER FACILITIES INVOLVED (8)						
MONTH	DAY	YEAR	YEAR	SEQUENTIA NUMBER	The second second	SION	MONT	TH DA	Y	YEAR	FAC	ILITY A	AME		DOCKET NO.(S 05000			
09	22	95	95	17	0	1	11	30		95	N/A							
OPERAT			THIS	S REPORT IS SU	BMITTED P	URSUA	NT TO	THE REQ	UIRE	MENTS	OF 10	CFR §:	CHECK	ONE OR	HORE (11)		
MODE (S	y)	N	20.	.2201(b)		20.22	03(a)	(2)(v)	X	50.7	3(a)(2)(i)		50.73()(2)(v	ii)		
POWER	(40)	400	20.	.2203(a)(1)		20.2203(a)(3)(i)				50.7	3(a)(2	(ii) 50.73(a)(2)(x)				
LEVEL ((10)	100	20.	.2203(a)(2)(i)		20.22	03(a)	(3)(11)		50.7	3(a)(2)(iii)		73.71	DOCKET NO. 05000 N/A HE OR MORE (11) 0.73(a)(2)(viii) 0.73(a)(2)(x) 3.71 OTHER Specify in Abstractor 366A) Include Area Contactor 366A			
***************************************		20.2203(a)(2)(ii)			20.2203(a)(4)				50.7	3(a)(2)(iv)	2)(v) (Speci		HER				
·····			20.	.2203(a)(2)(ii	2)(iii) 50.3			36(c)(1)		50.7	50.73(a)(2			Specify in Abstract				
	***************************************			.2203(a)(2)(iv)	50.36	6(c)(2)			50.7	50.73(a)(2							
			European Contract	LIC	ENSEE CON	TACT	FOR TH	IS LER	(12)	лфиистеприяти ловия			areada y an area Coun	Control Consultor DA				
NAME ROBER	RT J. WA	NCZYK, P	LANT MANA	AGER									ONE NO.		de Area	Code		
		COMPLET	E ONE LI	NE FOR EACH CO	MPONENT F	AILUR	E DESC	CRIBED I	N TH	IS REPO	ORT (1	3)	Mary and the state of the state					
CAUSE	SYSTEM	COMP	ONENT	MANUFACTURER	REPORTA TO NPR			CAUSE	SY	STEM	COMP	ONENT	MANUF	MANUFACTURER		THE RESERVE THE RE		
N/A								N/A										
N/A								N/A										
SUPPLEMENTAL REPORT EXPECTED (14)									T	and the same of th		PECTED		MO	DAY	YEAR		
YES (1)		omplete	EXPECTED	SUBMISSION DA	TE)	Х	NO				SLIBMI	(15)						

ABSTRACT (Limit to 1400 spaces, i.e., approximately 15 single-spaced typewritten lines) (16) During a review of the Vermont Yankee Inservice Test Program, questions arose regarding the basis for not including SR-13-25 (RCIC pump suction relief valve) and SR-23-34 (HPCI pump suction relief valve) in the IST program. Upon subsequent review, it was determined that SR-23-34 and SR-13-25 have a safety function to protect HPCI and RCIC pump suction pipework from overpressurization and should have been included within the scope of the IST program. As a result of this inquiry, a larger scope of valves with similar functions was subsequently reviewed for applicability. This subsequent review determined that SR-10-72A, SR-10-72B, SR-10-72C and SR-10-72D (Residual Heat Removal Pump Suction Relief Valves) also were not included within the scope of the IST Program. Additionally, during further review of components in the High Pressure Coolant Injection (HPCI) and Reactor Core Isolation Cooling (RCIC) systems, FCV-23-42, FCV-23-43, LCV-23-53, FCV-13-34, FCV-13-35 and LCV-13-32 (HPCI and RCIC Steam Line Condensate Pot Isolation and Level Control Valves) were identified as not being included in the IST program. These valves have safety functions to support the operation of the HPCI and RCIC systems. Since these valves were not included in the Vermont Yankee IST Program scope, the requirements of Technical Specification Surveillance Requirement 4.6.E were not met. An extension past the 30 day report date for revision 00 of this LER was granted by the Resident Inspector. It was determined that the cause of this event was due to an inadequate technical review performed during the 1993 program update. A Basis for Maintaining Operation was prepared and determined that the plant will continue to operate safely even though the subject valves were not tested in the Vermont Yankee IST program.

U.S. NUCLEAR REGULATORY COMMISSION

LICENSEE EVENT REPORT (LER)

APPROVED BY OMB NO. 3150-0104 EXPIRES 04/30/98

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS MANDATORY INFORMATION COLLECTION REQUEST: 50.0 HRS. REPORTED LESSONS LEAPNED ARE INCORPORATED INTO THE LICENSING PROCESS AND FED BACK TO INDUSTRY. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (T-6 F33), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.

FACILITY NAME (1)	DOCKET NUMBER (2)		P	AGE	(3)				
		YEAR	SEQUI	ENTIAL NU	JMBER	REV #			
VERMONT YANKEE NUCLEAR POWER CORPORATION	05000271	95	**	17		01	02	OF	04

TEXT (If more space is required, use additional copies of NRC Form 366A) (17)

DESCRIPTION OF EVENT

On 09/22/95 with the plant operating at 100% power, questions arose during a review of the Vermont Yankee Inservice Test Program regarding the basis for not including SR-13-25 (RCIC pump suction relief valve) and SR-23-34 (HPCI pump suction relief valve) in the IST program. It was determined that SR-23-34 and SR-13-25 have a safety function to protect HPCI and RCIC pump suction pipework from overpressurization. The HPCI and RCIC pump suction pipework are required to mitigate the consequences of an accident.

As a result of this inquiry, a larger scope of valves was reviewed for applicability. This review determined that SR-10-72A, SR-10-72B, SR-10-72C and SR-10-72D (Residual Heat Removal Pump Suction Relief Valves) also were not tested in the VY IST Program. These valves function to protect the RHR pump suction pipework from overpressurization. The RHR pump suction pipework is required to mitigate the consequences of an accident.

Additionally, during further review of components in the High Pressure Coolant Injection (HPCI) and Reactor Core Isolation Cooling (RCIC) systems, FCV-23-42, FCV-23-43, LCV-23-53, FCV-13-34, FCV-13-35 and LCV-13-32 (HPCI and RCIC Steam Line Condensate Pot Isolation and Level Control Valves) were identified as not being included in the IST program. These valves have safety functions to support the operation of the HPCI and RCIC systems.

ANALYSIS OF EVENT

Section 4.6.E of the Vermont Yankee Technical Specifications specifies that inservice testing (IST) of safety related pumps and valves be performed in accordance with Section XI of ASME Boiler and Pressure Vessel Code and applicable Addenda as required by 10 CFR 50, Section 50.55a, except where specific written relief has been granted by the NRC Pursuant to 10 CFR 50, Section 50.55a. Vermont Yankee adopted the 1990 Edition of Section XI during its required third interval update in 1993. Subsections IWV and IWP of ASME Section XI reference the use of the ASME Operations and Maintenance (OM) Standards through the 1988 addenda (OMa-1988) for the testing requirements of pumps and valves. OMa-1988 Part 10 "Inservice Testing of Valves in Light-Water Reactor Power Plants" specifies in subsection 1.1 that "The pressure relief devices covered are those for protecting systems or portions of systems which perform a required function in shutting down a reactor to the cold shutdown condition, in maintaining the cold shutdown condition, or in mitigating the consequences of an accident."

Additionally, subsection 1.1 also states that "The active or passive valves covered are those which are required to perform a specific function in shutting down a reactor to the cold shutdown condition, in maintaining the cold shutdown condition, or in mitigating the consequences of an accident."

SR-13-25 (RCIC pump suction relief valve), SR-23-34 (HPCI pump suction relief valve), SR-10-72A, SR-10-72B, SR-10-72C and SR-10-72D (RHR pump suction relief valve(s)) protect portions of the RCIC, HPCI and RHR systems which perform a function in mitigating the consequences of an accident. FCV-23-42, FCV-23-43, LCV-23-53, FCV-13-34, FCV-13-35 and LCV-13-32 (HPCI and RCIC Steam Line Condensate Pot Isolation and Level Control Valves) have active functions to support the operation of the HPCI and RCIC systems which perform a function in mitigating the consequences of an accident.

Since these valves were not included in the Vermont Yankee IST program, the requirements of Vermont Yankee Technical Specification Requirement 4.6.E for these valves were not met.

A Basis for Maintaining Operation (BMO) was prepared and determined that the plant will continue to operate safely even though the subject valves were not tested in the Vermont Yankee IST program. It was determined in the BMO for the RHR, RCIC and HPCI relief valves that overpressurization of the RHR, HPCI and RCIC pipework was unlikely due to the limited sources of high pressure fluids and due to the administrative controls which prevent suction pipework isolation valves from being placed in the closed condition. Additionally, it was determined that the HPCI and RCIC Turbine Steam Line Drain Isolation

U.S. NUCLEAR REGULATORY COMMISSION

LICENSEE EVENT REPORT (LER)

APPROVED BY OMB NO. 3150-0104 EXPIRES 04/30/98

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS MANDATORY INFORMATION COLLECTION REQUEST: 50.0 HRS. REPORTED LESSONS LEARNED ARE INCORPORATED INTO THE LICENSING PROCESS AND FED BACK TO INDUSTRY. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (T-6 F33), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.

FACILITY NAME (1)	DOCKET NUMBER (2)	LER MINNBER (6)						AGE	(3)	
		YEAR SEQUENTIAL NUMBER		REV #						
VERMONT YANKEE NUCLEAR POWER CORPORATION	05000271	95		17		01	03	OF	04	

TEXT (If more space is required, use additional copies of NRC Form 366A) (17)

and Level Control Valves would perform as required since their performance is monitored during period surveillance testing of the HPCI and RCIC pumps. Therefore, at no time as a result of these IST program deficiencies were the health and safety of the public affected.

CAUSE OF EVENT

Root Cause:

Vermont Yankee has determined that the reason for not including the subject valves in the IST program was due to an inadequate technical review during a program update in 1993.

Contributing Causes:

- The IST program basis document which was used as an aid in determining IST program scope received no formal review nor was it maintained up to date during subsequent IST program revisions.
- 2. Management oversight of IST program activities was ineffective.
- 3. IST program responsibilities are fragmented and decentralized.

CORRECTIVE ACTIONS

Short Term:

- As a result of the identified program scope deficiencies an operability assessment was performed for the subject systems. This assessment concluded that the plant could continue to operate safely until the corrective actions were completed.
- Vermont Yankee will perform a comprehensive review of the IST program scope to verify compliance with ASME/ANSI OMa-1988 Parts 1, 6 and 10. This action is expected to be completed by 12/31/95.
- A re-organization of the Vermont Yankee Engineering Department is currently in progress. As part of this reorganization, Vermont Yankee is assuring that engineering program coordination and program oversight are
 appropriately defined. This action is expected to be completed by 12/31/95.
- Vermont Yankee will add FCV-23-42, FCV-23-43, LCV-23-53, FCV-13-34, FCV-13-35 and LCV-13-32 (HPCI and RCIC Steam Line Condensate Pot Isolation and Level Control Valves) to the IST program and begin testing in accordance with the requirements of the Code. This action is expected to be completed by 12/31/95.

Long Term:

- Vermont Yankee will upgrade the existing IST program basis document to describe the methodology used for preparing the IST program, to provide a basis for including components in the IST program or excluding components from the IST program and to define the basis for the testing applied to each component. This action is expected to be completed by 10/01/96.
- 2. Vermont Yankee will add SR-13-25, SR-23-34, SR-10-72A, SR-10-72B SR-10-72C and SR-10-72D (RCIC, HPCI and

U.S. NUCLEAR REGULATORY COMMISSION

LICENSEE EVENT REPORT (LER)

APPROVED BY OMB NO. 3150-0104 EXPIRES 04/30/98

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS MANDATORY INFORMATION COLLECTION REQUEST: 50.0 HRS. REPORTED LESSONS LEARNED ARE INCORPORATED INTO THE LICENSING PROCESS AND FED BACK TO INDUSTRY. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (T-6 F33), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)						PAGE		
		YEAR SEQUENTIAL NUMBER		MEER	REV #		-			
VERMONT YANKEE NUCLEAR POWER CORPORATION	05000271	95		17		01	04	OF	04	

TEXT (If more space is required, use additional copies of NRC Form 366A) (17)

RHR pump suction relief valves) to the IST program and begin testing in accordance with the requirements of the code. This action is expected to be completed prior to the end of the 1996 refueling outage.

ADDITIONAL INFORMATION

No similar events regarding IST program scope deficiencies have been reported to the Commission in the past n. e years. This event was identified by the NRC as a violation of the requirements of 10 CFR 50.55a in Inspection Report 95-2; dated 10/20/95. Vermont Yankee responded to this violation by letter (BVY 95-124) dated 11/16/95.