

Florida Power CORPORATION Crystal Fliver Unit 3 Docket No. 50-302

February 8, 1996 3F0296-10

U. S. Nuclear Regulatory Commission Attention: Document Control Desk Washington, D. C. 20555

Subject: Licensee Event Report (LER) 96-001-00

Dear Sir:

Please find the enclosed Licensee Event Report (LER) 96-001-00. This report is submitted by Florida Power Corporation in accordance with 10 CFR 50.73. A supplement to this report is expected to be provided by March 8, 1996.

Sincerely,

BJ Hielle

B. J. Hickle, Director

Nuclear Plant Operations

TWC:ff

Attachment

xc: Regional Administrator, Region II Project Manager, NRR Senior Resident Inspector

150020 9602150043 960208 PDR ADOCK 05000302 S PDR

TERR

LICENSEE EVENT REPORT (LER)

EXPIRES 5/31/95

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HOURS, FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE RECORDS AND REPORTS MANAGEMENT BRANCH (MNBB 7714). U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON DC 20503.

FA	HLIT	Y NAME ((1)		ar months			OR OTHER DESIGNATION OF THE PERSON OF THE PE	CHIEFFE CHIE				-	-		COLUMN TO STATE OF THE STATE OF		-			hass-myan	-	and the later with	DO	CKE	MUI	MBE	R (2)		*****	-	-	*******	PAGE	E (3)	**********
				CR	YST	TAL RI	IVE	RU	INIT	3	(CR	-3)												0	5	0	0	0	3	1	0	2		OF	personne	-
TIT	LE (4		rson	nel	Erro	or by C	ont	ract	or F	lesi	ults i	n Op	oer	ation	0	utsic	de 1	00	CFR5	0 App	enc	lix R	Des	sign	Bas	is										
	EVEI	NT DATE ((5)			1	ERI	NUME	BER (6)				REP	OF	RT DAT	E (7)		T					ОТ	"ER	FACI	LITIE	ES NA	VOLV	/ED	(8)		-	ara-mana hay		
							SE	QUEN	ITIAL		REV	ISION									FACIL	ITY N	AME	5		-		Di	OCKE	ET I	NUM	BER	(S)			
MON	тн	DAY	YE	EAR	YE	EAR	N	UMB	ER		NUM	MBER	M	HTMO	-	DAY	Y	/EAI	R		N/A							0	5	1	0	0	0			
0	1	1 0	9	6	9	6	0	0	1		0	0	0	2	0	8 0	9	1	6		N/A							0	5	1	0	0	0	1		
		RATING		3	THIS	REPORT	TIS	SUBN	HTTE	DPL	JRSU/	ANT T	OT	HE REC	QUI	IREM	ENTS	OF	10 CF	R 5:	CHEC	KONE	ORM	ORE O	FTHE	FOLL	OWIN	(G)	(11)			-			
	MC	DDE (9)		3		20,402((b)						2	20.405(0	c)						50.7	3(a)(2)	(iv)						7	3.71	1(b)					
	POW					20.405((a)(1))(i)					5	50.36(c))(1)						50.7	3(a)(2)	(v)						7	3.71	1(0)					
	(10)		101	0		20.405((a)(1))(ii)					5	50.36(c))(2)						50.7	3(a)(2)	(vii)										rify in A			
						20.405((a)(1)	j(iii)					5	60.73(a))(2)((1)					50.7	3(a)(2)	(viii)(A	()						366A		in Te	ext, NA	C For	m	
						20.405((a)(1))(iv)				X	5	50.73(a))(2)((ii)					50.7	3(a)(2)	(viii)(E	3)												
						20.405((a)(1))(v)					5	50.73(a))(2)((iii)					50.7	3(a)(2)	(x)													
-							-						LIC	ENSE	EC	ONTA	CT F	OR	THIS	ER (12)															
NAM	E																								AD	EAC	ODE		EPH	ON	NE NI	IMB	EFI			
							T.V	W. C	Cato	hpc	ile, S	Br. N	uc	lear L	Lic	ensi	ing l	En	gine	er						5		1	1 6	1	3	- 1	4	6	0	1
	-		-	-	-		-	CO	MPLE	TE	ONE L	INE F	ORI	EACH	COI	MPON	IENT	FA	JLURE	IN THIS	REF	ORT (13)		1	1		1	1-	L				-	-	
CAU	SE	SYSTEM	CC	OMP	ONEN	п		NUFA	AC-	RE	PORT	ABLE	****					-		SYST		-	/PON	ENT			NUF				RTAE					
																						L	1	L												
																							1					L								
								SUF	PPLEI	MEN	TAL F	EPOF	RT E	EXPECT	TEC	2 (14)											PEC1				MONT	гн	DA	Y	YE	EAR
X	YES	S (If yes	- A. A. A. A. A.		EXPEC	CTED SUBN	MISSK	ON DA	TE)					Ь	N	NO											BMIS TE (1	SSION (5)			0	3	0	8	9	6

On January 10, 1996, Florida Power Corporation's (FPC) Crystal River Unit 3 (CR-3) was in MODE THREE (HOT STANDBY). During a walkdown to develop a modification for upgrading CR-3's Thermo-Lag fire barriers, an Appendix R separation problem was identified in that two conduits containing circuits for controlling "B" Train Emergency Feedwater flow to the steam generators were noted to pass through the same fire area as "A" Train circuits with no fire barrier protection in that Although the condition was initially determined not reportable, upon further review on January 11, 1996 while the unit was in MODE FOUR (HOT SHUTDOWN), a 4-hour prompt notification was made to identify a degraded condition while the plant was shutdown. This report documents the separation problem as a condition outside CR-3's design basis. A justification for continued operation was established based on the existence of continuous roving fire watches in the affected area. The cause of this event was cognitive personnel error by contractor personnel involved in preparing a modification to install conduit and cable during a 1985 refueling outage. Corrective actions will include revision to drawings, bringing affected circuits into compliance, field validation of Appendix R drawings and a self-assessment to determine the effectiveness of configuration controls covering multi-discipline modifications.

U.S. NUCLEAR REGULATORY COMMISSION

APPROVED OMB NO. 3150-0104

EXPIRES 5/31/95

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HOURS, FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE RECORDS AND REPORTS MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001.
AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON DC 20503.

· LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

SEQUENTIAL	DEMONDO	THE RESIDENCE OF THE PARTY AND ADDRESS OF THE
CRYSTAL RIVER UNIT 3 (CR-3)	REVISION NUMBER	
0 5 0 0 0 3 0 2 9 6 0 0 1	010	0 2 0 0 8

TEXT (If more space is required. Use additional NRC Form 366A's (17)

EVENT DESCRIPTION

On January 10, 1996, Florida Power Corporation's (FPC) Crystal River Unit 3 (CR-3) was in MODE THREE (HOT STANDBY). The plant was in the process of shutting down due to a forced outage associated with an earlier saltwater intrusion through a condenser tube leak. During a walkdown by personnel involved in developing a modification for upgrading CR-3's Thermo-Lag fire barriers, it was noted that conduits EFS56 and EFS57, which contain "B" Train circuits for Emergency Feedwater System [BA] (EFW) components, were routed through the "A" 480-Volt Engineered Safeguards (ES) Switchgear Room. The portion of the "B" Train conduits in the "A" Switchgear Room are not protected by fire barriers and are within 20 feet of redundant "A" train circuits. See Figure 1.

Conduits EFS56 and EFS57 contain circuits which provide flow control signals and motive power to controllers [BA,FC] for the "B" train Emergency Feedwater Flow Control Valves [BA,FCV]. The redundant "A" train circuits are associated with controllers for "A" train Emergency Feedwater Flow Control Valves. A Problem Report was generated to identify a noncompliance with 10CFR50 Appendix R, Section III.G.2.b separation criteria in that circuits and components for both trains of Emergency Feedwater are located in the same fire area and both trains of Emergency Feedwater are subject to loss of flow control if a fire occurred. The Problem Report was initially considered not to be reportable on the basis that the conduit was in the confirmed route of the continuous roving fire watch established in response to NRC Bulletin 92-01 "Failure of Thermo-lag 330 Fire Barrier System to Perform its Specified Fire Endurance Function".

Upon further review of the Problem Report on January 11, 1996, while the unit was in MODE FOUR (HOT SHUTDOWN) it was determined the condition warranted a 4-hour report in accordance with 10CFR50.72 since the installed condition did not conform with 10CFR50 Appendix R during the time period from 1985 when the conduits were installed, to the establishment of the compensatory fire watch in 1992. The notification was made at 1828 hours via the Non-Emergency Event Notification system in accordance with 10CFR50.72(b)(2)(i) as a degraded condition found while the reactor was shutdown and was assigned Event Number 29826.

This report is being submitted in accordance with 10CFR50.73(a)(2)(ii)(B) to describe a condition outside the design basis of CR-3 with regard to 10CFR50 Appendix R Fire analyses during the time period described above.

EVENT EVALUATION

Train "B" Emergency Feedwater Valves EFV-55 and EFV-56 and Train "A" valves EFV-57 and EFV-58 control flow and level for various design basis accidents including Loss of Main Feedwater, Main Feedwater Line Break, Main Steam Line Break, and Loss of Coolant Accidents (LOCA). These flow control valves are part of the

U.S. NUCLEAR REGULATORY COMMISSION

APPROVED OMB NO. 3150-0104

EXPIRES 5/31/95

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION P'..QUEST: 50.0 HOURS, FORWARD COMMENTS REGARDING BU'..DEN ESTIMATE TO THE RECORDS AND REPORTS MANAGEM'..NT BRANCH (MNBB 7714). U.S. NUCLEAR REGULATORY COMMISS' JN, WASHINGTON, DC 20555-0001, AND TO THE PAPERWO' & REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON DC 20503.

· LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME (1)	DOCKET NUMBER (2) LER I UMBER (6)	PAGE (3)
CRYSTAL RIVER UNIT 3 (CR-3)	YEAR SEG JENTIAL REVISION NUMBER NUMBER	P P
	0 5 0 0 0 3 0 2 9 6 0 4 1 0	0 0 3 0 0 0 8

TEXT (If more space is required, Use additional NRC Form 366A's (17)

Emergency Feedwater [BA] (EFW) system which provides secondary coolant to the Once Through Steam Generators [AB.SG] (OTSG) at a rate sufficient to remove decay heat in the event the Main Feedwater System [SJ] is unable to perform this function. EFW is also used to promote and enhance natural circulation in the Reactor Coolant System [AB] (RCS). The Emergency Feedwate: Initiation and Control System [JB] (EFIC) is the system that determines the need for EFW based on plant conditions. It initiates EFW by starting the pumps and controlling the valves to provide a flow path, and then controls flowrate in order to maintain water level in the steam generators. Once the system is operating, EFIC will automatically control the level in the OTSG's at the appropriate setpoint depending upon plant conditions. EFIC will also control the valves to limit the OTSG fill rate. This is done to minimize overcooling of the Reactor Coolant System when EFW is initiated. In order to prevent excessive EFW flow, which could cause damage to the EFW pumps or to the steam generator tubes, the EFW flow control valves will automatically reduce EFW flow when an EFW actuation occurs.

The control circuits for the EFW Flow Control Valves are necessary for safe shutdown and are subject to the requirements of 10CFR50 Appendix R Section III.G. This section addresses requirements for protection features needed to ensure the train of a safe shutdown system is free of fire damage. CR-3's design basis requires separation by a fire barrier with a 3-hour rating, or separation by horizontal distance of more than 20 feet with no intervening combustibles or fire hazards, or enclosure in a fire barrier having a 1-hour rating. In the second and third cases, the area must also be equipped with fire detection and automatic fire suppression. CR-3 complied with the enclosure requirements by use of a fire resistive material called Thermo-Lag 330. As noted above, and as shown on Figure 1, Conduits EFS56 and EFS57, which contain control power and instrumentation circuits for the "B" train EFW flow control valves, are routed with no protection through the "A" 480 Volt Engineered Safeguards (ES) Switchgear Room within 20 horizontal feet of the controllers for the "A" train control valves. The 480V Switchgear Rooms are 3-hour fire areas. Conduits EFS56 and EFS57 were intended to be routed to the "B" 480 Volt ES Switchgear Room through the corridor area from EFIC Room "B". The Corridor area is a 1-hour fire area and the portion of EFS56 and EFS57 in this area is coated with Thermo-Lag. If there was a fire in the "A" 480 ES Switchgear Room in the area of the EFV-57 and EFV-58 controllers and the as-installed conduits EFS56 and EFS57, then any flow control or level fill rate of emergency feedwater could be lost. The valves would fail 100 per cent open on loss of control signal or loss of power. There would be no flow control to limit EFW Pump runout and cavitation. There would be no flow control to limit RCS overcooling and there would be a potential for losing RCS Subcooling Margin due to loss of pressurizer level in the RCS.

An operability assessment of the EFW System was conducted in accordance with Compliance Procedure CP-150, "Identifying and Processing Operability Concerns." This procedure provides a structured approach toward determining the operability of plant components required for accident mitigation and safe shutdown of the

U.S. NUCLEAR REGULATORY COMMISSION

APPROVED OMB NO. 3150-0104

EXPIRES 5/31/95

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HOURS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE RECORDS AND REPORTS MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON DC 20503.

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME (1)	DOCKET NUMBER (2)										LER NUMBER (6)										PAGE (3)			
CRYSTAL RIVER UNIT 3 (CR-3)										Y	EAR			MBER	U.		REVIS	HON						
	0	j	5	0	0	0	3	0	2	9	6		0	0	1		0	0	0	4	OF	0	8	

TEXT (If more space is required, Use additional NRC Form 366A's (17)

plant. The assessment provided a justification for continued operation which recognized the existence of continuous roving fire watches that include the "A" 480 Volt ES Switchgear Room. These fire watches had been established in response to NRC concerns which showed Thermo-Lag material to be deficient. The operability assessment also noted the fire watch in the "A" 480V ES Switchgear Room supplements the installed Pyrotronics fire detection system in the area. The Shift Supervisor on Duty (SSOD) accepted the operability assessment on January 15, 1996 and closed the concern.

CAUSE

The primary cause of this event was cognitive personnel error by contractor engineering personnel. Conduits EFS56 and EFS57 were installed in 1985 during Refuel 5 as part of a field change to modification 88-10-66-08A "EFIC Electrical Conduit and Cable Installation". The field change was a multi-discipline (electrical and structural) change initiated by the electrical discipline for the purpose of addressing Appendix R. After the electrical design was completed, structural engineering completed the balance of the design for the conduit installation and approved the change notice. The structural design engineer selected a different route for conduit supports from that depicted on layout sketches provided by electrical engineering. It is surmised that this route was selected to take advantage of existing conduit supports and/or due to interferences present in the route selected by electrical engineering. The structural engineer was apparently not aware of the impact this change had on Appendix R criteria. Further, design verification of the field change did not include a final review by electrical engineering.

A secondary cause of this event was the failure to identify the conduit layout discrepancy during the installation and completion of modification 82-10-19-04 which was also installed during Refuel 5 for the purpose of Thermo-Lag installation.

Two other factors may have contributed to this event or the failure to discover the discrepancy. One was insufficient procedures in place during Refuel 5 to guide interface between engineering disciplines. The current guidelines in Nuclear Engineering Procedure (NEP) 210 "Modification Approval Records", requires, for a multi-discipline modification package, the co-approval signatures of the Design Engineers and Verification Engineers involved in developing the MAR; however, this was not specifically addressed in the engineering procedures in effect during Refuel 5. Another factor was that Appendix R drawings were developed using conduit layout drawings which are diagrammatic and do not necessarily depict the exact route. Since the conduit layout drawings were asbuilt according to the sketches provided by electrical engineering at a different time than the conduit support drawings, which were as-built per the sketches provided by structural engineering, a comparison was not performed and therefore, the discrepancy was not identified during the as-building stage.

U.S. NUCLEAR REGULATORY COMMISSION

APPROVED OMB NO. 3150-0104

EXPIRES 5/31/95

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HOURS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE RECORDS AND REPORTS MANAGEMENT BRANCH (MNBB 7714). U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON DC 20503.

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME (1)	DOCKET NUMBER (2)										L	ERN	UMB	ER (6	3)			PAGE (3)				
CRYSTAL RIVER UNIT 3 (CR-3)									Y	EAR		SEQU	MBER	L.		REVIS	ER					
	0	5	0	0	0	3	0	2	9	6		0	0	1		0	0	0	5	OF	0	8

TEXT (If more space is required, Use additional NRC Form 366A's (17)

IMMEDIATE CORRECTIVE ACTION

When the Problem Report for this condition was first presented to the Shift Manager on January 10, 1996 it was confirmed the separation discrepancy was in a fire area covered by the roving fire watch.

ADDITIONAL CORRECTIVE ACTION

- Drawings which indicate the routing of Conduits EFS56 and EFS57 have been revised to depict the correct routing.
- FPC will conduct a field validation of Appendix R drawings using a samplebased approach. The criteria, schedule and resources required for this field validation will be established by February 28, 1996.
- 3. Circuits contained in Conduits EFS56 and EFS57 will be brought back into compliance with 10CFR50 Appendix R. This may include wrapping with Mecatiss per the commitment described in FPC letter 3F1295-05 to NRC dated December 21, 1995. Consistent with commitments in the letter for Mecatiss wrapping, compliance with Appendix R will be achieved by the end of 1996.

ACTION TO PREVENT RECURRENCE

Both short-term and long-term actions have been identified as appropriate to address the root cause for this event. A copy of the initiating Problem Report will be provided to Nuclear Engineering Design personnel to re-emphasize the need for proper design interface between engineering disciplines. In addition to this, a self-assessment will be performed by April 30, 1996 of the effectiveness of existing (enhanced) configuration controls in the area of design interface between engineering disciplines. Additional actions to prevent recurrence may be identified at that time based on the results of the assessment.

PREVIOUS SIMILAR EVENTS

LER 89-39 reported a similar event. In this LER, it was discovered that a fuse was relocated to satisfy Appendix R requirements; however, the new location did not fulfill the desired objective. The cause of the separation problem was identified as design error in that personnel preparing and reviewing a field change for installation in Refuel 5 were not knowledgeable of Appendix R Separation criteria. The actions to prevent recurrence as identified in the ER were to review all modifications subsequent to Refuel 5 to assure Appendix R separation criteria was met. The evaluation of the problem report which initiated the LER noted it was considered to an isolated case of misinterpretation of Appendix R design requirements by field personnel.

U.S. NUCLEAR REGULATORY COMMISSION

APPROVED OMB NO. 3150-0104

EXPIRES 5/31/95

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HOURS, FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE RECORDS AND REPORTS MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20556-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON DC 2050S.

* LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME (1)	DOCKET NUMBER (2)									LER NUMBER (6)									PAGE (3)				
CRYSTAL RIVER UNIT 3 (CR-3)									1	EAR		SEQ				REVI	SION BER						
	0	5	0	0	0	3	0	2	9	6	-	0	0	1		0	10	0	6	OF	0	8	

TEXT (If more space is required, Use additional NRC Form 366A's (17)

ATTACHMENT

Attachment 1 -Abbreviations, Definitions and Acronyms

Figure 1 - Control Complex Elevation 124 Fire Areas

U.S. NUCLEAR REGULATORY COMMISSION

APPROVED OMB NO. 3150-0104

EXPIRES 5/31/95

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HOURS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE RECORDS AND REPORTS MANAGEMENT BRANCH (MNBB 7714). U.S. NUCLEAR REGULATORY COMMISSION. WASHINGTON, DC 20555-0001. AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON DC 20503.

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

CRYSTAL RIVER UNIT 3 (CR-3) VEAR SEQUENTIAL NUMBER REVISION NUMBER NUMBER	FACILITY NAME (1)	DOCKET NUMBER (2) LER	NUMBER (6)	PAGE (3)
0 5 0 0 0 3 0 2 9 60 0 40 0 40 0 7 05 6	CRYSTAL RIVER UNIT 3 (CR-3)			
		0 5 0 0 0 3 0 2 9 6 0	0 0 1 - 0 0 0	7 OF 0 8

TEXT (If more space is required. Use additional NRC Form 366A's (17)

ATTACHMENT 1 - ABBREVIATIONS, DEFINITIONS AND ACRONYMS

10 CFR 50 "Fire Protection Program for Nuclear Facilities" Appendix R

CR-3 Crystal River Unit 3

EFIC Emergency Feedwater Initiation and Control

EFW Emergency Feedwater

FPC Florida Power Corporation

LOCA Loss of Coolant Accident

MODE THREE HOT STANDBY

MODE FOUR HOT SHUTDOWN

OTSG Once Through Steam Generator

Problem Report A Problem Report documents a condition or event which impacts CR-3 and warrants evaluation, root cause analysis, or

corrective actions beyond what it would receive if documented

and processed by other methods.

NOTES: ITS defined terms appear capitalized in LER text {e.g. MODE ONE}

Defined terms/acronyms/abbreviations appear in parentheses when first used (e.g. Reactor Building (RB)).

EI!S codes appear in square brackets (e.g. Makeup Tank [CB,TK])

TEXT CONTINUATION

DOCKET NUMBER (2) cn 0 0 0 ω 0 10 9 o 0 0 1 0 0 8 OF 0 PAGE (3)

TEXT

FACILITY NAME (1)

CRYSTAL RIVER UNIT

w

(CR-3)

EFIG Room "D" EFIC Room "B" Conduit Path Corridor As Designed Area EFS-11 Conduit Path Relay/CRD II/As installed Room EF5-58 EFV-SS-EFV-SE--B" Train Centraliers EFV-57 EFV-58 "A" Trois -EFS-57 -EFS-58 Cestrellers DPDP-18 -DPDP-SA ABB V Switchgent Bas 18 488 V Switchgear Bas IA 480 V ESB Switchgear Room 480 Y ESA Switchgear Room

CONTROL COMPLEX EL. 124' FIRE AREAS

FIGURE 1